

Hammond Autowerks

4349 B Montgomery Dr.
 Santa Rosa, CA. 95405
 Phone: 707-538-4325

INVOICE

13054

Org. Est. # 049781

Invoice from History

Work Completed : 05/06/2016

Date: 01/29/2018

1978 Mercedes-Benz - 450SL - 4.5L, V8 (276CI) VIN(Not Availa
 Lic # : 987 VXY Odometer In : 36113

Santa Rosa, CA 95409

VIN # : 10704412047701

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
Bulb (12v - 5w) - license plate 000000-002723	1.00	2.20	2.20	Per customer, check for oil leaks; check and advise Found the valve cover gaskets leaking and cracked. (Replaced)	n/c
Ignition Wire Set - With Coil Wire 113D/8	1.00	177.58	177.58	Found the transmission pan leaking. (Replaced) Per customer, check all hoses and belts; check and advise	n/c
SPARK PLUG 7905	8.00	4.95	39.60	Found the alternator belt cracking - suggest replacing all belts. (Replaced) Hoses look ok at this time.	
Valve Cover Gasket 116 016 13 21	1.00	13.35	13.35	Free Safety Inspection	n/c
Valve Cover Gasket 116 016 14 21	1.00	14.50	14.50	Check lamps. Check for leaks. Test battery. Check tire pressure and set to proper pressure. Check tire tread. Check spare tire. Visual Brake Inspection. ***FOUND***	
BG - Brake Fluid 84032	1.00	17.33	17.33	Front brake pads 6mm, rear brake pads 7mm. Front rotors 21mm, rear rotors 10mm. Brake fluid >4% moisture, recommend a brake fluid flush. (Replaced brake fluid)	
Idler Arm Repair Kit 126 460 08 19	1.00	28.46	28.46	Battery tested good.	
Tie Rod Assembly-Center NLA 7.15 107 460 06 05	1.00	90.00	90.00	Front tires 7mm, rear tires 6mm. Rear tires are dry cracking - suggest replacing. (Replaced rear tires)	
Tie Rod Assembly-Left and Right 107 330 01 03	2.00	50.88	101.76	The muffler is making noise - suggest taking to muffler shop for repairs.	
Ball Joint-Left Lower 115 333 11 27	1.00	50.00	50.00	The inner and outer tie rods have excessive play. (Replaced) The idler arm has play.(Replaced)	
Drive Belt-Alternator 10 X 1000	1.00	9.40	9.40	The left side lower ball joint has excessive play. (Replaced) The rear marker light is inoperable - replaced.	
Drive Belt-Water Pump and Power Steering 10 X 1200	2.00	12.82	25.64	Spark plugs and wires should be replaced due to wear.(Replaced) Check and adjust tire pressure to vehicle specification.	n/c
Drive Belt-Air Pump 10 X 900	1.00	8.95	8.95	Front tires set to 32psi, rear tires set to 36psi Per customer, requested Hammond plate frames; Installed front and rear frames.	n/c
Drive Belt - Air Conditioning 13 X 868	1.00	11.98	11.98	SPARK PLUGS - Remove & Replace - All Applicable Models	n/c
BG - Universal Synthetic ATF 31216	7.00	0.00	n/c	Removed and replaced all spark plugs	
BG - ATC Plus 310	1.00	15.73	15.73	SPARK PLUG WIRE SET - Remove & Replace - All Applicable Models	200.00
AT Filter Kit 109 270 02 98	1.00	24.75	24.75	Removed and replaced the spark plug wires.	
Cooper Trendsetter SE 2057514 40K Warranty 95K 440 A CP01920754 01324	2.00	107.13	214.26	VALVE COVER GASKET - Remove & Replace - Both *reduced from 1.3 for over lap in labor Removed and replaced both valve cover gaskets.	75.00
Tire Fee 1	2.00	1.75	3.50	Perform Brake Flush	100.00
Distributor Cap 03 120	1.00	100.48	100.48	Check brake fluid for moisture and contamination. Inspect all hydraulic lines and hoses. Inspect calipers and wheel cylinders (when applicable). Inspect master cylinder and cap. Flush entire brake system including master cylinder, calipers, wheel cylinders until clean. Reset indicator where applicable.	
Distributor Rotor 04 018	1.00	32.06	32.06	IDLER ARM OR INTER ROD - Remove & Replace - All Applicable Models - [DOES NOT include alignment.] Removed and replaced the idler arm bushing.	225.00
				DRAG LINK OR CENTER LINK - Remove & Replace - All Applicable Models - [DOES NOT include alignment.]	100.00

Visit us on the web : www.hammondautowerks.com

Our Email Address: hammondautowerks@att.net

Hammond Autowerks
 4349 B Montgomery Dr.
 Santa Rosa, CA. 95405
 Phone: 707-538-4325

INVOICE

13054

Org. Est. # 049781

Invoice from History

Work Completed : 05/06/2016 Date: 01/29/2018

1978 Mercedes-Benz - 450SL - 4.5L, V8 (276CI) VIN(Not Availa
 Lic # : 987 VXY Odometer In : 36113

Santa Rosa, CA 95409
 Home all

VIN # : 10704412047701

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
WURTH MULTI PURPOSE SOLVENT 089093000	2.00	5.65	11.30	Removed and replaced the center link	
				TIE ROD &/OR ENDS - Remove & Replace - One - [Includes: Adjust toe-in only. NOTE: Deduct .4 if alignment is also performed.] *deducted .4 due to alignment	62.50
				Removed and replaced the left tie rod	
				TIE ROD &/OR ENDS - Remove & Replace - Each Additional - [Includes: Adjust toe-in only. NOTE: Deduct .4 if alignment is also performed.]	37.50
				Removed and replaced the right tie rod	
				BALL JOINT - Remove & Replace - One Side,Lower - [Includes: R&I Control Arm where necessary.]	312.50
				Removed and replaced the left lower ball joint	
				Alignment	83.50
				A/C COMPRESSOR DRIVE BELT - Remove & Replace - w/Air Pump - [Includes: Serpentine type.]	n/c
				Removed and replaced the A/C compressor drive belt.	
				ALTERNATOR DRIVE BELT - Remove & Replace - All Applicable Models - [Includes: Serpentine type.]	n/c
				Removed and replaced the alternator drive belt.	
				POWER STEERING PUMP DRIVE BELT - Remove & Replace - All Applicable Models - [Includes: Serpentine type.]	112.50
				Removed and replaced the power steering drive belt.	
				WATER PUMP DRIVE BELT - Remove & Replace - All Applicable Models	n/c
				Removed and replaced the water pump drive belt.	
				Transmission Service	156.25
				Remove and replace transmission filter kit, and transmission fluid.	
				MOUNT AND BALANCE 2 TIRES	50.00
				Mounted and balance 2 rear tires. Changed the direction of the front tires to have the white wall facing inside to match new rear tires.	
				DISTRIBUTOR CAP - Remove & Replace - All Applicable Models	62.50
				Removed and replaced the distributor cap and rotor. 5/5 830am ordered cap ssf and rotor wp -marc	
				Hazardous Materials	5.00

Hammond Autowerks
 4349 B Montgomery Dr.
 Santa Rosa, CA. 95405
 Phone: 707-538-4325

INVOICE

13054

Org. Est. # 049781

Invoice from History

Work Completed : 05/06/2016 Date: 01/29/2018

1978 Mercedes-Benz - 450SL - 4.5L, V8 (276CI) VIN(Not Availa
 Lic # : 987 VXY Odometer In : 36113

Santa Rosa, CA 95409

F VIN # : 10704412047701

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
---------------------------	-----	------	-----	-------------------	-----

Org. Estimate	0.00	Revisions	3,065.90	Current Estimate	3,065.90
---------------	------	-----------	----------	------------------	----------

Revision # 1, Previous Estimate Amount: 0.00, Additional Cost: 285187, Revised Estimate: 285187, Parts: \$996.43 Labor: \$168125 Sublet: \$83.50 Taxes & Fees: \$90.69 Authorized by - Allen, Michael, Date - 5/3/2016, Time - 11:27 AM, Initiated By - Shop, Written By - Winslow, Kayla, Reason - Repairs needed, Phone Number - Home: 707-695-6454xCell
 Revision # 2, Previous Estimate Amount: 2848.37, Additional Cost: 2.39, Revised Estimate: 2850.76, Parts: \$2.20 Labor: \$0.00 Sublet: \$0.00 Taxes & Fees: \$0.19 Authorized by - Allen, Michael, Date - 5/3/2016, Time - 11:27 AM, Initiated By - Shop, Written By - Winslow, Kayla, Reason - Repairs needed, Phone Number - Home: 707-695-6454xCell
 Revision # 3, Previous Estimate Amount: 2850.76, Additional Cost: 21164, Revised Estimate: 306240, Parts: \$132.54 Labor: \$62.50 Sublet: \$0.00 Taxes & Fees: \$16.60 Authorized by - Allen, Michael, Date - 5/5/2016, Time - 8:34 AM, Initiated By - Shop, Written By - Winslow, Kayla, Reason - Cap and rotor have corrosion, Phone Number - Home: 707-695-6454xCell

Labor:	1,493.75
Parts:	989.33
Sublet:	83.50
Fee(s):	8.50
SubTotal:	2,575.08
Tax:	86.57
Total:	2,661.65
Bal Due:	\$0.00

[Payments - MasterCard - \$2,661.65]

Vehicle Received: 5/3/2016

Customer Number : 6671

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one years or 12,000 miles whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

Upon notification of completion of repairs, a \$50 per day storage fee will be charged.

A \$150 per day fee will be charged should a Loaner Car not be returned on the agreed upon day.

Signature _____ Date _____

Visit us on the web : www.hammondautowerks.com

Our Email Address: hammondautowerks@att.net

This document was created with Win2PDF available at <http://www.win2pdf.com>.
The unregistered version of Win2PDF is for evaluation or non-commercial use only.
This page will not be added after purchasing Win2PDF.

Hammond Autowerks
 4349 B Montgomery Dr.
 Santa Rosa, CA. 95405
 Phone: 707-538-4325

INVOICE

13798

Org. Est. # 050687

Invoice from History

Work Completed : 08/04/2016 Date: 01/29/2018

1978 Mercedes-Benz - 450SL - 4.5L, V8 (276Cl) VIN(Not Availa
 Lic # : 987 VXY Odometer In : 36300

Santa Rosa, CA 95409
 Home

VIN # : 10704412047701

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
servo update kit (SSF) 22 7550 999	1.00	699.00	699.00	Per customer, AC inoperable - not sure about heater and defrost; check and advise	n/c
Auxiliary Water Pump 000 835 69 64	1.00	105.69	105.69	Found A/C servo to be non responsive and leaking, aux pump also inop.System may have other issues but un able to determine extending issues untill servo and pump are replaced	
Coolant/Antifreeze - 1 Gallon (Blue) Q 1 03 0004	1.00	23.50	23.50	Check and adjust tire pressure to vehicle specification.	n/c
Medium Hose Clamp clamp2	4.00	2.00	8.00	replace servo with updated unit and pump	405.00
				Removed and replaced the servo and auxiliary water pump. A/C now works but there is no heat. Found the in car temp sensor for heat, wires were cut off - most likely when the dash cover was installed. Need more time to repair wires. Also suspect the vacuum pod in the heater box is inoperable causing the center vents to not work.	
				Time repair in car temp sensor wires	135.00
				Connected wires from inside air temp sensor to wires running to new ac computer. After connecting wires heat and air work properly.	
				Hazardous Materials	5.00

Org. Estimate 135.00 Revisions 2,018.61 Current Estimate 2,153.61

Revision # 1, Previous Estimate Amount: 135.00, Additional Cost: 1748.61, Revised Estimate: 1883.61, Parts: \$1235.50 Labor: \$405.00 Sublet: \$0.00
 Taxes & Fees: \$108.11 Authorized by - Allen, Michael, Date - 7/26/2016, Time - 1:49 PM, Initiated By - Shop, Written By - Winslow, Kayla, Reason - A/C repair, Phone Number - Home: 707-695-6454xCell
 Revision # 2, Previous Estimate Amount: 1883.61, Additional Cost: 270.00, Revised Estimate: 2153.61, Parts: \$0.00 Labor: \$270.00 Sublet: \$0.00
 Taxes & Fees: \$0.00 Authorized by - Allen, Michael, Date - 8/3/2016, Time - 1:27 PM, Initiated By - Shop, Written By - Winslow, Kayla, Phone Number - Customer Called In

Labor:	540.00
Parts:	836.19
HazMat:	5.00
SubTotal:	1,381.19
Tax:	73.17
Total:	1,454.36
Bal Due:	\$0.00

[Payments - MasterCard - \$1,454.36]

Vehicle Received: 7/26/2016

Customer Number : 6671

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one years or 12,000 miles whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

Upon notification of completion of repairs, a \$50 per day storage fee will be charged.

A \$150 per day fee will be charged should a Loaner Car not be returned on the agreed upon day.

Signature _____ Date _____

Visit us on the web : www.hammondautowerks.com

Our Email Address: hammondautowerks@att.net

Service Advisor : Winslow, Kayla, Tech : Please Select, Technician; Hammond, Ci

This document was created with Win2PDF available at <http://www.win2pdf.com>.
The unregistered version of Win2PDF is for evaluation or non-commercial use only.
This page will not be added after purchasing Win2PDF.

Hammond Autowerks

4349 B Montgomery Dr.
 Santa Rosa, CA. 95405
 Phone: 707-538-4325

INVOICE

17678

Org. Est. # 055384

Invoice from History

Work Completed : 12/13/2017

Date: 01/29/2018

1978 Mercedes-Benz - 450SL - 4.5L, V8 (276CI) VIN(Not Availa
 Lic # : 987 VXY Odometer In : 36712

Santa Rosa, CA 95409

VIN # : 10704412047701

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
Engine Oil c20w50	2.00	5.50	11.00	Per customer, adjusted timing for smog but it ran better prior. Please, reset to make it run better.	67.50
BG - Brake Fluid 84032	1.00	17.33	17.33	Adjusted timing and fuel mixture for smoother running.	
				Per customer, brakes feel spongy; Check and advise; Front brake pads 6mm, rear brake pads 8mm, brake fluid >4% moisture. Recommend brake fluid flush.	n/c
				Per customer, install customer-supplied driver's visor	67.50
				Installed customer supplied visor and visor clip. Aftermarket visor clip doesn't fit in as snug as the OE clip on the passenger side.	
				Perform Safety Inspection *	67.50
				Front brake pads 6mm, rear brake pads 8mm, brake fluid >4% moisture, front rotors lipped and grooved, transmission pan gasket seeps, steering gear box seeping, rear pinion shaft seal leaking, power steering high pressure line leaking, aux water pump leaking, found oil level low, topped off engine oil with 2qts to set proper level.	
				* Includes: Basic brake inspection and fluid testing (rotor measuring may be extra), lamp inspection and bulb replacement (most vehicles), suspension inspection, basic battery inspection and testing, top off washer fluid, check all fluids (if applicable), check wiper blades, check tire wear, check and adjust spare tire pressure, check engine air and cabin filters (on most vehicles), check for leaks, check drive belt.	
				Check and adjust tire pressure to vehicle specification.	n/c
				Front tires 32psi, rear tires 36psi	
				Perform Brake Flush	108.00
				Check brake fluid for moisture and contamination. Inspect all hydraulic lines and hoses. Inspect calipers and wheel cylinders (when applicable). Inspect master cylinder and cap. Flush entire brake system including master cylinder, calipers, wheel cylinders until clean. Reset indicator where applicable.	
				Hazardous Materials	5.00

Hammond Autowerks
 4349 B Montgomery Dr.
 Santa Rosa, CA. 95405
 Phone: 707-538-4325

INVOICE

17678

Org. Est. # 055384

Invoice from History

Work Completed : 12/13/2017 Date: 01/29/2018

1978 Mercedes-Benz - 450SL - 4.5L, V8 (276CI) VIN(Not Availa
 Lic # : 987 VXY Odometer In : 36712

Santa Rosa, CA 95409
 Home

VIN # : 10704412047701

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
---------------------------	-----	------	-----	-------------------	-----

Org. Estimate 275.00 Revisions 126.82 Current Estimate 401.82

Revision # 1, Previous Estimate Amount: 275.00, Additional Cost: 126.82, Revised Estimate: 401.82, Parts: \$17.33 Labor: \$108.00 Sublet: \$0.00
 Taxes & Fees: \$1.49 Authorized by - Allen, Michael Date - 12/12/2017, Time - 5:28 PM, Initiated By - Customer, Written By - Brady, Marc, Reason -
 brake fluid >4% moisture, Phone Number - Home: 707-695-6454xCell

Labor:	310.50
Parts:	28.33
HazMat:	5.00
SubTotal:	343.83
Tax:	2.44
Total:	346.27
Bal Due:	\$0.00

Customer Number : 6671

[Payments - MasterCard - \$346.27]

Vehicle Received: 12/12/2017

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one years or 12,000 miles whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

Upon notification of completion of repairs, a \$50 per day storage fee will be charged.

A \$150 per day fee will be charged should a Loaner Car not be returned on the agreed upon day.

Signature _____ Date _____

Visit us on the web : www.hammondautowerks.com

Our Email Address: hammondautowerks@att.net

This document was created with Win2PDF available at <http://www.win2pdf.com>.
The unregistered version of Win2PDF is for evaluation or non-commercial use only.
This page will not be added after purchasing Win2PDF.