



Invoice No. 31364

Page 1
Order Date 11/20/15 12:56 pm
Paid: 12/07/15 10:16 am

BAR #: ARD00265411
EPA-CAL000364788
1809 B Empire Industrial Court
Santa Rosa, Ca 95403
Phone: 707-544-5430 FAX: 707-544-5489

IMS & 60K SERVICE
& CLUTCH

Table with vehicle details: 99 PORSCHE 911 BLACK, Mileage in: 66935 out: 66935, Lic: 5GTL230/CA H6Cyl 3.4, Vin: WPOCA2992XS656075 06/99, Eq: AC PS FI DC, Last in 5/29/2013

Quotes
1 11/24/15 12:55pm 5408.96

IMS RETROFIT >01/ A911 IMSR18026 Labor: \$750.00

Per recommendation due to metal fragments found in the oil filter paper cartidge. The IMS bearing is a known weak component in all Boxsters and 911s built between '97 and '05. Should this bearing fail, the engine will suffer irreparable damage and would require complete replacement. The fix is to remove the transmission to access the bearing and replace it with an upgraded design of bearing. (The condition of the clutch and flywheel will be evaluated during this repair.)

Boxster (M96.22) up to eng. no. 651 12851
Boxster S (M96.21) up to eng. no. 671 11237
996 up to eng. no. 661 14164


Table with 4 columns: Part Number, Description, Quantity, Price. Includes items like IMS kit double brg-N, SHAFT SEALING RING-N, HEX HD. SCREW 6X20-N, etc. Total Job Subtotal: \$1,554.15

60K SERVICE 996 99-01 Labor: \$735.00

Safety inspection; change engine motor oil and filter, brake fluid, air filter, and spark plugs. Replace engine drive belt; check battery, coolant and windshield washer fluids; visually check hoses, cooling system and all lights; check tires, tire pressure, brakes, parking brake, clutch, steering and suspension, drive shaft, center support, and flex disc; lubricate door hinges and locks; clean out rain drains and radiator air ducts; treat door and convert. top seals as nec.; visually check exhaust system. Road test to check overall performance of engine and transmission. Replace bulb for left front side marker.

Table with 4 columns: Part Number, Description, Quantity, Price. Includes items like Oil Filter-N, Super DOT 4 Brake fluid-N, Screen wash add.-N, etc.

----->----->----->-----Continued on the next page----->----->----->-----

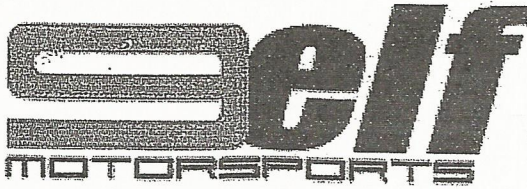

Invoice No.
31364

Page 3
Order Date 11/20/15 12:56 pm
Paid: 12/07/15 10:16 am

BAR #: ARD00265411
EPA-CAL000364788
1809 B Empire Industrial Court
Santa Rosa, Ca 95403
Phone: 707-544-5430 FAX: 707-544-5489

INSPECTION REPORT

- *Water pump bearing has moderate play, (recomend replacement with other coolant repairs)
- *Coolant leak at rear of engine
- *Small amount of metallic particles found in oil filter(Poss IMS bearing)

Job Subtotal: \$0.00

CLUTCH

Labor: \$0.00

Clutch replaced during IMS repair, no additional labor required.

996 116 911 00	Clutch Kit-N	1.0 @ 781.42 = \$	781.42	781.42
			Job Subtotal: \$781.42	

Recommendations:

- Brake material remaining Front= 4mm, Rear= 6mm
- Right side day running lights not working.
- Small dents on left-rear quarter fender
- Alarm sounds when arming
- Battery low on reserve capacity
- Brake discs worn, lipped (will require discs when the pads wear out)
- Rear tires 0mm on outer edges
- Alignment
- Minor oil leaks both cam covers/solenoids


Tire Pressure: LF[36] RF[36] LR [44] RR [44]

I would like to personally thank you for entrusting me with your Porsche. I strive to exceed your expectations, if you feel I have failed in my efforts, please let me know.
Michael Rose

I hereby authorize the above repair work to be done with the necessary material and hereby grant you and/or your employees permission to operate the car, herein described on street, highways or elsewhere for the purpose of testing and/or inspection. Self motorsports will retain all parts removed. An express mechanics lien is hereby acknowledged on above car, truck or vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, accident or any other cause beyond your control.

Signature: _____

----->----->----->-----Continued on the next page----->----->----->-----

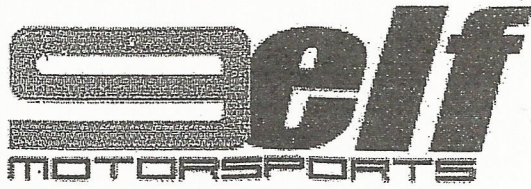

Invoice No.

31364

Page 2

Order Date 11/20/15 12:56 pm

Paid: 12/07/15 10:16 am

BAR #: ARD00265411
EPA-CAL000364788
1809 B Empire Industrial Court
Santa Rosa, Ca 95403
Phone: 707-544-5430 FAX: 707-544-5489

60K SERVICE 996 99-01

Table with 5 columns: Part Number, Description, Quantity, Unit Price, Total Price. Includes items like Drive Belt 6K X 2115-N, alum. Washer 18x24x1.5-N, Bulb 12v H6W-N, and Synthetic 5W-40-N.

Job Subtotal: \$1,147.36

WATER PUMP 996 Labor: \$500.00

Replace water pump and engine drive belt, check condition of idler and tensioner rollers, re-assemble, fill and bleed cooling system. Replace coolant cap. Road test vehicle.

Table with 5 columns: Part Number, Description, Quantity, Unit Price, Total Price. Includes Water Pump Gasket-N, PORSCHE COOLANT-N, Water Pump-N, and Expansion Tank Cap-N.

Job Subtotal: \$1,007.01

COOLANT LEAK Labor: \$187.50

Drain and refill coolant, reseal casting plate on rear of engine.

Table with 5 columns: Part Number, Description, Quantity, Unit Price, Total Price. Includes Gasket-S.

Job Subtotal: \$192.55

OIL SEPERATOR 996 3.4 Labor: \$500.00

DISCONNECTED DRIVETRAIN FROM CHASSIS AND LOWERED ENGINE. REMOVED CYL. 1-3 INTAKE MANIFOLD TO GAIN ACCESS TO FAULTY OIL SEPARATOR. REMOVED SEPARATOR AND REPLACED WITH NEW. RESEALED INTAKE MANIFOLD AND RESECURED DRIVETRAIN AS NEC.


Table with 5 columns: Part Number, Description, Quantity, Unit Price, Total Price. Includes Oil Separator-N, Power Solvent-N, and Hose clamp 8-12mm-N.

Job Subtotal: \$657.89

INSPECTION REPORT Labor: \$0.00

No Oil on dipstick when car arrived
Alarm beeps when armed
*Oil seperator leaking
*Coolant cap leaking
Left front side marker out
*Battery failed load test
*Requires front brakes
Requires rear brakes soon
!Rear tires worn to 0mm on edges-reamainder tread OK
Requires alignment
Oil leaks both cam covers and solenoids. (left side worse)

----->----->----->-----Continued on the next page----->----->----->-----

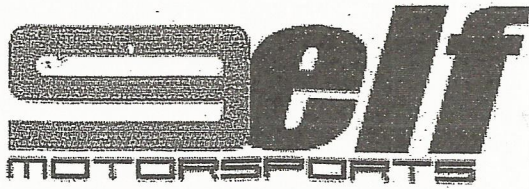

Invoice No.

31364

Page 4

Order Date 11/20/15 12:56 pm

Paid: 12/07/15 10:16 am

BAR #: ARD00265411
EPA-CAL000364788
1809 B Empire Industrial Court
Santa Rosa, Ca 95403
Phone: 707-544-5430 FAX: 707-544-5489

Payments to 9-elf Motorsports


Cost Summary

Status: Paid Work Order

Payments: \$5,575.12
1 12/07/15 5575.12 Visa

Labor	2672.50
Parts	2657.88
Non Taxable	10.00
Haz Waste	0.19
Enviro. Fee	1.99
Tax	232.56
Total	\$5575.12
Payments	5575.12
Bal Due	0.00

Thank you for choosing 9-elf Motorsports

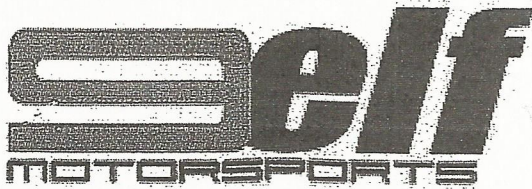

Invoice No.

30451

Page 1

Order Date 05/29/13 05:51 pm

Paid: 05/31/13 05:35 pm

BAR #: ARD00265411
EPA-CAL000364788
1809 B Empire Industrial Court
Santa Rosa, Ca 95403
Phone: 707-544-5430 FAX: 707-544-5489

Table with vehicle details: 99 PORSCHE 911 BLACK, Mileage in:64866 out:64866, Lic: 5GTL230/CA H6Cyl 3.4, Vin: WPOCA2992XS656075 06/99, Eq: AC PS FI DC, Profile:

MINOR SERVICE 996 Labor: \$178.50

Safety Inspection; engine oil and filter change; check fault memory of engine DME (where applicable), check battery, brake fluid, transmission / differential, belts, tires, hoses and all lights; check tire pressures; visually inspect cooling system; check brakes and clutch; check steering and suspension; inspect drive shaft u-joints, center support and flex disc; check exhaust system; road test to check overall performance of engine and transmission.

** Per recommendation, cleaned off the bottom of the engine of leaked oil as best as possible, to re-inspect at the customer's next visit, for an accurate evaluation of leak sources and priority of resolution.

Table with parts list: 996 107 225 53 Oil Filter-N, 90012310630 alum. Washer 18x24x1.5-N, A11 POWER SOLVENT-N, SWEPCO 15/40 Swepeco 15W/40 Oil-N. Job Subtotal: \$296.75

IGNITION LOCK 986/996 Labor: \$375.00


Per recommendation due to finding the ignition lock hard to turn and lacking a definitive 'click' when removing the key. (A faulty ignition lock can cause both accessory malfunctions and a battery drain.) Removed steering wheel and instrument cluster. Replaced faulty ignition lock assembly with new, updated design. Refit cluster and steering wheel. Tested lock and accessory functions; o.k.

Table with parts list: 996 347 017 07 Ignition Lock Assembly-N. Job Subtotal: \$551.09

Recommendations:

- Brake material remaining Front= 4mm, Rear= 6mm
Small dents on left-rear quarter fender
Oil separator leaking coolant, bellows torn
Coolant cover plate near flywheel leaking
** Cleaned off engine of leaked oil 5/31/13 to inspect at next visit **
Brake discs worn, lipped (will require discs when the pads wear out)
Cabin filter dirty, 60k Major Service performed yet?
Metal particulates seen in oil filter (recommend IMS bearing upgrade)
Coolant tank cap seeping

----->----->----->---Continued on the next page--->----->----->-----

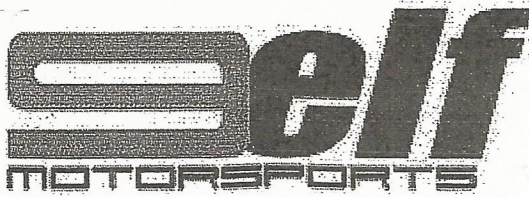

Invoice No.
30451

Page 2

Order Date 05/29/13 05:51 pm
Paid: 05/31/13 05:35 pm

BAR #: ARD00265411
EPA-CAL000364788
1809 B Empire Industrial Court
Santa Rosa, Ca 95403
Phone: 707-544-5430 FAX: 707-544-5489
Tire Pressure: LF[36] RF[36] LR [44] RR [44]

We would like to personally thank you for entrusting us with your Porsche. We strive to exceed your expectations, if you feel we have failed in our efforts, please let us know.

Payments to 9-elf Motorsports		Cost Summary	
Status: Paid Work Order		Labor	553.50
		Parts	294.34
Payments: \$875.58		Enviro. Fee	1.99
1 05/31/13 875.58 Check	1012	Tax	25.75
		Total	\$875.58
		Payments	875.58
		Bal Due	0.00

Thank you for choosing 9-elf Motorsports

SONNEN PORSCHE

900 REDWOOD HIGHWAY • MILL VALLEY, CA 94941

Ph: (415) 380-8000

415-380-8000

996.637.243.01

IND: 06 | FKW: 27/11 | LNR: 1661 | ID: 107

Made in Germany



BAR # AA 219898
EPA # CAL 000234633

CUSTOMER NO. 132948	ADVISOR RUSSELL FONG	1346	TAG NO. 301	INVOICE DATE 06/07/12	INVOICE NO. POCS320456
SANTA ROSA, CA 95404	LICENSE NO. 5GTL230	MILEAGE 61,949	COLOR BLACK/	STOCK NO.	
	YEAR / MAKE / MODEL 99/PORSCHE/911 CARRERA/2DR CABRIOLET			DELIVERY DATE	DELIVERY MILES
	VEHICLE I.D. NO. W P O C A 2 9 9 2 X S 6 5 6 0 7 5			SELLING DEALER NO.	PRODUCTION DATE
DECLINED EMAIL	F.T.E. NO.	P.O. NO.	R.O. DATE 06/07/12		
BUSINESS PHONE			COMMENTS	MO: 61949	

JOB# 1 CHARGES-----

LABOR-----
 J# 1: 90POZZREMOTE: ADD/REPLACE REMOTE TECH(S):103247 90:00
 CUSTOMER REQUESTS NEW KEY/REMOTE
 PROGRAMMED REMOTE AS REQUESTED

PARTS-----	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE	PRICE
	1	996-538-531-00-CUT	KEY	85.00	85.00
	1	996-637-243-01	HAND ALARM REMOT	227.77	227.77
TOTAL - PARTS					312.77

JOB# 1 TOTALS-----

LABOR 90.00
PARTS 312.77

JOB# 1 JOURNAL PREFIX POC3 JOB# 1 TOTAL 402.77

ESTIMATE-----

CUSTOMER HEREBY ACKNOWLEDGES RECEIVING
 ORIGINAL ESTIMATE OF \$403.00 (+TAX)

TOTALS-----

*****		TOTAL LABOR....	90.00
* [] CASH [] CHECK CK NO. [] *		TOTAL PARTS....	312.77
* [] VISA [] MASTERCARD *		TOTAL SUBLET...	0.00
* [] OTHER [] CHARGE *		TOTAL G.O.G....	0.00
*****		TOTAL MISC CHG.	0.00
		TOTAL MISC DISC	0.00
		TOTAL TAX.....	25.02
		TOTAL INVOICE \$	427.79

CUSTOMER SIGNATURE

THANK YOU