

1988 BMW M3 Coupe

VIN: WBSAK0302J2197343



CERTIFICATE OF TITLE

VEHICLE HISTORY

V93180703FC

AUTOMOBILE

SALVAGED

VEHICLE ID NUMBER

YR MODEL

MAKE

PLATE NUMBER

WBSAK0302J2197343

1988 BMW

8DWM280

BODY TYPE MODEL

AX UNLADEN WEIGHT

FUEL TRANSFER DATE

FEE PAID

REGISTRATION EXPIRATION DATE

2D

YR 1ST SOLD

G 06/14/18

\$899

06/02/2019

CLASS *YR

CJ 2018 ZU

EQUIPMT/TRUST NUMBER

ISSUE DATE

07/03/18

MOTORCYCLE ENGINE NUMBER

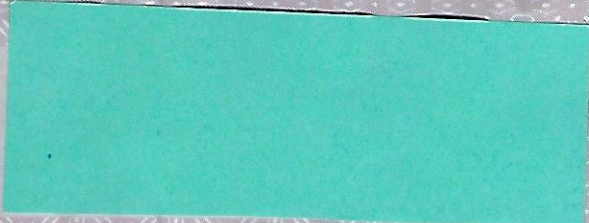
ODOMETER DATE

ODOMETER READING

05/29/1996

VOID WITHOUT BEAR WATERMARK. HOLD TO LIGHT TO VIEW.

VOID WITHOUT BEAR WATERMARK. HOLD TO LIGHT TO VIEW.



I certify (or declare) under penalty of perjury under the laws of the State of California that THE SIGNATURE(S) BELOW RELEASES INTEREST IN THE VEHICLE.

1a. DATE [X] SIGNATURE OF REGISTERED OWNER

1b. DATE [X] SIGNATURE OF REGISTERED OWNER

Federal and State law requires that you state the mileage upon transfer of ownership. Failure to complete or providing a false statement may result in fines and/or imprisonment.

The odometer now reads [] (no tenths), miles and to the best of my knowledge reflects the actual mileage unless one of the following statements is checked. Mileage is VOID if altered or erased.

WARNING [] Odometer reading is not the actual mileage. [] Mileage exceeds the odometer mechanical limits.

I certify (or declare) under penalty of perjury under the laws of the State of California that the foregoing is true and correct.

Table with 4 columns: DATE, TRANSFEROR/SELLER SIGNATURE(S), DATE, TRANSFEREE/BUYER SIGNATURE(S). Includes printed names of seller and buyer.

IMPORTANT READ CAREFULLY

Any change of Lienholder (holder of security interest) must be reported to the Department of Motor Vehicles within 10 days.

LIENHOLDER(S)

2. [X] Signature releases interest in vehicle. (Company names must be countersigned) Release Date

CA 182318433 020398 REG. 17.30RS (REV 02/2016)

KEEP IN A SAFE PLACE - VOID IF ALTERED



Vehicle History Report™

US \$39.99

1988 BMW M3 VIN: WBSAK0302J2197343 SEDAN 2 DR 2.3L I4 F DOHC GASOLINE REAR WHEEL DRIVE		Branded Titles: Rebuilt, Salvage
		22 Service history records
		42 Detailed records available
		191,589 Last reported odometer reading

This CARFAX Vehicle History Report is based only on information supplied to CARFAX and available as of 11/2/20 at 11:00:08 AM (CST). Other information about this vehicle, including problems, may not have been reported to CARFAX. Use this report as one important tool, along with a vehicle inspection and test drive, to make a better decision about your next used car.

















Title History	Summary
CARFAX guarantees the information in this section	
Salvage Junk Rebuilt Fire Flood Hail Lemon	Alert! Problem Found
Not Actual Mileage Exceeds Mechanical Limits	No Problem
ALERT! - Severe problems were reported by a state Department of Motor Vehicles (DMV). This vehicle does not qualify for the CARFAX Buyback Guarantee.	

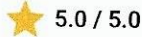

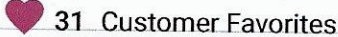
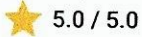


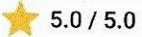


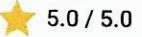

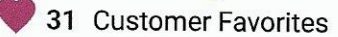
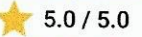


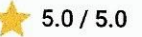


Additional History	Summary
Not all accidents / issues are reported to CARFAX	
Total Loss No total loss reported to CARFAX.	<input checked="" type="checkbox"/> No Issues Reported
Structural Damage CARFAX recommends that you have this vehicle inspected by a collision repair specialist.	<input checked="" type="checkbox"/> No Issues Reported
Airbag Deployment No airbag deployment reported to CARFAX.	<input checked="" type="checkbox"/> No Issues Reported
Odometer Check No indication of an odometer rollback.	<input checked="" type="checkbox"/> No Issues Indicated
Accident / Damage DMV title problems reported.	Severe Damage
Manufacturer Recall No open recalls reported to CARFAX. Check with an authorized BMW dealer for any open recalls.	<input checked="" type="checkbox"/> No Recalls Reported
Basic Warranty Original manufacturer warranty likely voided by manufacturer after vehicle was severely damaged.	Warranty Voided

Detailed History
Mileage Source Comments

08/21/1990	34,904	California Inspection Station	Failed emissions inspection
01/03/1992	48,714	California Inspection Station San Diego, CA	Passed emissions inspection
05/29/1996	89,016	California Motor Vehicle Dept. Petaluma, CA	Odometer reading reported
06/28/1996		California Motor Vehicle Dept.	Title issued or updated - Loan or lien reported
04/17/1998	109,611	California Inspection Station Vacaville, CA	Failed emissions inspection
05/15/1998		California Motor Vehicle Dept.	New owner reported - SALVAGE TITLE/CERTIFICATE ISSUED - REBUILT TITLE ISSUED
05/13/2000	125,626	Service Facility Santa Rosa, CA	Vehicle serviced
05/13/2000		California Inspection Station Santa Rosa, CA	Passed emissions inspection
04/07/2005	139,810	California Inspection Station Santa Rosa, CA	Passed emissions inspection
04/08/2005		California Motor Vehicle Dept. Petaluma, CA	New owner reported - REBUILT TITLE ISSUED
04/19/2007	153,213	North Bay Bavarian Santa Rosa, CA 707-545-0820 northbaybavarian.com/ ★ 5.0 / 5.0 17 Verified Reviews ✓ ♥ 31 Customer Favorites	Vehicle serviced - Oil and filter changed - Oxygen sensor replaced
05/01/2007	153,244	North Bay Bavarian Santa Rosa, CA 707-545-0820 northbaybavarian.com/ ★ 5.0 / 5.0 17 Verified Reviews ✓ ♥ 31 Customer Favorites	Vehicle serviced - Exhaust manifold gasket replaced - Exhaust system checked
05/09/2007	153,582	California Inspection Station	Failed emissions inspection - Designated GROSS POLLUTER
05/22/2007	153,867	North Bay Bavarian Santa Rosa, CA 707-545-0820 northbaybavarian.com/ ★ 5.0 / 5.0 17 Verified Reviews ✓ ♥ 31 Customer Favorites	Vehicle serviced - Emission system checked
05/22/2007	153,906	California Inspection Station	Passed emissions inspection
08/08/2007	154,986	North Bay Bavarian Santa Rosa, CA 707-545-0820 northbaybavarian.com/ ★ 5.0 / 5.0 17 Verified Reviews ✓	Vehicle serviced - A/C refrigerant recharged

05/26/2009	161,822	 31 Customer Favorites California Inspection Station Petaluma, CA	Passed emissions inspection
12/04/2009	163,105	North Bay Bavarian Santa Rosa, CA 707-545-0820 northbaybavarian.com/  5.0 / 5.0 17 Verified Reviews   31 Customer Favorites	Vehicle serviced - Emission system checked - Intake manifold gasket(s) replaced - Air intake hose replaced
03/30/2010	164,618	North Bay Bavarian Santa Rosa, CA 707-545-0820 northbaybavarian.com/  5.0 / 5.0 17 Verified Reviews   31 Customer Favorites	Vehicle serviced
08/14/2010		Midas Berkeley, CA 510-849-1400 midas.com  4.4 / 5.0 14 Verified Reviews 	Vehicle serviced - Exhaust system checked
03/09/2011		California Motor Vehicle Dept. Berkeley, CA	Registration updated when owner moved the vehicle to a new location
05/23/2011	168,292	California Inspection Station Santa Rosa, CA	Passed emissions inspection
05/26/2011		California Motor Vehicle Dept. Healdsburg, CA	New owner reported - REBUILT TITLE ISSUED
03/15/2012		North Bay Bavarian Santa Rosa, CA 707-545-0820 northbaybavarian.com/  5.0 / 5.0 17 Verified Reviews   31 Customer Favorites	Vehicle serviced
04/03/2012		North Bay Bavarian Santa Rosa, CA 707-545-0820 northbaybavarian.com/  5.0 / 5.0 17 Verified Reviews   31 Customer Favorites	Vehicle serviced - Rear shock absorber(s) replaced
04/09/2012		California Inspection Station Santa Rosa, CA	Passed emissions inspection
05/16/2012		California Motor Vehicle Dept. Angwin, CA	New owner reported - REBUILT TITLE ISSUED
03/28/2013		North Bay Bavarian Santa Rosa, CA 707-545-0820 northbaybavarian.com/  5.0 / 5.0 17 Verified Reviews 	Vehicle serviced - Washer pump replaced - Wipers/washers serviced

 31 Customer Favorites			
04/29/2013	176,824	North Bay Bavarian Santa Rosa, CA 707-545-0820 northbaybavarian.com/  5.0 / 5.0 17 Verified Reviews 	Vehicle serviced
 31 Customer Favorites			
08/29/2013	178,563	North Bay Bavarian Santa Rosa, CA 707-545-0820 northbaybavarian.com/  5.0 / 5.0 17 Verified Reviews 	Vehicle serviced - Fluids checked - Oil and filter changed - Tire condition and pressure checked - Muffler replaced
 31 Customer Favorites			
06/25/2014	182,687	California Inspection Station Santa Rosa, CA	Passed emissions inspection
06/27/2014		North Bay Bavarian Santa Rosa, CA 707-545-0820 northbaybavarian.com/  5.0 / 5.0 17 Verified Reviews 	Vehicle serviced - Transmission fluid changed - Brakes serviced - Engine checked - Rear crankshaft oil seal replaced - Fuel line/hose replaced - Cooling system hoses checked - Differential fluid flushed/changed - Heater hose(s) replaced - Lower control arm(s) replaced - Control arm(s) replaced - Drive belt(s) replaced - Radiator hose(s) replaced - Alignment checked - Cooling system checked - Coolant reservoir replaced - Vehicle washed/detailed - Coolant temperature sensor replaced - Emission system checked - Thermostat replaced - Vacuum hose(s) replaced - Brake fluid flushed/changed - A/C expansion/orifice valve replaced - Clutch release bearing replaced - Exhaust pipe seal replaced - Steering gear repaired - Muffler replaced
 31 Customer Favorites			
09/08/2014	183,284	North Bay Bavarian Santa Rosa, CA 707-545-0820 northbaybavarian.com/  5.0 / 5.0 17 Verified Reviews 	Vehicle serviced - Brake fluid flushed/changed - Fluids checked - Oil and filter changed - Tire condition and pressure checked - Vehicle washed/detailed - Fuel system checked
 31 Customer Favorites			
01/21/2016	185,787	North Bay Bavarian Santa Rosa, CA 707-545-0820 northbaybavarian.com/  5.0 / 5.0 17 Verified Reviews 	Vehicle serviced - Battery/charging system checked - Brakes checked - Fluids checked - Oil and filter changed - Tire condition and pressure checked
 31 Customer Favorites			
06/27/2016	186,835	North Bay Bavarian Santa Rosa, CA 707-545-0820 northbaybavarian.com/	Vehicle serviced

		 5.0 / 5.0 17 Verified Reviews  	
02/28/2017	188,341	North Bay Bavarian Santa Rosa, CA 707-545-0820 northbaybavarian.com/  5.0 / 5.0 17 Verified Reviews  	Vehicle serviced - Brakes checked - Fluids checked - Oil and filter changed - Tire condition and pressure checked - Brakes serviced
12/07/2017	189,850	North Bay Bavarian Santa Rosa, CA 707-545-0820 northbaybavarian.com/  5.0 / 5.0 17 Verified Reviews  	Vehicle serviced - Brakes checked - Fluids checked - Oil and filter changed - Tire condition and pressure checked
06/21/2018	190,179	California Inspection Station Santa Rosa, CA	Passed emissions inspection
06/26/2018	190,180	North Bay Bavarian Santa Rosa, CA 707-545-0820 northbaybavarian.com/  5.0 / 5.0 17 Verified Reviews  	Vehicle serviced - Exhaust replaced - Emissions inspection performed
07/03/2018		California Motor Vehicle Dept. Santa Rosa, CA	New owner reported - REBUILT TITLE ISSUED
01/18/2019	190,827	North Bay Bavarian Santa Rosa, CA 707-545-0820 northbaybavarian.com/  5.0 / 5.0 17 Verified Reviews  	Vehicle serviced - Brakes checked - Fluids checked - Oil and filter changed - Tire condition and pressure checked
04/18/2019	191,589	North Bay Bavarian Santa Rosa, CA 707-545-0820 northbaybavarian.com/  5.0 / 5.0 17 Verified Reviews  	Vehicle serviced - Fuel system checked

Have Questions? Please visit our Help Center at www.carfax.com.



Glossary

Failed Emissions Inspection

The emissions check performed during a vehicle inspection indicated the vehicle was emitting more than allowable emissions standards and/or had missing or modified parts. Repeated failed emissions records can indicate engine problems and CARFAX recommends you have the vehicle inspected.

Gross Polluter

A Gross Polluter is a vehicle that fails an emissions inspection with below-standard scores. These vehicles can pollute as much as

18 times more than a vehicle that passes an emissions inspection. It is illegal to drive or sell a gross polluting vehicle in California, and it cannot be registered with the DMV. CARFAX recommends checking the latest Vehicle Inspection Report to confirm the proper repairs have been completed before purchasing.

New Owner Reported

When a vehicle is sold to a new owner, the Title must be transferred to the new owner(s) at a Department of Motor Vehicles.

Ownership History

CARFAX defines an owner as an individual or business that possesses and uses a vehicle. Not all title transactions represent changes in ownership. To provide estimated number of owners, CARFAX proprietary technology analyzes all the events in a vehicle history. Estimated ownership is available for vehicles manufactured after 1991 and titled solely in the US including Puerto Rico. Dealers sometimes opt to take ownership of a vehicle and are required to in the following states: Maine, Massachusetts, New Jersey, Ohio, Oklahoma, Pennsylvania and South Dakota. Please consider this as you review a vehicle's estimated ownership history.

Rebuilt/Reconstructed Title

A Rebuilt/Reconstructed vehicle is a salvage vehicle that has been repaired and restored to operation. These vehicles are often severely damaged before they are rebuilt and refurbished parts are typically used during reconstruction. In most states, an inspection of the vehicle is required before the vehicle is allowed to return to the road.

Salvage Title

A Salvage Title is issued on a vehicle damaged to the extent that the cost of repairing the vehicle exceeds approximately 75% of its pre-damage value. This damage threshold may vary by state. Some states treat Junk titles the same as Salvage but the majority use this title to indicate that a vehicle is not road worthy and cannot be titled again in that state. The following eleven states also use Salvage titles to identify stolen vehicles - AZ, FL, GA, IL, MD, MN, NJ, NM, NY, OK and OR.

Title Issued

A state issues a title to provide a vehicle owner with proof of ownership. Each title has a unique number. Each title or registration record on a CARFAX report does not necessarily indicate a change in ownership. In Canada, a registration and bill of sale are used as proof of ownership.

Follow Us:

facebook.com/CARFAX[@CARFAXinc](https://twitter.com/CARFAXinc)

About CARFAX

CARFAX DEPENDS ON ITS SOURCES FOR THE ACCURACY AND RELIABILITY OF ITS INFORMATION. THEREFORE, NO RESPONSIBILITY IS ASSUMED BY CARFAX OR ITS AGENTS FOR ERRORS OR OMISSIONS IN THIS REPORT. CARFAX FURTHER EXPRESSLY DISCLAIMS ALL WARRANTIES, EXPRESS OR IMPLIED, INCLUDING ANY IMPLIED WARRANTIES OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE.

© 2020 CARFAX, Inc., a unit of IHS Markit Ltd. All rights reserved.
11/2/20 11:00:08 AM (CST)

North Bay Bavarian
 1801 Empire Industrial Ct.
 Santa Rosa, CA. 95403
 Phone - 707-545-0820
 Independent BMW Specialists

INVOICE

31000

Org. Est. # 100873
 EPA#000004766
 BAR#AB137993

INVOICE

Print Date : 04/03/2012

Angwin, CA 94508
 Home ----- Office
 Cust ID : 4579

Ref # :

1988 BMW - M3
 2.3L, In-Line4, VIN (3)
 Lic # : 4ADD683
 Unit # : WBSAK0302J219734
 Vin # : **2197343**
 Hat # :

Odometer In :

Part Description / Number	Qty	Sale	Extended	Labor Description	Extended
REAR SHOCK 24-020282	2.00	98.00	196.00		
STRUT INSERT 34-001363	2.00	140.00	280.00		
REAR SHOCK MOUNT GROUND CONTROL RSMOUNT	1.00	87.40	87.40		
E30 OE SPORT SPRING SET 50404-55	1.00	239.68	239.68		

Org. Estimate \$871.34 Revisions \$0.00 Current Estimate \$ 871.34 Additional Cost Revised Estimate

Labor:	0.00
Parts:	803.08
Sublet:	0.00

Sub:	803.08
Tax:	68.26
Total:	871.34
Bal Due:	\$871.34

PO # 4355

[Payments -]

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one year or 12,000 miles whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

SIGNATURE..... Date..... Time.....

Written By: ROW, MATTHEW

North Bay Bavarian
 1801 Empire Industrial Ct.
 Santa Rosa, CA. 95403
 Phone - 707-545-0820
 Independent BMW Specialists

INVOICE

33656

Org. Est. # 109619
 EPA#000004766
 BAR#AB137993

INVOICE

Print Date : 04/29/2013

1988 BMW - M3
 2.3L, In-Line4, VIN (3)
 Lic # : 4ADD683
 Unit # : WBSAK0302J219734
 Vin # : **2197343**
 Hat # :
 Odometer In : 176824

Angwin, CA 94508
 Home : 2 --- Office
 Cust ID : 4579 Ref # :

Part Description / Number	Qty	Sale	Extended	Labor Description	Extended
KEYLESS ENTRY				CHECK DOOR LOCKS	120.00
KEDLK123	1.00	69.63	69.63	INSTALL KEYLESS ENTRY KIT	
				HARD WIRE RADAR DETECTOR	60.00
				CHECK HOOD ALIGNMENT	N/C
				INSTALL CLUTCH STOP	N/C

[Technicians : WILSON, LOGAN]

Org. Estimate \$126.00 Revisions \$0.00 Current Estimate \$ 126.00 Additional Cost Revised Estimate

Labor:	180.00
Parts:	69.63
Sublet:	0.00

Sub:	249.63
Tax:	6.09
Total:	255.72
Bal Due:	\$255.72


[Payments -]

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one years or 12,000 miles whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

SIGNATURE..... Date..... Time.....

North Bay Bavarian
 1801 Empire Industrial Ct.
 Santa Rosa, CA. 95403
 Phone - 707-545-0820

Sub Estimate



EPA#000004766
 BAR#AB137993

Independent BMW Specialists

ESTIMATE FOR SERVICES

Estimate Date : 02/28/2013

1988 BMW - M3

Lic # : 4ADD683

Unit # : WBSAK0302J219734

VIN # : 2197343

Odometer In: 0

Angwin, CA 94508

Home --- Office

Cust Id: 4,579

Part Description / Number	Qty	Sale	Extended	Labor Description	Extended
BLOWER MOTOR 64111466014	1.00	461.30	461.30	REPLACE BLOWER MOTOR	336.00
DISTRIBUTOR CAP 12111309797	1.00	101.00	101.00	CHECK SMOG	60.00
IGNITION ROTOR 12111309798	1.00	23.25	23.25	SMOG	75.00
MAIN FUEL PUMP 16141179232	1.00	372.11	372.11	CHECK HEATER BLOWER FAN	60.00
AUX FUEL PUMP E30 87>/M3 ALL 16141179415	1.00	309.13	309.13	REAR DEFROST BUTTON STAYS ON, CHECK BUTTON, REPLACE IF NECESSARY	36.00
FUEL FILTER **KL9** 13321270038	1.00	50.44	50.44	REPLACE DISTRIBUTOR AND IGNITION ROTOR	60.00
<i>Cat removal SS exhaust Super Sprint</i>				REPLACE AUX FUEL PUMP	156.00
<i>Water pump</i>				REMOVE REAR SEAT, FUEL TANK COVER, AND FUEL SENDER AND PUMP RESOLDER PUMP IN PLACE, REINSTALL ALL, CK FOR FUNCTION AND LEAKS.	
<i>Seal injectors</i>				REPLACE FUEL PUMP	216.00
<i>Shifter rod / rebuild</i>				REMOVE PUMP FROM MOUNT, DISCONNECT ELECTRICAL WIRES, REPLACE PUMP AND FUEL FILTER, CK FOR FUNCTION	
<i>Mike: strut braces IE</i>				Hazardous Materials	6.00
<i>Bilstein HR Sport springs</i>					
				<i>MAF Thinner</i>	

Parts : \$ 1,317.23

Labor : \$ 1,005.00

Tax : \$ 115.26

Total : \$ 2,437.49

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the vehicle described for testing and/or inspection. Express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto. SMOG: I understand that I can have emission service and/or adjustments done elsewhere. I hereby waive this right.

TEARDOWN ESTIMATE: I understand that my vehicle will be reassembled within ___ days of the date shown above if I choose not to authorize the service recommended. All Parts removed will be discarded unless instructed otherwise: Save all Parts ____. NOT RESPONSIBLE FOR LOSS OR DAMAGE TO CARS OR ARTICLES LEFT IN CARS IN CASE OF FIRE, THEFT OR ANY OTHER CAUSE.

SIGNATURE.....

Date..... Time.....

Date: 8/20/2013 01:53 PM
 Estimate ID: 2126
 Estimate Version: 0
 Supplement: 1 (F F) 8/20/2013 01:36:46 PM
 Profile ID: REDWOOD AUTO BODY

Redwood Auto Body, Inc.

200 Kennedy Lane, Healdsburg, CA 95448
 (707) 433-7895
 Fax: (707) 433-7473
 Email: redwoodautobody@sbcglobal.net
 Tax ID: 20-4604410 BAR #: ARD00148490 EPA #: CAL000308344

Supplement Delta Report
 Comparison of Estimate 2126 Supplement 0 and Supplement 1

Damage Assessed By: KEN RICHARDSON
 Supplemented By: KEN RICHARDSON

Insured: IV
 Vehicle Description: 1988 BMW M3
 Date of Loss: 8/7/2013

Line Item	Labor Type	Operation	Line Item Description	Part Type	Dollar Amount	Labor Units	CEG Unit
Changed Entries							
20		ADD'L COST	Paint				
24<		ADD'L COST	Paint		216.00 *	0.0	T
					256.00 *<	0.0	T
Added Entries							
S1 8	BDY	ADD'L LABOR OP	Tower Bar				
S1 14	BDY	REPAIR	Cowl Top	Existing		0.5*	
S1 15	REF	REFINISH/REPAIR	Cowl Top	Existing		4.0*	
S1 16	BDY	REMOVE/INSTALL	Wiper Assy	Existing		1.0*	
				Existing		0.5*	

Global Changes

No Deductible, Customer Responsibility, Labor Rate, or Part Adjustment changes were made.

	Amount
Original Estimate:	1,864.24
Supplement 1	535.50
Orig Total Tax	24.21
Supp 1 Total Tax	27.71
Net Supplement Amount	535.50
Net Total	2,399.74
Program Calc Versions	
Supp 0	7.0.486
Supp 1	7.0.486
Data Versions	
	JUL_13_V
	JUL_13_V

ESTIMATE RECALL NUMBER: 8/20/2013 10:17:30 2126

Software Version: 7.0.486

Copyright (C) 1994 - 2013 Mitchell International
 All Rights Reserved

Date: 8/20/2013 01:53 PM
 Estimate ID: 2126
 Estimate Version: 0
 Supplement: 1 (F F) 8/20/2013 01:36:46 PM
 Preliminary
 Profile ID: REDWOOD AUTO BODY

Redwood Auto Body, Inc.

200 Kennedy Lane, Healdsburg, CA 95448
 (707) 433-7895
 Fax: (707) 433-7473
 Email: redwoodautobody@sbcglobal.net
 Tax ID: 20-4604410 BAR #: ARD00148490 EPA #: CAL000308344

Damage Assessed By: KEN RICHARDSON
 Supplemented By: KEN RICHARDSON

Date of Loss: 8/7/2013
 Deductible: UNKNOWN

Insured:
 Address:
 Telephone: Work Phone: () 12 1508

Home Phone:

Mitchell Service: 916224

Description: 1988 BMW M3
 Body Style: 2D Sed
 VIN: WBSAK0302J2197343
 OEM/ALT: O

Drive Train: 2.3L Inj 4 Cyl 5M

Search Code: None

SPECIAL PARTS NOTICE: ALL CRASH PARTS ON THIS ESTIMATE ARE NEW-OEM [ORIGINAL EQUIPMENT MANUFACTURE] UNLESS OTHERWISE SPECIFIED. PARTS DESCRIBED AS RECHROMED, OR REMANUFACTURED ARE EITHER RECONDITIONED OR REBUILT. PARTS THAT ARE DESCRIBED AS QUALITY REPLACEMENT PARTS, AND QRP CAPA, ARE NON OEM CRASH PARTS. **

Line Item	Entry Number	Labor Type	Operation	Line Item Description	Part Type/ Part Number	Dollar Amount	Labor Units
1	601080	BDY	REMOVE/INSTALL	Frt Bumper Assy			
2	604940	BDY	REPAIR	R Fender Panel			0.8
3	AUTO	REF	REFINISH	R Fender Outside	Existing		3.0*
4	610450	GLS	REMOVE/REPLACE	W/Shield Glass			C 2.3
5				w/s has 2 cracks won't make in/out w/o breakage	Sublet	349.75 *	0.0*
6	610470	BDY	REMOVE/REPLACE	W/Shield Moulding			
S1 7	900500	BDY *	REPAIR	Windsheild Frame	51 31 1 945 082	42.68	
S1 8	900500	BDY *	ADD'L LABOR OP	Tower Bar	Existing		4.0*
9	900500	REF *	REFINISH/REPAIR	Windsheild Frame	Existing		0.5*
10	610620	BDY	REMOVE/INSTALL	R W/Shield Wiper Blade Arm	Existing		1.5*
11	610630	BDY	REMOVE/INSTALL	L W/Shield Wiper Blade Arm	Existing		0.2 r
12	610900	BDY	REMOVE/INSTALL	R Cowl/Dash Cowl Top Grille	Existing		0.2 r
13	610910	BDY	REMOVE/INSTALL	L Cowl/Dash Cowl Top Grille	Existing		0.2 r
S1 14	900500	BDY *	REPAIR	Cowl Top	Existing		0.2 r
S1 15	900500	REF *	REFINISH/REPAIR	Cowl Top	Existing		4.0*
S1 16	900500	BDY *	REMOVE/INSTALL	Wiper Assy	Existing		1.0*
17	900500	BDY *	REMOVE/INSTALL	Rt Rocker	Existing		0.5* r
18				may need attaching clips	Existing		0.5* r
19	936012		ADD'L COST	HAZARDOUS WASTE DISPOSAL			
						3.00 *	

ESTIMATE RECALL NUMBER: 08/20/2013 10:17:30 2126
 Mitchell Data Version: OEM: JUL_13_V

Software Version: 7.0.486

Copyright (C) 1994 - 2013 Mitchell International
 All Rights Reserved

Page 1 of 3

Date: 8/20/2013 01:53 PM
 Estimate ID: 2126
 Estimate Version: 0
 Supplement: 1 (F F) 8/20/2013 01:36:46 PM
 Preliminary
 Profile ID: REDWOOD AUTO BODY

20	900500	REF *	REMOVE/REPLACE	MASK FOR OVERSPRAY
21	900500	BDY *	REMOVE/REPLACE	RESTORE CORROSION PROTECTION
22	AUTO	REF	ADD'L OPR	Clear Coat
23	933003	REF	ADD'L OPR	TINT COLOR
24	AUTO		ADD'L COST	Paint

** QUAL REPL PART	5.00	*	0.2*
** QUAL REPL PART	10.00	*	0.3*
			0.9
			0.5*
	256.00	*	

* - Judgment Item
 C - Included in Clear Coat Calc
 r - CEG R&R Time Used For This Labor Operation

Estimate Totals

I. Labor Subtotals	Units	Rate	Add'l Labor Amount	Sublet Amount	Totals	II. Part Replacement Summary	Amount
Body	14.4	82.00	0.00	0.00	1,180.80	Taxable Parts	57.68
Refinish	6.4	82.00	0.00	0.00	524.80	Sales Tax @ 8.750%	5.05
						Non-Taxable Parts	349.75
					1,705.60	Total Replacement Parts Amount	412.48
Labor Summary	20.8				1,705.60		
III. Additional Costs					Amount	IV. Adjustments	Amount
Taxable Costs					259.00	Customer Responsibility	0.00
Sales Tax @ 8.750%					22.66		
Total Additional Costs					281.66		
Paint Material Method: Rates							
Init Rate = 40.00 , Init Max Hours = 99.9, Addl Rate = 0.00							
						I. Total Labor:	1,705.60
						II. Total Replacement Parts:	412.48
						III. Total Additional Costs:	281.66
						Gross Total:	2,399.74
						IV. Total Adjustments:	0.00
						Net Total:	2,399.74
						Less Original Net Total:	1,864.24
						Net Supplement Amount:	535.50
						S1: KEN RICHARDSON	535.50

This is a preliminary estimate.
Additional changes to the estimate may be required for the actual repair.

Insurance Co: CUSTOMER PAY

ESTIMATE RECALL NUMBER: 08/20/2013 10:17:30 2126
 Mitchell Data Version: OEM: JUL_13_V

Software Version: 7.0.486

Copyright (C) 1994 - 2013 Mitchell International
 All Rights Reserved

Date: 8/20/2013 01:53 PM
Estimate ID: 2126
Estimate Version: 0
Supplement: 1 (F F) 8/20/2013 01:36:46 PM
Preliminary
Profile ID: REDWOOD AUTO BODY

Body Shop: REDWOOD AUTO BODY
Address: 200 Kennedy Lane
Healdsburg, CA 95448
Telephone: (707) 433-7895

SPECIAL PARTS NOTE; All crash parts on this estimate are "NEW" parts (OEM) unless otherwise specified. Parts described as RECHROMED, RECORED, or REMANUFACTURED are either "RECONDITIONED" parts or "REBUILT" parts. Crash parts described as "QUAL REPL PART" are NON-OEM aftermarket parts.

ESTIMATE RECALL NUMBER: 08/20/2013 10:17:30 2126
Mitchell Data Version: OEM: JUL_13_V

Software Version: 7.0.486

Copyright (C) 1994 - 2013 Mitchell International
All Rights Reserved

Page 3 of 3

Ireland Engineering Inc.
 2088-A Central Ave.
 Duarte, CA 91010
 Tel (626) 359-7674
 Fax (626) 303-7354

Invoice

Date	Invoice #
3/13/2012	35689

Bill To
Angwin.CA 94508
Residential Address

Ship To

P.O. Number	Terms	Rep	Ship	Via	F.O.B.
M3070	Mastercard	FEA	3/13/2012	UPS	

Quantity	Description	Price Each	Amount
1	MAF Sensor-E30 M3	375.00	375.00T
1	SS Front Strut Brace-E30	120.00	120.00T
1	SS Rear Strut Brace-E30	90.00	90.00T
	Freight	14.68	14.68
		3.75%	51.19

Total		\$650.87
--------------	--	----------

AMERICA'S TIRE

1774508

americastire.com

DATE: 03-06-2017 TIME: 12:38 PM

CUSTOMER INFORMATION		VEHICLE INFORMATION		STORE LOCATION	
ANGWIN	CA 94508	1989 BMW		CAN 29	
(H)		M3		1547 TRANCAS ST	
(W)	(M)	ALL E30		NAPA CA 94558-2915	
		MILEAGE: 188,444		PHONE: 707-255-2995	
		TORQUE SPECS: 080		893 CODY DEEVER	
				WORK ORDER#	

CODE	CC	QTY.	SIZE	DESCRIPTION	F.E.T.	PRICE	AMOUNT
29672	NRM	4	205 /50 R15	86V SL BSW	.00	115.00	460.00
			BRI POTENZA	RE71R			
WARRANTY: SEE REVERSE SIDE FOR WARRANTY DETAILS							
COMMENT: BOLT PATTERN: 5-120							
COMMENT: INFLATION F:33 R:33							
COMMENT: Tires going on wheels in trunk and behind seats wheels coming off back into							
COMMENT: vehicle							
80017	NRM	4	CERTIFICATES FOR	REFUND, REPLACEMENT	.00	16.55	66.20
80075	NRM	4	STATE REQUIRED	ENVIRONMENTAL FEE - UNITS	.00	1.75	7.00
80224	NRM	4	WASTE TIRE	DISPOSAL FEE	.00	2.50	10.00
80219	NRM	4	INSTALLATION &	LIFETIME SPIN BALANCING	.00	16.00	64.00
80402	NRM	4	VALVES, ROTATIONS &	REPAIRS INCLUDED FREE	.00	.00	.00

The tire and/or wheel you have chosen is different from the original equipment provided with your vehicle and may change its handling or stability characteristics. Further information is available from your America's Tire salesperson.

SUBTOTAL: 607.20
 TAX: 36.43
 TOTAL: 643.63
 DEBIT: 643.63
 TENDERED: 643.63

XXXXXXXXXXXX 3109

Signature on file

North Bay Bavarian
 1801 Empire Industrial Ct.
 Santa Rosa, CA. 95403
 Phone - 707-545-0820
 Independent BMW Specialists

INVOICE

37262

Org. Est. # 121827
 EPA#000004766
 BAR#AB137993

INVOICE

Print Date : 09/08/2014

1988 BMW - M3

2.3L, In-Line4, VIN (3)

Lic # : 4ADD683

Odometer In : 183284

Unit # : WBSAK0302J219734

Vin # : **2197343**

Hat # :

Angwin, CA 94508
 Home 707 --- Office
 Cust ID : 4579

Ref # :

Part Description / Number	Qty	Sale	Extended	Labor Description	Extended
AUX. FAN SWITCH 61311364272	1.00	32.56	32.56	REMOVE MECHANICAL FAN AND WIRE ELECTIC FAN TO COOL ENGINE	187.50
30 AMP RESETTING BREAKER 30AB	1.00	5.00	5.00	PERFORM 500 MILE CHECK UP	N/C
DME RELAY 61361729004	1.00	21.50	21.50	VALVE ADJUSTMENT	N/C
FUEL PUMP RELAY 61368373700	1.00	19.95	19.95	REMOVE IGNITION WIRES AND VALVE COVER. ADJUST VALVES, CLEAN VALVE COVER, REPLACE VALVE COVER GASKET AND REINSTALL VALVE COVER AND IGNITION WIRES.	
VALVE COVER GASKET M3(E30) 11121312171	1.00				
SPARK PLUG GASKET M3\M5\M6 11121312173	2.00			OIL AND FILTER CHANGE	N/C
OIL FILTER M3 (E30) 11421258039	1.00			CHANGE ENGINE OIL AND FILTER, CHECK TIRE PRESSURES- LF RF RR LR , CHECK BRAKES- F % R%, CHECK FLUID LEVELS, CHECK CONDITION OF VEHICLE.	
MOBILE ONE 20W/50 ENGINE OIL 07119632546	5.00				
BRAKE FLUID 01BF	2.00	9.89	19.78	BRAKE FLUID CHANGE DRAIN FLUID, REMOVE AND CLEAN RESERVOIR. REINSTALL AND RENEW FLUID. BLEED ENTIRE BRAKE SYSTEM.	125.00
				FUEL	40.00
				TUNE PERFROMANCE CHIP	1,250.00
				WASH VEHICLE	6.00

[Technicians : WILSON, LOGAN; LUU, CAM]

Org. Estimate \$1,715.93 Revisions \$0.00 Current Estimate \$ 1,715.93 Additional Cost Revised Estimate

Labor:	1,562.50
Parts:	98.79
Sublet:	46.00

Sub:	1,707.29
Tax:	8.64
Total:	1,715.93
Bal Due:	\$1,715.93

[Payments -]

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is 12 months or 12,000 miles whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

SIGNATURE..... Date..... Time.....

**ENGINE
RBLD**

North Bay Bavarian
1801 Empire Industrial Ct.
Santa Rosa, CA. 95403
Phone - 707-545-0820
Independent BMW Specialists

INVOICE

36724

Org. Est. # 118410
EPA#000004766
BAR#AB137993

INVOICE

Print Date : 06/27/2014

Angwin, CA 94508
Home ----- Office
Cust ID : 4579

Ref # :

1988 BMW - M3
2.3L, In-Line4, VIN (3)
Lic # : 4ADD683
Unit # : WBSAK0302J219734
Vin # : **2197343**
Hat # :

Odometer In : 182640

Part Description / Number	Qty	Sale	Extended	Labor Description	Extended
ANTIFREEZE 01AF	1.00	20.98	20.98	RESTORE FRONT SEATS	1,350.00
EXHAUST VALVE GUIDE 09 0387 573	8.00	8.25	66.00	REMOVE ENGINE AND OVER HAUL	3,750.00
HEAD GAKSET SET 11121316992	1.00	375.78	375.78	REMOVE IGNITION WIRES, CAM COVER, INTAKE MANIFOLD AND UPPER TIMING COVER. DRAIN COOLANT, REMOVE TIMING CHAIN TENSIONER AND CAM GEARS. UNBOLT CYLINDER HEAD AND CLEAN SURFACE. CLEAN SEALING SURFACE. REPLACE HEAD GASKET, REINSTALL ALL OF THE ABOVE. CHANGE OIL AND FILTER, RENEW COOLANT AND RUN MOTOR, WASH ENGINE AND SET MIXTURE. ROAD TEST VEHICLE.	
SWEPCO 20/50 ENGINE OIL 20/50 SWEPCO	5.00	9.50	47.50	REPLACE ALL NEEDED COOLING HOSES	125.00
INTAKE BLOCK 13541318319	2.00	105.17	210.34	REPLACE DRIVE BELTS	N/C
EXHAUST VALVE 11341309487	8.00	42.67	341.36	REPLACE EXPANSION TANK	N/C
VALVE SPRING- INNER/OUTER ASSEMBLY 11341312867	16.00	36.00	576.00	BRAKE FLUID CHANGE	125.00
COPPER EX. NUT 6MM 11621304755	16.00	0.69	11.04	DRAIN FLUID, REMOVE AND CLEAN RESERVOIR. REINSTALL AND RENEW FLUID. BLEED ENTIRE BRAKE SYSTEM.	
EXHAUST NUT - 10MM 18301737774	6.00	1.13	6.78	REPLACE FRONT BRAKE PADS	125.00
EXHAUST NUT 8MM 18307620549	8.00	0.95	7.60	REMOVE WHEELS AND BRAKE CALIPERS. REPLACE ROTORS AND COAT PADS WITH ANTI SQUEAL COMPOUND. LUBRICATE HUBS AND CALIPERS, INSTALL ROTORS AND BRAKE PADS. TORQUE WHEELS AND BED PADS ON ROAD TEST.	
EXHAUST STUD- 6MM 11121312096	2.00	4.15	8.30	REPLACE LEFT FRONT CONTROL ARM	175.00
OIL FILTER M3 (E30) 11421258039	1.00	10.73	10.73	REPLACE LEFT AND RIGHT TIE ROD ASSEMBLIES	225.00
EXHAUST FLANGE GASKET 11761308686	2.00	11.54	23.08	4 WHEEL ALIGNMENT	145.00
MUFFLER HANGER 18211728332	2.00	4.32	8.64		
W/P TO RETURN PIPE HOSE 11531266472	1.00	7.33	7.33		
EXPANSION TANK HOSE 11531309667	1.00	10.39	10.39		
RADIATOR TO T-STAT 11531309668	1.00	11.37	11.37		
T-STAT TO WATER PIPE 11531309669	1.00	59.84	59.84		
THERMOSTAT TO WATER LINE					

**ENGINE
RBLD**

North Bay Bavarian
1801 Empire Industrial Ct.
Santa Rosa, CA. 95403
Phone - 707-545-0820
Independent BMW Specialists

INVOICE

36724

Org. Est. # 118410
EPA#000004766
BAR#AB137993

INVOICE

Print Date : 06/27/2014

Angwin, CA 94508
Home 2 --- Office
Cust ID : 4579

1988 BMW - M3
2.3L, In-Line4, VIN (3)
Lic # : 4ADD683
Unit # : WBSAK0302J219734
Vin # : **2197343**
Hat # :

Odometer In : 182640

Ref # :

Part Description / Number	Qty	Sale	Extended	Labor Description	Extended
11531309670 RADIATOR HOSE- UPPER	1.00	13.54	13.54	CHANGE TRANSMISSION FLUID	37.50
11531309680 EXPANSION TANK HOSE	1.00	18.61	18.61	CHANGE DIFFERENTIAL FLUID	37.50
17111150232 EXPANSION TANK BREATHER HOSE	1.00	4.57	4.57	REPLACE FUEL LINES	125.00
17121712736 HEATER HOSE E30	1.00	50.26	50.26	REPLACE VACUUM LINES	N/C
64218367834 BELT	1.00	9.60	9.60	MACHINE WORK	3,600.00
10-864 BELT	1.00	10.20	10.20	MACHINE WORK	
10-813 BELT	1.00	9.90	9.90	REPLACE RADIATOR AND HEATER HOSES	150.00
13-810 EXPANSION TANK	1.00	11.30	11.30	REPAIR SUBFRAME AT MOTOR MOUNTS	187.50
17112225543 BRAKE FLUID	1.00	86.76	86.76	REPAIR BUMPER ON PASSENGER SIDE.	87.50
01BF BRAKE CLEAN	2.00	9.89	19.78	REMOVE BUMPER AND REPLACE PASSENGER SIDE BUMPER BRACKET.	
01B BRAKE PAD SENSOR- E30 REAR	1.00	9.60	9.60	DETAIL	175.00
34351179819 BRAKE PAD SET E28	1.00	12.04	12.04	CHECK A/C SYSTEM	312.50
34111161717 CONTROL ARM - E30	1.00	130.13	130.13	EXPANSION VALVE IS CLOGGED, TEMP SENSOR AT THERMOSTAT IS FAULTY. NEED TO REPLACE AND RECHECK	
31121127725 CONTROL ARM BUSHING E30 M3	1.00	163.07	163.07	PERFORMANCE CAM REGRIND	625.00
31129061222 TIE ROD ASSEMBLY E30 L/R	1.00	44.48	44.48	Hazardous Materials	6.00
32111125186 STEERING RACK BOOT	2.00	159.25	318.50		
32111127104 LOCK PLATE STEERING RACK E30	2.00	14.42	28.84		
32111124540 CLUTCH RELEASE BEARING	2.00	2.70	5.40		
21517521471	1.00	68.34	68.34		

ENGINE REBUILD

North Bay Bavarian
1801 Empire Industrial Ct.
Santa Rosa, CA. 95403
Phone - 707-545-0820
Independent BMW Specialists

INVOICE

36724

Org. Est. # 118410
EPA#000004766
BAR#AB137993

INVOICE

Print Date : 06/27/2014

Angwin, CA 94508

Home : ? --- Office :

Cust ID : 4579

Ref # :

1988 BMW - M3

2.3L, In-Line4, VIN (3)

Lic # : 4ADD683

Unit # : WBSAK0302J219734

Vin # : **2197343**

Hat # :

Odometer In : 182640

Part Description / Number	Qty	Sale	Extended	Labor Description	Extended
REDLINE 75W90 GEAR OIL 0175W90	1.30	19.25	25.03		
MANUAL TRANS OIL REDLINE MTL	1.50	12.50	18.75		
VACUUM HOSE BLACK /FT 11727545323	3.00	4.28	12.84		
FUEL HOSE 13531726960	1.00	6.87	6.87		
FUEL LINE BULK 13311272750	0.50	32.23	16.12		
PRE-FORMED FUEL HOSE - SHORT 13311288284	1.00	17.10	17.10		
FUEL LINE 8X13 16121180409	1.00	22.37	22.37		
BREATHER HOSE- ICV TO DISTR. 13411309613	1.00	31.34	31.34		
BREATHER HOSE 13411311655	1.00	21.05	21.05		
RADIATOR- MISHIMOTO ALU. 17111468084	1.00	258.00	258.00		
THERMOSTAT 11531315537	1.00	115.62	115.62		
HEATER HOSE 64211370807	1.00	12.03	12.03		
HEATER HOSE 64211374908	1.00	24.68	24.68		
HEATER HOSE 64211381541	1.00	17.41	17.41		
TIMING CHAIN- ENDLESS 11311403081	1.00	146.93	146.93		
TIMING GUIDE RAIL- LEFT 11311308495	1.00	16.34	16.34		
TIMING SLIDE RAIL- UPPER 11311308550	1.00	138.13	138.13		
TIMING CHAIN TENSION RAIL- LOWER 11311308639	1.00	331.86	331.86		
TIMING CHAIN TENSION RAIL-					

**ENGINE
REBUILD**

North Bay Bavarian
1801 Empire Industrial Ct.
Santa Rosa, CA. 95403
Phone - 707-545-0820
Independent BMW Specialists

INVOICE

36724
Org. Est. # 118410
EPA#000004766
BAR#AB137993

INVOICE

Print Date : 06/27/2014

Angwin, CA 94508

Home - Office

Cust ID : 4579

Ref # :

1988 BMW - M3

2.3L, In-Line4, VIN (3)

Lic # : 4ADD683

Unit # : WBSAK0302J219734

Vin # : **2197343**

Hat # :

Odometer In : 182640

Part Description / Number	Qty	Sale	Extended	Labor Description	Extended
UPPER					
11311317335	1.00	276.79	276.79		
TIMING COVER GASKET- RIGHT					
11141727980	1.00	1.80	1.80		
TIMING COVER GASKET- LEFT					
11141727981	1.00	1.41	1.41		
M-3 CRANKSHAFT SEAL					
11141308342	1.00	34.16	34.16		
REAR CRANKSHAFT SEAL					
11142249533	1.00	34.56	34.56		
BUMPER BRACKET					
51111940378	1.00	12.49	12.49		
TEMP SENSOR					
12632241342	1.00	28.97	28.97		
EXPANSION VALVE					
64518391209	1.00	69.98	69.98		

[Technicians : LUU, CAM]

Org. Estimate	Revisions	Current Estimate	Additional Cost	Revised Estimate	Labor:	Parts:	Sublet:	Sub:	Tax:	Total:	Bal Due:
\$1,856.00	\$9,125.37	\$ 10,981.37	\$6,257.38	\$8,113.38	5,468.50	4,510.61	5,895.00	15,874.11	394.68	16,268.79	\$16,268.79
<small>NEEDED WORK DUNN, MIKE Customer Called In 03/26/2014 - 1:41 ROW, RICK Parts: \$2523.11 Labor: \$3012.50 Sublet: \$495.00 Taxes & Fees: \$226.77</small>											
<small>DUNN, MIKE 03/28/2014 - 2:12 <none> Parts: \$1344.36 Labor: \$1400.00 Sublet: \$0.00 Taxes & Fees: \$123.63</small>											

[Payments -]

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one years or 12,000 miles whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

SIGNATURE..... Date..... Time.....

North Bay Bavarian
 1801 Empire Industrial Ct.
 Santa Rosa, CA. 95403
 Phone: 707-545-0820 Fax: 707-545-0854
 Independent BMW Specialists

INVOICE

42876

Org. Est. # 137105
 EPA#000004766
 BAR#ARB00137993
 Printed: 06/23/2016

INVOICE

1988 BMW - M3 - 2.3L, In-Line4 (140CI) VIN(3)

Angwin, CA 94508

Home : ? Office :

Lic # : 4ADD683 - CA

Odometer In : 186835

Unit # : WBSAK0302J219734

VIN # : 2197343

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
OIL FILTER M3 (E30) 11421258039	1.00	12.83	12.83	ENGINE OIL AND FILTER CHANGE	67.50
SEAL RING 07119963129	1.00	0.65	0.65	CHANGE ENGINE OIL AND FILTER, CHECK TIRE PRESSURES, CHECK FLUIDS, CHECK BRAKES, CHECK CONDITION OF VEHICLE	
SWEPCO 20/50 ENGINE OIL 20/50 SWEPCO	5.00	13.50	67.50	REPLACE BROKEN REAR MUFFLER HANGER	40.50
EXHAUST HANGER 18211712838	1.00	7.52	7.52	***Discount*** \$25.00 off labor Hazardous Materials	6.00

Org. Estimate 210.24 Revisions 0.00 Current Estimate 210.24

Labor:	108.00
Parts:	88.50
HazMat:	6.00
Discount:	-25.00
SubTotal:	177.50
Tax:	7.74
Total:	185.24
Bal Due:	\$185.24

[Payments -]
 Vehicle Received: 6/23/2016

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is 12 months or 12,000 miles whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

Signature _____ Date _____ Time _____

Written By: ROW, MATTHEW - Technicians : LUU, CAM

**BRACES/
MAINT.**

North Bay Bavarian
1801 Empire Industrial Ct.
Santa Rosa, CA. 95403
Phone: 707-545-0820 Fax: 707-545-0854
Independent BMW Specialists

INVOICE

44896

Org. Est. # 139615
EPA#000004766
BAR#ARB00137993

INVOICE

Date: 02/28/2017

Angwin, CA 94508
Home : 12 Office :

1988 BMW - M3 - 2.3L, In-Line4 (140CI) VIN(3)
Lic # : 4ADD683 - CA Odometer In : 188341
Unit # : WBSAK0302J219734
VIN # : 2197343

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
MARKER - FRONT 63141385419	2.00	86.50	173.00	CHECK PASSENGER REAR VIEW MIRROR	0.00
MARKER LENSE - REAR 63141385420	2.00	86.50	173.00	INSTALL GOOD USED ENGINE	
OIL FILTER M3 (E30) 11421258039	1.00	12.83	12.83	CHECK FAN BELTS AND TIGHTEN	0.00
SEAL RING 07119963129	1.00	0.65	0.65	CHECK CORNER LIGHTS	0.00
SWEPCO 20/50 ENGINE OIL 20/50 SWEPCO	5.00	13.50	67.50	ENGINE OIL AND FILTER CHANGE	67.50
BRAKE CLEAN 01B	1.00	9.60	9.60	CHANGE ENGINE OIL AND FILTER, CHECK TIRE PRESSURES, CHECK FLUIDS, CHECK BRAKES, CHECK CONDITION OF VEHICLE	
BRAKE ROTOR FRONT 34112226813	2.00	113.00	226.00	CHECK GAUGES. FLICKER	101.25
BRAKE PAD SENSOR- E30 REAR 34351179819	1.00	10.22	10.22	REPLACE FRONT BRAKE PADS AND ROTORS	270.00
BRAKE PAD SET E28- FRONT 34111161717	1.00	124.30	124.30	REMOVE WHEELS AND BRAKE CALIPERS. REPLACE ROTORS AND COAT PADS WITH ANTI SQUEAL COMPOUND. LUBRICATE HUBS AND CALIPERS, TORQUE CALIPER BOLTS TO 110 Nm, INSTALL ROTORS AND BRAKE PADS. TORQUE WHEELS AND BED PADS ON ROAD TEST.	
				Discount \$50.00 off labor	
				Hazardous Materials	6.00

Org. Estimate 161.57 Revisions 0.00 Current Estimate 161.57

Labor:	438.75
Parts:	797.10
HazMat:	6.00
Discount:	-50.00
SubTotal:	1,191.85
Tax:	69.75
Total:	1,261.60
Bal Due:	\$1,261.60

[Payments -]
Vehicle Received: 2/3/2017

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is 12 months or 12,000 miles whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

Signature _____ Date _____ Time _____

Written By: ROW, MATTHEW - Technicians : LUU, CAM

North Bay Bavarian
 1801 Empire Industrial Ct.
 Santa Rosa, CA. 95403
 Phone: 707-545-0820 Fax: 707-545-0854
 Independent BMW Specialists

INVOICE

49481

Org. Est. # 144276
 EPA#000004766
 BAR#ARB00137993

INVOICE

Date: 06/25/2018

Santa Rosa, CA 95409
 Home

1988 BMW - M3 - 2.3L, In-Line4 (140CI) VIN(3)
 Lic # : 4ADD683
 Unit # : WBSAK0302J219734
 VIN# : 2197343

Odometer In : 190180

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
EXHAUST HANGER 18211712838	1.00	10.38	10.38	SWITCH EXHAUST SYSTEMS, SUPPLY CUSTOMER WITH FACTORY EXHAUST SYSTEM	232.50
				SMOG TEST	75.00

Org. Estimate 318.78 Revisions 0.00 Current Estimate 318.78

Labor:	232.50
Parts:	10.38
Sublet:	75.00
SubTotal:	317.88
Tax:	0.90
Total:	318.78
Bal Due:	\$318.78

[Payments -]
 Vehicle Received: 6/25/2018

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is 12 months or 12,000 miles whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

Signature _____ Date _____

Visit us on the web : www.WWW.NORTHBAYBAVARIAN.COM

Our Email Address: northbaybavarian@yahoo.com

Service Advisor : ROW, MATTHEW, Tech : LUU, CAM

North Bay Bavarian
 1801 Empire Industrial Ct.
 Santa Rosa, CA. 95403
 Phone: 707-545-0820 Fax: 707-545-0854
 Independent BMW Specialists

INVOICE

52007

Org. Est. # 146880
 EPA#000004766
 BAR#ARB00137993

INVOICE

Date: 04/18/2019

Santa Rosa, CA 95409

1988 BMW - M3 - 2.3L, In-Line4 (140CI) VIN(3)

Lic #: 4ADD683

Odometer In : 191589

Unit # : WBSAK0302J219734

VIN # : 2197343

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
FUEL PUMP RELAY 61368373700	1.00	20.27	20.27	CHECK CAUSE OF AUX. FAN NOT SHUTTING OFF. FOUND RELAY FOR AUX FAN WELDED AT CONTACTS. INSTALLED NEW RELAY AND CHECKED OPERATION. FAN IS WORKING CORRECTLY AT THIS TIME. [Recommendations] FRONT TIRES 33 PSI REAR TIRES 33 PSI FRONT BRAKES 12MM REAR BRAKES 11MM TRANS. SEEPING AT OUTPUT SEAL P/S HOSES SEEPING- RECHECK DIFF SEEPING AT SIDE SEALS	48.00

Org. Estimate 70.09 Revisions 0.00 Current Estimate 70.09

Labor:	48.00
Parts:	20.27
SubTotal:	68.27
Tax:	1.82
Total:	70.09
Bal Due:	\$70.09

Paid Cash

[Payments -]

Vehicle Received: 4/18/2019

Customer Number : 2561

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is 12 months or 12,000 miles whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

Signature _____

Date _____

Visit us on the web : www.WWW.NORTHBAYBAVARIAN.COM

Our Email Address: northbaybavarian@yahoo.com

Service Advisor : ROW, JAMES, Tech : WILSON, LOGAN

North Bay Bavarian
 1801 Empire Industrial Ct.
 Santa Rosa, CA. 95403
 Phone: 707-545-0820 Fax: 707-545-0854
 Independent BMW Specialists

INVOICE

47697

Org. Est. # 142435
 EPA#000004766
 BAR#ARB00137993

INVOICE

Date: 12/07/2017

Angwin, CA 94508
 Home : Office :

1988 BMW - M3 - 2.3L, In-Line4 (140CI) VIN(3)
 Lic # :4ADD683 - CA Odometer In : 189850
 Unit # :WBSAK0302J219734
 VIN # :2197343

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
OIL FILTER M3 (E30) 11421258039	1.00	12.83	12.83	ENGINE OIL AND FILTER CHANGE	77.50
SEAL RING 07119963129	1.00	0.65	0.65	CHANGE ENGINE OIL AND FILTER, CHECK TIRE PRESSURES, CHECK FLUIDS, CHECK BRAKES, CHECK CONDITION OF VEHICLE	
SWEPCO 20/50 ENGINE OIL 20/50 SWEPCO	5.00	13.50	67.50	***Discount*** \$25.00 off labor	
				Hazardous Materials	6.00

Org. Estimate 171.46 Revisions 0.00 Current Estimate 171.46

Labor:	77.50
Parts:	80.98
HazMat:	6.00
Discount:	-25.00
SubTotal:	139.48
Tax:	6.98
Total:	146.46
Bal Due:	\$146.46

[Payments -]
 Vehicle Received: 11/30/2017

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is 12 months or 12,000 miles whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

Signature _____ Date _____ Time _____

Written By: ROW, MATTHEW - Technicians : LUU, CAM