




2006 Aston Martin DB9 Volante Convertible

SCFAD02A86GB04741

Left Coast Classics

707-332-8331

Inspection Report

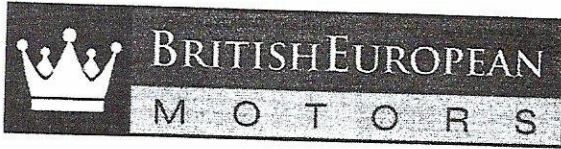

Pre-Owned Quality Assurance Inspection check List

Date: 5/17/19 Advisor: James Technician: Greg
 Year/Make/Model: 06 Aston Martin DB9 Miles: 23683
 Stock Number: — Ext. Color: Silver met Int. Color: Dark grey/charcoal
 VIN#: 04741 License#: 86E5220 RO#: —

Preliminary	O.K.	Action Required	Not Applicable
Next scheduled service performed (Oil & Filter)	✓		
Vehicle Exterior	O.K.	Action Required	Not Applicable
Correct VIN plate and anti-theft labels	✓		
Exterior lamp condition	✓		
Inspect the body and paint	✓		
Convertible top condition <u>Slight diamond scuffing</u>	✓		
Windshield condition	✓		
Wipers/condition of mechanism/blades	✓		
Doors open/close properly	✓		
Fuel cap/door working properly	✓		
Fuel-filler aperture drain (clean)	✓		
Side/rear windows condition	✓		
Bumper/fascia condition <u>Small scratches/curb scrapes</u>	✓	✓	
Grille/trim/molding condition	✓		
Luggage Area	O.K.	Action Required	Not Applicable
Tool kit present <u>Tool hook good</u>			✓
Spare tire size, condition and pressure			✓
Manual fuel lid release operation	✓		
CD magazine is present (if fitted)			✓
Trim/carpet condition <u>Some wear/scuffing</u>	✓		
Convertible top cover			✓

2006

Trunk lid closes properly	✓		
Engine Area			
Hood releases/locks properly	✓		
Automatic/manual transmission system condition and fluid level	✓		
Transfer case operation and fluid level			✓
Engine oil level and condition	New oil & filter ✓		
Power steering pump/hoses condition/leaks/fluid level	New fluid ✓		
Fluid level / Leaks and condition (other than listed)	✓		
Cooling system fluid level / protection level (recovery tank level) Leaks?	✓		
Cooling fan/fan clutch/motor-condition/operation	✓		
Brake/clutch fluid level and condition	✓		
Washer fluid level	Full ✓		
Air filter condition	✓		
Spark Plug Wires/engine wiring	✓		
Vacuum hoses security/condition	✓		
Emissions (meets state/local requirements) 2008 & Older req. Smog			
Listen for any abnormal noises/engine running	✓		
Fuel pump noise/external fuel pump leakage	✓		
Fuel lines/hoses/pressure (leaks/record reading)	✓		
Drive belts condition	✓		
Coolant hoses	✓		
Brakes/clutch master cylinder and booster	✓		
Clutch operation/engagement			✓
Vehicle Interior			
Damaged wood, leather or carpets	New wood on Dash/Doors ✓		
Fit/condition of glove box, console box and trim	New leather Dash/panels ✓		
Ashtray operation	✓		
Sun visor operation	✓		
Airbag/intact/no codes/dash lamp works properly	✓		
Child safety door latches			✓
Condition of seat belts	✓		
Tilt telescope/lock function of steering column	✓		
Operation of rear window shades (if fitted)			✓
All mirrors: condition/operation	✓		
Interior door handle operation	✓		
Trim-door trim/headliner	✓		

Electrical Systems	O.K.	Action Required	Not Applicable
Stored engine, transmission or brake system codes//OBDII Monitors	✓		
Interior lamps including glove box	✓		
Vanity mirror lighting			✓
Sunroof operation/limit switch			✓
Operation of power convertible top	✓		
Window operation	✓		
Central locking system	✓		
Seat adjustments, memory/heated	✓		
Electrical trunk release	✓		
Door mirrors, including memory (if fitted)	✓		
Clock	✓		
Cigar lighter(s)			✓
Horns	✓		
Wiper(s)-all speed-rain sensor (if fitted)	✓		
Headlamp washer jets (if fitted)	✓		
Heated rear/front windshield	✓		
Blower motor operation/check for noise	✓		
Instrument panel warning lamps	✓		
Fuel pump inertia switch	✓		
Instrument illumination including dimmer	✓		
Door, trunk and hood lamps	✓		
Radio/cassette/CD operation	✓		
All speakers (including audible warning)	✓		
Electrical antenna (if fitted)			✓
Gear shift/key interlock system	✓		
Battery condition and specification	✓		
Starter/alternator operation	✓		
Alarm system (if fitted)	✓		
Warning chimes	✓		

Electrical Systems (Exterior)	O.K.	Action Required	Not Applicable
Parking/headlamps/tail lamps	✓		
Fog lamps-front/rear			✓
Hazard lamps	✓		
Brake lamps (including high-mount)	✓		
Reverse lamps	✓		
Directional signals	✓		
License plate lamps	✓		
Heating/Air-conditioning Systems			
	O.K.	Action Required	Not Applicable
Operation in manual and automatic mode	✓		
Air distribution and vent controls	✓		
Re-circulation feature	✓		
Outlet temperature heating /cooling	✓		
Exterior temperature function	✓		
Undercarriage/Drivetrain			
	O.K.	Action Required	Not Applicable
Frame or underbody damage	✓		
Suspension-sway bars/control arms/bushings-wear/damage	✓		
Springs/shocks/struts-damage/wear/leaks <i>New</i>	✓		
Steering rack-and-pinion/linkage/tie rods wear/damage	✓		
Fluid leaks	✓		
Engine and transmission mounts	✓		
All brake lines and couplings	✓		
Exhaust system/catalytic converter/manifold	✓		
Front wheel bearings	✓		
Parking brake and cables	✓		
Brake pads/disks/calipers front and rear			
Front Driver <u>10</u> Front Pass <u>10</u> Rear Driver <u>10</u> Rear Pass <u>10</u> mm <i>New Brakes front & rear</i>			
Road wheel nuts-torque <i>100LBS</i>	✓		
Wheels-size/condition <i>New wheels & Tires</i>	✓		
Tire pressure and specification <i>35F 38R</i>	✓		
Tire tread depth			
Front Driver <u>12</u> Front Pass <u>12</u> Rear Driver <u>12</u> Rear Pass <u>12</u> mm <i>New Tires front & rear</i>			
Rear differential fluid level	✓		

	O.K.	Action Required	Not Applicable
Universal CV joints/boots condition	✓		✓
Road Test			
Engine start – up cold/hot (excessive exhaust smoke)	✓		
Instrument pack gauges for normal operation	✓		
Trip computer	✓		
Cruise control	✓		
Automatic/manual transmission shift quality/shift points	✓		
Abnormal wind noise	✓		
Engine performance	✓		
Vibration (drivetrain and wheels)	✓		
Straight-line stability/pull	✓		
Steering wheel alignment	✓		
Braking system including ABS/parking brake	✓		
Vehicle handling	✓		
Safety belts inertia locking system	✓		
Heating and air-conditioning system	✓		
Abnormal noises	✓		
Engine idle-smoothness and RPM	✓		
Reverse park control operation	✓		
Navigation system/compass (if fitted)	✓		
Navigation CD/DVD (if fitted)	✓		
Voice activation system (if fitted)	✓		✓

Required Technician Signature

I certified that all items have been inspected.

British European Motors Technician

Date

5/14/19

Required Manager Signature

I certified that all mechanical, detailing, and appearance repair standards have been met.

British European Motors Service Advisor

Date

5/17/19

British European Motors Service Manager

Date

RECOMMENDATIONS/ACTIONS REQUIRED

Minor scuffs & scraping on lower bumper
To Skid shield - Skid shield scuffs & scrapes

No Damage found from previous Damage Reports

Other Than scuffs & scrapes from Normal In & out
of Drive ways -

Repair Orders

Invoice No.
280918008

Order Date 09/18/18 04:46 pm
Closed 11/4/2018

7009

Z: 11e SANTA ROSA CA 95404 Cell: Home*:	06 ASTON MARTIN DB9 Mileage in:23499 out:23499 Lic: 8GES220/CA 12Cyl 6.0 Vin: SCFAD02A86GB04741 11/05 Eq: AT AC PS FI DC Fleet # Dolores	Quotes 1 09/19/18 10:57am 401.00 Paul in person. 2 10/04/18 11:49am36926.90 Paul by phone jobs1-27
--	---	---

7009 deposit credit card \$24500. 10/4/2018
WOOD REFINISHING COST, NO ESTIMATE AVAILABLE TILL REMOVED AND SENT IN FOR
INSPECTION... ALL TRIM AND UPHOLSTERY SEPERATED OUT FOR NEX GO AROUND,
FURTHER INSPECTION OF DOOR PANELS TO ATTEMPT AND REPAIR TO LOOK BETTER
AND CHANGE AT A LATER DATE

added dismount/Balance 10/19/18 12:10pm

Job01 Check Engine Light On Labor: \$176.00

Customer purchased vehicle and drove back from LA- wile driving to Monterey-
check engine light came on
** Thermostat code P0128, temp out of range, recommend replacement first and then
recheck

Status: Completed Tech: GV

Job Subtotal: \$176.00

Job02 Ac Not Working Labor: \$0.00

Wile driving noticed ac not working... Need to start with main line that is
actively leaking and then service the system. Repair carried out on sepearte
invoice

Status: Completed Tech: Dr.

Job Subtotal: \$0.00

Job03 Door Panel End Caps/Panels Labor: \$0.00

Removed and sent capping (wood) for refinishing, remainder to be carried out with
trim repairs

Status: Completed Tech: GV

Job Subtotal: \$0.00

----->----->----->-----Continued on the next page----->----->----->----->

Invoice No.
280918008

Order Date 09/18/18 04:46 pm
Closed 11/4/2018

7009

Job04 Service?-WITH RELATED REPAIRS Labor: \$0.00

Service needed... Carried out with repairs

Status: Completed Tech: Dr.

Job Subtotal: \$0.00

Job05 Tires? Labor: \$0.00

Match Brand from last car

Status: Completed Tech: Dr.

Job Subtotal: \$0.00

Job06 Dash Top- Peeling Up... Labor: \$0.00

TO BE ADDRESSED WITH INTERIOR TRIM/WOOD

Status: Completed Tech: JSB

Job Subtotal: \$0.00

Job07 Wheels?-Supplied Labor: \$0.00

Confirmed and ordered

Status: Completed Tech: Dr.

Job Subtotal: \$0.00

Job08 (*) POST-PURCHASE INSPECTION Labor: \$225.00

REPORT VALID AT TIME OF INSPECTION ONLY.
ANY ESTIMATES ON PRICES FOR REPAIRS VALID FOR 7 DAYS, SUBJECT TO INCREASE
THEREAFTER.

THIS INSPECTION IS CARRIED OUT WITHOUT BIAS AND IS VISUAL NO COMPRESSION TEST IS
CARRIED OUT, (UNLESS AGREED TO IN WRITING PRIOR TO INSPECTION AND LISTED AS A
SEPERATE CHARGE. IF THE VEHICLE HAS OBDII DIAGNOSTIC ABILITY THEN IT WILL BE
SCANNED BY OUR COMPUTOR (IF ABLE) RESULTS WILL BE LISTED (IF ABLE). NO FURTHER

----->----->----->-----Continued on the next page--->----->----->----->

Invoice No.
 280918008

Order Date 09/18/18 04:46 pm
 Closed 11/4/2018

7009

Job08 (*) POST-PURCHASE INSPECTION

(IF ABLE) RESULTS WILL BE LISTED (IF ABLE). NO FURTHER WARRANTY IS IMPLIED OR OTHERWISE AS TO THE VEHICLES PRIOR ACCIDENT OR INCIDENT HISTORY AND PAINTWORK AND COSMETIC APPEARANCE IS GRADED AS TO OUR EXPERIENCE COMPARED WITH OTHER VEHICLE OF SAME TYPE OR YEAR. THIS IS SUBJECT TO MATTER OF OPINION. IT IS ALSO UNDERSTOOD AND IS

Status: Completed Tech: GV

Job Subtotal: \$225.00

Job09 Tread Plate Name-ORDERED

Labor: \$0.00

Just Aston Martin-ORDERED

Status: Completed Tech: Dr.

Job Subtotal: \$0.00

Job10 V. Cover Gaskets/Service/Plugs

Labor: \$2,340.00

Completed most of work, then had to hold on additional parts order, move partial labor to following invoice

0W/40 SYN	ENGINE OIL SYNTH M1 (pn-N)	28.0 @	5.57 =\$	155.96
AG43-6714-AA	OIL FILTER-N	1.0 @	117.04 =\$	117.04
07-85057	CAM COVER GASKET-S	1.0 @	208.10 =\$	208.10
07-85366	GASKET- SPRK PLUG-S	12.0 @	21.80 =\$	261.60
07-85056	CAM COVER GASKET-S	1.0 @	208.10 =\$	208.10
1R12-08-10077-PK	INTAKE MAN. GASKET-S	1.0 @	551.34 =\$	551.34
07-85126	SPARK PLUG-S	12.0 @	106.05 =\$	1272.60
46580	PARTS CLEANER/BRAKE-N	3.0 @	7.98 =\$	23.94
				2798.68

Status: Completed Tech: GV

Job Subtotal: \$5,138.68

Job11 (**) Brake Fluid Service

Labor: \$390.00

----->----->----->-----Continued on the next page----->----->----->----->

Invoice No.
280918008

Order Date 09/18/18 04:46 pm
Closed 11/4/2018

7009

Job11 (**) Brake Fluid Service

Drain and add clean fluid
Bleed system and top off master cylinder reservoir as required

LMA	BRAKE FLUID , CASTROL **-N	32.0 @	0.96 =\$	30.72	
46580	PARTS CLEANER/BRAKE-N	2.0 @	7.98 =\$	15.96	46.68

Status: Completed Tech: GV

Job Subtotal: \$436.68

Job12 Front Brake Pads & Rotors, Labor: \$565.50

Replacement front brake pads and rotors. Pad sensors not required at this time

4G43-28-10941	BRAKE PADS-S	1.0 @	932.09 =\$	932.09	
4G43-2C564-AB	BOLT-S	4.0 @	11.28 =\$	45.12	
8D33-2C564-AA	BOLT-S	4.0 @	37.80 =\$	151.20	
4G43-28-10265	BRAKE ROTOR-S	2.0 @	448.03 =\$	896.06	2024.47

Status: Completed Tech: GV

Job Subtotal: \$2,589.97

Job13 R. Pads, Rotors, Sensor, Ebrake Labor: \$585.00

Install replacement brake rotors, pads and sensors

4G43-28-10942	REAR BRAKE PADS-S	1.0 @	882.25 =\$	882.25	
4G43-28-10266	BRAKE ROTOR-S	2.0 @	466.33 =\$	932.66	
4G43-2D009-AB	PAD WEAR SENSOR-N	2.0 @	126.49 =\$	252.98	
4G43-2C562-BA	E- BRAKE PADS-S	1.0 @	340.07 =\$	340.07	
46580	PARTS CLEANER/BRAKE-N	3.0 @	7.98 =\$	23.94	2431.90

Status: Completed Tech: GV

Job Subtotal: \$3,016.90

Job14 Rear Strut Assemblies Labor: \$1,852.50

----->----->----->-----Continued on the next page----->----->----->----->

Invoice No.
280918008

Order Date 09/18/18 04:46 pm
Closed 11/4/2018

7009

Job14 Rear Strut Assemblies

Raise vehicle, remove rear fender liners and loosen and remove up rights. Loosen and remove lower shock mount and upper mount bracket. Dissassemble and assemble replacement springs and shocks. Secure all and refit and secure both left and right uprights

4G43-18080-DD	REAR STRUT ASSY-S	2.0 @ 2937.77 =\$	5875.54	5875.54
---------------	-------------------	-------------------	---------	---------

Status: Completed Tech: GV

Job Subtotal: \$7,728.04

Job15 Tires Supplied

Labor: \$0.00

235/40/ZR19	POTENZA RE050A-S	2.0 @ 461.86 =\$	923.72	
275/35/ZR19	POTENZA RE050A-S	2.0 @ 524.00 =\$	1048.00	1971.72

Status: Completed Tech: SL

Job Subtotal: \$1,971.72

Job16 Set Used Rims

Labor: \$0.00

Match to prior vehicle, picture confirmation from customer

2006/USED	RIM-FRONT-U	2.0 @ 750.00 =\$	1500.00	
2006/R-USED	RIM-REAR-U	2.0 @ 750.00 =\$	1500.00	3000.00

Status: Completed Tech: Dr.

Job Subtotal: \$3,000.00

Job17 Dis/mount/balce 4 tires

Sublet: \$164.75

Dismount four tires
Mount, computer spin balance including valve cores
or tpms rebuild

Tire Pressure: following work order

----->----->----->-----Continued on the next page----->----->----->----->

BRITISH EUROPEAN MOTORS
606 Portal Street
Cotati, CA 94931
Phone: 707 792-2737 FAX: 707 792-4454

Invoice No.
280918008

Order Date 09/18/18 04:46 pm
Closed 11/4/2018

7009

Payments to British European Motors	Cost Summary
-------------------------------------	--------------

Labor	6134.00
Parts	18148.99
Sublet	164.75
Haz Waste	5.00
Freight	385.00
Ca. State RecycFe	7.00
Freight-tires	20.00
Tire Disposal Fee	15.80
Freight Rims	150.00
Subtotal	25030.54
Tax	1656.10
Total	\$26686.64

1 11/02/1824500.00 Visa 10/4/2018 dep.
2 11/03/18 2186.64 On Acct
--A/R Pmt Allocations--
11/13/18 \$2,186.64
*Unpaid Bal: \$0.00

Thank you for choosing British European Motors

Invoice No.
281105003

Order Date 11/05/18 08:22 am
Closed 11/10/2018

SANTA ROSA CA 95404 Cell: Home*:	06 ASTON MARTIN DB9 Mileage in:23499 out:23499 Lic: 8GES220/CA 12Cyl 6.0 Vin: SCFAD02A86GB04741 11/05 Eq: AT AC PS FI DC Fleet # Dolores	<u>Quotes</u> 1 11/05/18 08:26am11207.71 <u>Paul in person.</u>
--	--	---

Job01 Add. Eng Parts Reqd/Assemble	Labor: \$1,170.00
---	--------------------------

Replacement parts had to be ordered and then work completed from initial invoice for vavle cover gaskets and spark plugs/service

07-85755	SENSOR, CID-S	1.0 @	310.32 =\$	310.32	
4G43-39-10014	SENSOR, CRANK-S	1.0 @	51.18 =\$	51.18	
1L5Z-6C315-AA	CRANK SENSOR-N	1.0 @	280.93 =\$	280.93	642.43

Status: Completed Tech: GV

Job Subtotal: \$1,812.43

Job02 A/C Pressure Line	Labor: \$897.00
--------------------------------	------------------------

Hook up a/c machine and drain system, disconnect and remove leaking a/c line and install replacement. Evacuation and testing on seperate line

AG43-19972-AA	AC PRESSURE HOSE-S	1.0 @	988.85 =\$	988.85	988.85
---------------	--------------------	-------	------------	--------	--------

Status: Completed Tech: GV

Job Subtotal: \$1,885.85

Job03 Power Steering Pressure Hose	Labor: \$585.00
---	------------------------

Drain system and remove leaking pressure hose, clean fittings and install replacement hose. secure and bleed system with clean fluid. Run and top off as required.

4G43-3A719-AE	P. STEERING PRESSURE H-S	1.0 @	857.92 =\$	857.92	
46580	PARTS CLEANER/BRAKE-N	2.0 @	7.98 =\$	15.96	
83290429576	HYDR/STR FL(AU/XK) 1LTR-N	2.5 @	39.40 =\$	98.50	972.38

Status: Completed Tech: GV

Job Subtotal: \$1,557.38

Job04 Wiper Blades	Labor: \$0.00
---------------------------	----------------------

----->----->----->-----Continued on the next page----->----->----->----->

Invoice No.
 281105003

Order Date 11/05/18 08:22 am
 Closed 11/10/2018

Job04 Wiper Blades

9G43-17B437-AA	WIPER BLADE-S	1.0 @	114.28 =\$	114.28	
4G43-17528-CA	R/H WIPER BLADE-N	1.0 @	98.80 =\$	98.80	213.08

Status: Completed Tech: GV

Job Subtotal: \$213.08

Job05 (*)Air Conditioning Service 134 Labor: \$250.00

Hook up A/C rec machine, check pressures. Drain & evacuate system, measure amount of removed freon if any. Hold system in vacuum state to see if holds, if holds, recharge including leak dye to man specs. Visual inspection if any emediate leaks, if system starts to lose efficiency, a recheck for leaks maybe required.

R-134A	FREON R-134A-N	48.0 @	1.29 =\$	61.92	
BG702	LEAK DYE/LUBRICANT (a/c) -N	1.0 @	16.00 =\$	16.00	
BG708	FRIDGI QUIET-N	1.0 @	16.02 =\$	16.02	93.94

Status: Completed Tech: SL

Job Subtotal: \$343.94

Job06 Thermostat Replace Labor: \$292.50

Dissassemble housing and remove thermostat. clean area and install replacement with new seals and o-ring.
 Secure housings and hoses.

46580	PARTS CLEANER/BRAKE-N	1.0 @	7.98 =\$	7.98	
A/F AFPXA003	ANTIFREEZE (pnts)-N	24.0 @	3.94 =\$	94.56	
4G4E-8575-AB	THERMOSTAT-N	1.0 @	398.62 =\$	398.62	
32-85116	THERMOSTAT SEAL-S	1.0 @	63.41 =\$	63.41	
32-85114	THERMOSTAT O RING-S	1.0 @	9.13 =\$	9.13	573.70

Status: Completed Tech: GV

Job Subtotal: \$866.20

Job07 Update Conv Top ECU/Actuators Labor: \$528.00

----->----->----->---Continued on the next page--->----->----->----->

Invoice No.
281105003

Order Date 11/05/18 08:22 am
Closed 11/10/2018

Job07 Update Conv Top ECU/Actuators

Remove panels and update covers and insulate to drain off any moisture, both in convertible top ECU and in actuating rams left and right, both suspect failures, carried out with rear strut work due to much better access at time of repairs, all drains clear and sized for draining and moisture build up through insulation

Status: Completed Tech: GV

Job Subtotal: \$528.00

Job08 Computerized 4 Wheel Alignment

Sublet: \$145.00

Computerized four wheel alignment
Adj/Set front toe

Job09 Correct R.Muffler By-Pass

Labor: \$0.00

Remove wire holding back vacuum actuators

Status: Completed Tech: Dr.

Job Subtotal: \$0.00

Job10 Check Fit Wheels

Labor: \$234.00

Smooth/treat inside of wheels at mating surface for ease of fit on each wheel hub, secure with original lug nuts

Status: Completed Tech: GV

Job Subtotal: \$234.00

Job11 Wheel Caps Supplied

Labor: \$0.00

HY53-1A096-BA-PK HUB CENTR CAP-SET-S

1.0 @ 149.69 =\$ 149.69 149.69

Status: Completed Tech: Dr.

Job Subtotal: \$149.69

----->----->----->---Continued on the next page--->----->----->----->

Invoice No.
281105003

Order Date 11/05/18 08:22 am
Closed 11/10/2018

Job12 Threshold Name Plate Labor: \$0.00

Supply and install threshold-sill name plates, retain originals for customer

4G43-80-10787	NAME PLATE-S	2.0 @	351.32 =\$	702.64	702.64
---------------	--------------	-------	------------	--------	--------

Status: Completed Tech: Dr.

Job Subtotal: \$702.64

Tire Pressure: LF[] RF[] LR [] RR []

Payments to British European Motors Cost Summary

Labor	3956.50
Parts	4336.71
Sublet	145.00
Haz Waste	6.00
Freight	35.00
Subtotal	8479.21
Tax	395.72
Total	\$8874.93

1 11/09/18 8874.93 On Acct
--A/R Pmt Allocations--
11/13/18 \$8,874.93
*Unpaid Bal: \$0.00

Thank you for choosing British European Motors

Invoice No.
281102004

Order Date 11/02/18 11:09 am
Closed/Paid: 12/07/18 05:05 pm

SANTA ROSA CA 95404 Cell: Home*:	06 ASTON MARTIN DB9 Mileage in:23499 out:23499 Lic: 8GES220/CA 12Cyl 6.0 Vin: SCFAD02A86GB04741 11/05 Eq: AT AC PS FI DC Fleet # Dolores	<u>Quotes</u> 1 12/07/18 03:27pm 3721.97 Paul by phone.
--	---	---

Job01 Remove Wood Interior Trim Etc Labor: \$390.00

Remove interior wood trim and send for estimate/repairs/refinishing

Status: Completed Tech: GV

Job Subtotal: \$390.00

Job02 Dash/Door Cap Wood Refit Labor: \$487.50

Refit and secure best possible on door capping, center console installed. Follow up pieces of dash ordered and awaiting, upon arrival, customer to drop off for 1 week turn around/install

Status: Completed Tech: GV

Job Subtotal: \$487.50

Job03 Dash Leather Move To New Invoice Labor: \$0.00

Dash leather repairs moved to a separate invoice to start repairs

Status: Completed Tech: Dr.

Job Subtotal: \$0.00

Job04 Wood Refinishing Sublet: \$2,435.47

4 pieces repairs as required, gloss finish

Job05 Touch Up Sensor Sublet: \$189.00

Color tint, refinish rear parking sensors

----->----->----->---Continued on the next page--->----->----->----->

BRITISH EUROPEAN MOTORS
606 Portal Street
Cotati, CA 94931
Phone: 707 792-2737 FAX: 707 792-4454

Invoice No.
281102004

Order Date 11/02/18 11:09 am
Closed/Paid: 12/07/18 05:05 pm

Tire Pressure: LF[36] RF[36] LR [38] RR [38]

Payments to British European Motors	Cost Summary
-------------------------------------	--------------

Status: Closed Work Order
Payments: \$3,721.97
1 12/07/18 3721.97 Visa

Labor	877.50
Parts	0.00
Sublet	2624.47
Freight	20.00
Freight-wood in/ou	200.00
Subtotal	3721.97
Total	\$3721.97
Payments	3721.97
Bal Due	0.00

Thank you for choosing British European Motors

Invoice No.
 281113001

Order Date 11/13/18 08:17 am
 Closed 11/24/2018

SANTA ROSA CA 95404	06 ASTON MARTIN DB9
Cell: 9	Mileage in:23499 out:23499
Home*: 7	Lic: 8GES220/CA 12Cyl 6.0
	Vin: SCFAD02A86GB04741 11/05
	Eq: AT AC PS FI DC
	Fleet # Dolores

Quotes
 1 11/19/18 08:24am 3795.62
 Paul in person.

Job01 Battery Tender Labor: \$88.00

Wire and test battery tender

CHG0043	BATTERY TENDER-N	1.0 @	155.67 =\$	155.67	155.67
---------	------------------	-------	------------	--------	--------

Status: Completed Tech: GV

Job Subtotal: \$243.67

Job02 Under Body Front Tray/Mount Labor: \$563.20

Repair, refit and align undertray without replacing, add new hardware as required.

BOLT	BOLT-N	12.0 @	0.79 =\$	9.48	
WASHER	WASHER (FLAT)-N	12.0 @	0.20 =\$	2.40	
WASHER (LOCK)	WASHER (locking)-N	12.0 @	0.27 =\$	3.24	15.12

Status: Completed Tech: GV

Job Subtotal: \$578.32

Job03 Trans Shift Release Update Labor: \$211.20

Acces release cable at transmission, Adapt and secure park release cable to prevent cable shift and trans park fault

Status: Completed Tech: GV

Job Subtotal: \$211.20

Tire Pressure:set prior

Payments to British European Motors Cost Summary

----->----->----->---Continued on the next page--->----->----->----->

BRITISH EUROPEAN MOTORS
606 Portal Street
Cotati, CA 94931
Phone: 707 792-2737 FAX: 707 792-4454

Invoice No.
281113001

Order Date 11/13/18 08:17 am
Closed 11/24/2018

Payments to British European Motors

Cost Summary

Labor	862.40
Parts	170.79
Subtotal	1033.19
Tax	15.58
Total	\$1048.77

1 11/21/18 1048.77 On Acct

Thank you for choosing British European Motors

Invoice No.
 281210002

Order Date 02/01/19 12:00 pm
 Closed 5/11/2019

7202

SANTA ROSA CA 95404 Cell: Home*:	e	06 ASTON MARTIN DB9 Mileage in:23499 out:23499 Lic: 8GES220/CA 12Cyl 6.0 Vin: SCFAD02A86GB04741 11/05 Eq: AT AC PS FI DC Fleet # Dolores
--	---	---

Quotes

1 12/07/18 03:27pm10671.85
 Paul in person.

7202

Job01 Door Panel End Caps/Trim Labor: \$1,384.50

Seperate door panels and plastic capping from both front doors, Assemble both front door, drivers with used panel, passenger new. Cut and fit replacement speaker cover material. Refit all and secure.

4G43-237A77-ACW	END CAP PANEL-S	1.0 @	181.98 =\$	181.98	
4G43-237A76-ACW	END CAP PANEL-S	1.0 @	181.98 =\$	181.98	
4G43-23901-AB	DOOR PANEL PLASTIC-S	1.0 @	289.52 =\$	289.52	
4G43-23900-AB	DOOR PANEL PLASTIC-S	1.0 @	289.52 =\$	289.52	
4G43-23901-AB	DOOR PANEL PLASTIC-S	-1.0 @	289.52 =\$	-289.52	
4G43-2901-AB/USE	PANEL ASSY USED-S	1.0 @	550.00 =\$	550.00	
34=0923	MATERIAL, SPEAKER-S	1.0 @	25.00 =\$	25.00	1228.48

Status: Completed Tech: GV

Job Subtotal: \$2,612.98

Job02 Dash Panels Labor: \$2,730.00

Remove dash panels and center console. Trim console and install panels supplied, othe credited panels could be supplied by manufacturer in anything like a timely manner

4G43-C043C54-AHW	PANEL-S	1.0 @	743.26 =\$	743.26	
4G43-C043C54-CHW	PANEL-S	1.0 @	743.32 =\$	743.32	
91909	PANEL- CONSOLE-S	1.0 @	2780.37 =\$	2780.37	
4G43-C044H58-AHW	PANEL-S	1.0 @	1631.52 =\$	1631.52	
4G43-C04634-BHW	PANEL-S	1.0 @	751.07 =\$	751.07	
91909	PANEL-CONSOLE-S	-1.0 @	2780.37 =\$	-2780.37	
4G43-C04634	AHW PANEL-S	-1.0 @	751.07 =\$	-751.07	3118.10

Status: Completed Tech: GV

Job Subtotal: \$5,848.10

----->----->----->---Continued on the next page--->----->----->----->

Invoice No.
281210002

Order Date 02/01/19 12:00 pm
Closed 5/11/2019

7202

Job03 Top Off Levels, Chck For Driving Labor: \$0.00

Check fluid levels, top off as required, check tire pressures, general check over for vehicle going back into service.

Status: Completed Tech: GV

Job Subtotal: \$0.00

Job04 Repair Console Sublet: \$973.97

Strip back and repair re-trim on center console as required

Job05 Instrument Trim Sublet: \$342.00

Remove trim and re-wrap original trim to cover shrinkage

Tire Pressure: LF[] RF[] LR [] RR []

Payments to British European Motors Cost Summary

Labor	4114.50
Parts	4346.58
Sublet	1315.97
Fuel Added	70.00
Freight	400.00
Subtotal	10247.05
Tax	402.06
Total	\$10649.11

1 05/08/1910649.11 On Acct

Thank you for choosing British European Motors

Invoice No.
 290508004

Order Date 05/08/19 04:30 pm
 Closed 5/18/2019

le	06 ASTON MARTIN DB9
SANTA ROSA CA 95404	Mileage in:23499 out:23499
Cell:	Lic: 8GES220/CA 12Cyl 6.0
Home*:	Vin: SCFAD02A86GB04741 11/05
	Eq: AT AC PS FI DC
	Fleet # Dolores

Quotes
 1 05/08/19 04:29pm 6393.76
 le in person.

paid total 9542.87 5/8/2019

Job01 Engine Missiring Labor: \$181.00

At idle and when driving, diagnose and call with estimate to repair

Status: Completed Tech: GV

Job Subtotal: \$181.00

Job02 Ignition Coils Labor: \$1,610.90

Remove instake and parts required to access ignition coils, in doing so the injector seals were discovered to be in need of replacement, installed and supplied upper and lower seals (parts showing on seperate task)

8G43-12A366-AA	IGNITION COIL-N	12.0 @	342.40 =\$	4108.80	4108.80
----------------	-----------------	--------	------------	---------	---------

Status: Completed Tech: GV

Job Subtotal: \$5,719.70

Job03 Additional Parts Required Labor: \$0.00

Injector o-ring seals, upper and lower

6G43-08-11260	FUEL INJECTION SEAL LO-S	12.0 @	23.03 =\$	276.36	
54498	INJECTOR UPPER SEAL-S	12.0 @	16.73 =\$	200.76	477.12

Status: Completed Tech: GV

Job Subtotal: \$477.12

Job04 Clean & Inspect-For Sale Labor: \$136.00

Clean off and carry out inspection to prepare the vehicle for sale showing documents to back up the repairs and services carried out

----->----->----->---Continued on the next page--->----->----->----->

BRITISH EUROPEAN MOTORS
606 Portal Street
Cotati, CA 94931
Phone: 707 792-2737 FAX: 707 792-4454

Invoice No.
290508004

Order Date 05/08/19 04:30 pm
Closed 5/18/2019

Job04 Clean & Inspect-For Sale

Status: Completed Tech: GV

Job Subtotal: \$136.00

Tire Pressure: LF[] RF[] LR [] RR []

Payments to British European Motors

Cost Summary

Labor	1927.90
Parts	4585.92
Freight	45.00
Emissions Test96-	68.00
Freight- Inj sals	20.00
Subtotal	6646.82
Tax	424.20
Total	\$7071.02

1 05/17/19 7071.02 On Acct

Thank you for choosing British European Motors

Carfax Report



CARFAX® Vehicle History Report™

US \$39.99

An independent company established in 1986

Vehicle Information:

2006 ASTON MARTIN DB9 VOLANTE

VIN: SCFAD02A86GB04741

CONVERTIBLE

5.9L V12 F

GASOLINE

REAR WHEEL DRIVE

[Standard Equipment](#) | [Safety Options](#)



Accident reported



Damage reported



2 Previous owners




4 Service history records



Personal vehicle



23,687 Last reported odometer reading

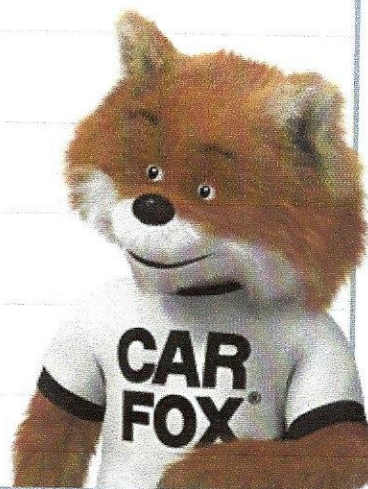

This CARFAX Vehicle History Report is based only on information supplied to CARFAX and available as of 6/9/19 at 3:45:31 PM (CDT). Other information about this vehicle, including problems, may not have been reported to CARFAX. Use this report as one important tool, along with a vehicle inspection and test drive, to make a better decision about your next used car.



Ownership History

The number of owners is estimated

	Owner 1	Owner 2
Year purchased	2006	2018
Type of owner	Personal	Personal
Estimated length of ownership	10 yrs. 2 mo.	7 months
Owned in the following states/provinces	California	California
Estimated miles driven per year	2,164/yr	---
Last reported odometer reading	22,933	23,687



Title History

CARFAX guarantees the information in this section

	Owner 1	Owner 2
Salvage Junk Rebuilt Fire Flood Hail Lemon	Guaranteed No Problem	Guaranteed No Problem
Not Actual Mileage Exceeds Mechanical Limits	Guaranteed No Problem	Guaranteed No Problem



GUARANTEED - None of these major title problems were reported by a state Department of Motor Vehicles (DMV). If you find that any of these title problems were reported by a DMV and not included in this report, CARFAX will buy this vehicle back. [Register](#) | [View Terms](#) | [View Certificate](#)



Additional History

Not all accidents / issues are reported to CARFAX


	Owner 1	Owner 2
Total Loss No total loss reported to CARFAX.	No Issues Reported	No Issues Reported


Structural Damage No structural damage reported to CARFAX.	No Issues Reported	No Issues Reported
Airbag Deployment No airbag deployment reported to CARFAX.	No Issues Reported	No Issues Reported
Odometer Check No indication of an odometer rollback.	No Issues Indicated	No Issues Indicated
Accident / Damage Damage reported on 05/05/2010. Accidents reported on: 10/26/2012 and 01/06/2013.	Accident Reported	No New Issues Reported
Manufacturer Recall Check with an authorized Aston Martin dealer for any open recalls.	Ask Your Dealer	Ask Your Dealer
Basic Warranty No data reported to CARFAX.	No Data Reported	No Data Reported



CARFAX Detailed History Glossary


Owner 1
 Purchased: 2006
 Type: Personal
 Where: California
 Est. miles/year: 2,164/yr
 Est. length owned: 1/3/06 - 3/18/16 (10 yrs. 2 mo.)

Low mileage!
 This owner drove less than the industry average of 15,000 miles per year.



Date:	Mileage:	Source:	Comments:
01/03/2006	72	California Motor Vehicle Dept. Los Angeles, CA	Title issued or updated First owner reported Titled or registered as personal vehicle
02/08/2006		California Motor Vehicle Dept. Los Angeles, CA	Title issued or updated Registration updated when owner moved the vehicle to a new location
05/05/2010		Damage Report	Damage reported Damage to front
 <div style="border: 1px solid gray; padding: 5px; display: inline-block;"> Not all damage is caused by an accident. Get the car inspected before you buy. Learn more </div>			
11/14/2011	11,686	California Inspection Station Los Angeles, CA	Passed emissions inspection
10/26/2012		California Damage Report	Accident reported It hit a stationary object Damage to front Airbags did not deploy

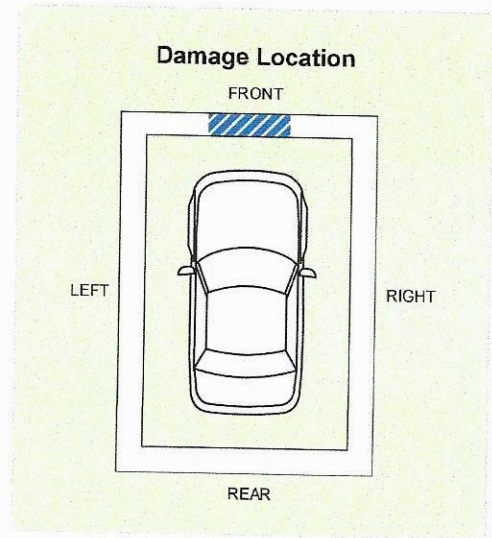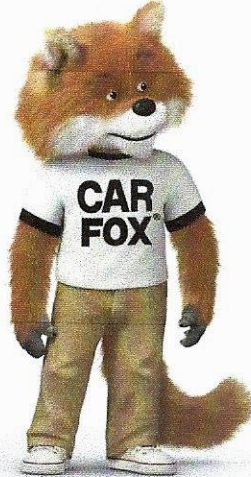

01/06/2013		Damage Report	Collision damage reported Damage to front Damage to right front Damage to left front
11/26/2013	16,648	California Inspection Station Los Angeles, CA	Failed emissions inspection
12/20/2013	17,029	California Inspection Station Los Angeles, CA	Passed emissions inspection
11/13/2014		California Motor Vehicle Dept. Los Angeles, CA	Registration updated when owner moved the vehicle to a new location
11/09/2015	21,690	California Inspection Station	Passed safety inspection Passed emissions inspection
01/11/2016	22,120	California Inspection Station	Passed safety inspection Passed emissions inspection
01/14/2016	22,124	BMW of Valencia Valencia, CA 661-200-9111 valenciabmw.com 4.4 ★★★★★ 67 Verified Reviews	Pre-delivery inspection completed Recommended maintenance performed Oil and filter changed Tire condition and pressure checked
01/25/2016		MINI of Valencia Valencia, CA 661-666-2980 miniofvalencia.com/ 4.3 ★★★★★ 34 Verified Reviews	Pre-delivery inspection completed
03/18/2016	22,172	Auto Auction California	Vehicle sold
			<p>Millions of used vehicles are bought and sold at auction every year.</p>
10/03/2016		Dealer Inventory	Vehicle offered for sale
10/09/2016	22,567	California Inspection Station	Passed safety inspection Passed emissions inspection
10/04/2017	22,774	Dealer Inventory	Vehicle offered for sale

07/19/2018 22,933 Dealer Inventory Vehicle offered for sale

Owner 2

Purchased: 2018
Type: Personal
Where: California
Est. length owned: 10/12/18 - present (7 months)

Date:	Mileage:	Source:	Comments:
10/12/2018		California Motor Vehicle Dept. Santa Rosa, CA	Title issued or updated New owner reported
11/12/2018	23,508	McLea's tire & Automotive Cotati, CA 707-792-0540 mcleantire.com 4.8 ★★★★★ 8 Verified Reviews	Vehicle serviced
05/21/2019	23,687	Auto Phoenix Cotati, CA 707-792-1512 myautophoenix.business.site/	Vehicle serviced

Have Questions? Please visit our Help Center at www.carfax.com.



Glossary

[View Full Glossary](#)

Accident Indicator

CARFAX receives information about accidents in all 50 states, the District of Columbia and Canada.

Not every accident is reported to CARFAX. As details about the accident become available, those additional details are added to the CARFAX Vehicle History Report. CARFAX recommends that you have this vehicle inspected by a qualified mechanic.

- According to the National Safety Council, Injury Facts, 2015 edition, 8% of the 254 million registered vehicles in the U.S. were involved in an accident in 2013. Over 74% of these were considered minor or moderate.
- This CARFAX Vehicle History Report is based only on information supplied to CARFAX and available as of 6/9/19 at 3:45:31 PM (CDT). Other information about this vehicle, including problems, may not have been reported to CARFAX. Use this report as one important tool, along with a vehicle inspection and test drive, to make a better decision about your next used car.

California Damage Reports:

- Provide an estimate of the extent of damage in its accident reports for the following:
 - MINOR : The vehicle damage affects only appearance, dents, glass, cracks, trim
 - MODERATE: Damage to one-fourth of the vehicle or less. Examples include entire fender, grille, quarter panel, door, hood.
 - SEVERE / MAJOR: Damage to more than one-fourth of the vehicle. Examples include entire side, rear end.
- Are required if the estimated damage exceeds \$500, or \$750 as of January 2003

Damage Indicator

Damage can be a result of many different types of events. Examples include contact with objects (other cars, trees, traffic signs, road debris, etc), vandalism, or weather-related events. Not every damage event is reported to CARFAX. As details about the damage event become available, those additional details are added to the CARFAX Vehicle History Report. CARFAX recommends that you have this vehicle inspected by a qualified mechanic.

- This CARFAX Vehicle History Report is based only on information supplied to CARFAX and available as of 6/9/19 at 3:45:31 PM (CDT). Other information about this vehicle, including problems, may not have been reported to CARFAX. Use this report as one important tool, along with a vehicle inspection and test drive, to make a better decision about your next used car.

Failed Emissions Inspection

The emissions check performed during a vehicle inspection indicated the vehicle was emitting more than allowable emissions standards and/or had missing or modified parts. Repeated failed emissions records can indicate engine problems and CARFAX recommends you have the vehicle inspected.

First Owner

When the first owner(s) obtains a title from a Department of Motor Vehicles as proof of ownership.

New Owner Reported

When a vehicle is sold to a new owner, the Title must be transferred to the new owner(s) at a Department of Motor Vehicles.

Ownership History

CARFAX defines an owner as an individual or business that possesses and uses a vehicle. Not all title transactions represent changes in ownership. To provide estimated number of owners, CARFAX proprietary technology analyzes all the events in a vehicle history. Estimated ownership is available for vehicles manufactured after 1991 and titled solely in the US including Puerto Rico. Dealers sometimes opt to take ownership of a vehicle and are required to in the following states: Maine, Massachusetts, New Jersey, Ohio, Oklahoma, Pennsylvania and South Dakota. Please consider this as you review a vehicle's estimated ownership history.

Title Issued

A state issues a title to provide a vehicle owner with proof of ownership. Each title has a unique number. Each title or registration record on a CARFAX report does not necessarily indicate a change in ownership. In Canada, a registration and bill of sale are used as proof of ownership.

Follow Us:  facebook.com/CARFAX  [@CarfaxReports](https://twitter.com/CarfaxReports)

CARFAX DEPENDS ON ITS SOURCES FOR THE ACCURACY AND RELIABILITY OF ITS INFORMATION. THEREFORE, NO RESPONSIBILITY IS ASSUMED BY CARFAX OR ITS AGENTS FOR ERRORS OR OMISSIONS IN THIS REPORT. CARFAX FURTHER EXPRESSLY DISCLAIMS ALL WARRANTIES, EXPRESS OR IMPLIED, INCLUDING ANY IMPLIED WARRANTIES OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. CARFAX®

© 2019 CARFAX, Inc., a unit of IHS Markit. All rights reserved.

Covered by United States Patent Nos. 7,113,853; 7,778,841; 7,596,512, 8,600,823; 8,595,079; 8,606,648; 7,505,838.

6/9/19 3:45:31 PM (CDT)