KAHLER'S WERKSTATT 000083021 REPAIR ORDER # 6117 DOUGHERTY ROAD DATE: 06/09/09 08:00 am DUBLIN, CA 94568 PAGE: 1 REFERENCE: PH: 925-829-2050 BAR# ARDAC246747 EPA#000309663 MIIN 55349 MIOUT 55403 CUSTOMER: VEHICLE: 70 PORSCHE 914 - 6ADDRESS: LICENSE: 6HEW185/CA CITY: VIN: 9140431823 PHONE 1: ENGINE: Cyl H6 Disp 2.3 PHONE 2: MILEAGE: 55403 COLOR: EMAIL: ___IALS CANNOT BE COMBINED REPAIR INSTRUCTIONS: PAYMENT TERMS: CASH. VISA. MASTERCARD DISCOVER, NO CHECKS NO PAYMENTS ACCEPTED OVER PHONE BUSINESS HOURS: Monday-Friday 7:30am-5:30pm LABOR PARTS OP DESCRIPTION CHARGE OUA Part Number/Description 01 PURCHASE INSPECTION 195.00 CLIENT HAS ALREADY BOUGHT THIS VEHICLE, WOULD LIKE TO HAVE INSPECTION DONE, GO THROUGH THE WHOLE VEHICLE AND MAKE SURE THERE ARE NO ISSUES. PERFORMED AN REPAIR ORDERS PREPURCHASE INSPECTION ON VEHICLE. PLAY IN BOTH REAR WHEEL BEARINGS, ENGINE HAS OIL LEAKS, BOTH HEAT EXCHANGER ARE DAMAGED, MUFFLER IS WELDED ON TOP, OUTLET PIPE IS KINKED, LEFT HEATER 6/9/09 THEN 3/25/15 FLAP CABLE END MISSING, MUFFLER GASKET MISSING LEFT SIDE, FRONT AND REAR BRAKES AT 8MM, DUE TO CRASH DAMAGE/REPAIRS HOOD WILL NOT FIT PROPERLY, BOTH FRONT FENDERS HAVE BEEN REPLACED, WELDING REPAIRS DONE AT FRONT SWAY BAR PIVOT MOUNTS, BRAKE HOSE MOUNTS ALSO HAVE BEEN WELDED, FRONT LOWER PAN IS CRUSHED UNDER SPARE TIRE, DOOR JAMS ROUGH AT FRONT, RIGHT FRONT TURN SIGNAL DOES NOT WORK, RIGHT FRONT SIDE MARKER HELD IN PLACE WITH BAILING WIRE, UNDER PANEL BELOW STEERING RACK IS MISSING, LOTS OF HEAVY UNDERCOATING, REAR TRUNK PANEL HAS BEEN REPLACED, REAR TRUNK FLOOR \$37,817.52 ROUGH, EXCESSIVE BODY SEALER, PAINTED OVER, WIPERS SLOW, NO SPEED INCREASE AT HIGH SWITCH SETTINGS, DEFROSTER CABLES STICKY, ALIGNMENT NEEDED. 02 DS LEAK CLIENT STATES VEHICLE HAS A LEAK CHECK AND ADVISE. CHECKED AND FOUND LEAK COMING FROM CYLINDER HEAD BASE

136.00

65.00

RECOMMENDED REPAIRS:

03 DS

04 DS

GASKET, REQUIRES ENGINE OVERHAUL TO FIX.

TURN SIGNAL

PROPERLY, NOW WORKING NORMALLY.

ALIGN

FOUND RIGHT FRONT TURN SIGNAL DOES NOT WORK, FOUND BOTH FRONT MARKERS ARE WIRED WRONG, IMPORPERLY GROUNDED AND RUNNING LIGHT NOT WIRED, CONNECTED ALL

Loss of personal property or partial theft of automobile is not insured or protected against loss occasioned by theft, fire and vandalism while property remains with the repair facility. I hereby authorize the repair work to be done CHECK # along with the necessary materials and sublet repairs. I hereby grant you and/or HAZ WASTE: \$ 6.25 your employees permission to operate the vehicle herein described on street, SRCHRG TOTAL: \$ highways or elsewhere for the purpose of testing and/or inspection. An express FREIGHT: \$ 0.00 mechanic's lien is hereby acknowledged on vehicle to secure the amount of repairs thereto. In the event legal action is necessary to enforce this 9,781.00 LABOR: \$ contract. I will pay reasonable attorney's fees and court fees. In addition I PARTS: \$ 6,514.08 acknowledge notice & oral approval of an increase in the orginal estimated price. SUBLET: \$ 0.00 ITEMS 1-8 NON TAXABLE: \$ (Signature) 0.00 QUOTES: DISCOUNT: \$ 0.00 06/09 SUBTOTAL: \$ 16,301.33 08:03am 455.00 08/03 10:04am 15759.48 JOHN Ph:510-886-6658 TAX: \$ 635.12 06/16 TOTAL: \$ 16936.45 04:46pm 10455.00 09/22 04:27pm 16936.45 MHOL In Person JOHN In Person PAYMENTS: \$ 16936.45 ITEMS 1-5 DUE: \$

ALL NEW MECHANICAL PARTS AND ASSOCIATED LABOR HAVE A LIMITED WARRANTY FOR 6,000 MILES OR 6 MONTHS WHICHEVER OCCURS FIRST, SUBJECT TO DISCLAIMER OF WARRANTIES HEREON PRINTED AND TO THE CONDITIONS OF THE SONG-BEVERLY ACT. WARRANTY IS VALID ONLY IF VEHICLE IS RETURNED TO OUR FACILITY FOR REPAIRS AND/OR ADJUSTMENTS. WARRANTY IS VOID IF THERE IS ANY EVIDENCE OF NEGLECT, MISUSE, OR ABUSE CONTRIBUTING TO ANY FAILURE.

PRICE

6117 DOUGHERTY ROAD DUBLIN, CA 94568

PH: 925-829-2050 BAR# ARDAC246747 EPA#000309663

REPAIR ORDER # 000083021

DATE: 06/09/09 08:00 am PAGE: 2 REFERENCE: MIIN 55349 MIOUT 55403

CUSTOMER: ADDRESS:

CITY: PHONE 1:

PHONE 2: EMAIL:

VEHICLE: 70 PORSCHE 914 - 6

LICENSE: 6HEW185/CA VIN: 9140431823

ENGINE: Cyl H6 Disp 2.3 MILEAGE: 55403 COLOR:

..... JECIALS CANNOT BE COMBINED

REPAIR INSTRUCTIONS:

PAYMENT TERMS: CASH, VISA, MASTERCARD DISCOVER, NO CHECKS

NO PAYMENTS ACCEPTED OVER PHONE

BUSINESS HOURS: Monday-Friday 7:30am-5:30pm

CLIENT WOULD LIKE TO HOOD ALIGNED, PERFOMRED HOOD	QUA Part Number/	Description	and the same of th
MAJOR TUNE AND SERVICE, LUBE, OIL AND FILTER, ADJUST VALVES, COMPRESSION TEST, BALANCE ADJUST FUEL INJECTION STAKS, SET IDLE FUEL MIXTURE, SAFETY INSPECTION. OB COVERHAUL DISASSEMBLED ENGINE AND PERFORMED OVERHAUL. REPLACED ALL LISTED ITEMS WITH NEW, PERFORMED ALIGN BORE AND CYLINDER DECKING WAS PERFORMED SPICT HOLES, REPLACED OIL RETURN TUBES, ROCKER ARMS, ROD BOLTS, ROT NUTS, FLYWHEEL, RECHECKED AFTER ASSEMBLY FOUND NO MORE OIL LEAKS FROM ENGINE.	1.0 930 107 764 00 11.0 20 50 1.0 901 110 909 00 6.0 WR5DC 1.0 01 017 6.0 80 90 1.0 SEAL RING 1.0 PARTS CLEANER 1.0 901 100 902 01 6.0 901 103 131 01 6.0 911 102 171 00 4.0 901 107 351 01 2.0 901 105 583 01 6.0 908 104 391 00 2.0 901 101 161 01 1.0 911 100 907 05 25.0 WASHERS 24.0 99 0579 052 1.0 043 010 00 12.0 901 103 173 00 12.0 901 103 173 00 12.0 901 103 173 00 12.0 901 103 173 00 12.0 901 103 173 00 12.0 901 103 173 00 12.0 901 103 173 00 12.0 901 103 173 00 12.0 901 103 173 00 12.0 901 103 173 00 12.0 914 103 171 00 24.0 10 0115 101 24.0 901 104 382 02 1.0 914 103 141 00 6.0 901 111 271 00 1.0 MACHINE SHOP 1.0 KIT 4S 1.0 901 102 026 01	OIL FILTER 911 72 VALVOLINE FUEL FILTER 911 ME SPARK PLUG POINT SET GEAR OIL COPPER OR ALUMINUM SPRAY SOLVENT GASKET SET ROD BUSHINGS 911 FLY WHEEL BOLT OIL RETURN TUBE 91 FLANGE HEAD GASKET 2.2 2. CASE WASHER 911 LOWER ENGINE GSKT WASHERS SEALS LOCITE 574 ROD NUT ALL 911 ROD BOLT 2.4 2.7 3 HEAD STUD NUTS ROD BEARING STD BARREL NUT MACHINE SHOP VALVE COVER GASKET FLYWHEEL 911 70-77	PRICE 18.95 49.50 78.84 30.12 16.00 23.40 0.62 6.95 798.47 90.48 86.46 106.48 65.54 109.26 12.72 110.45 26.00 81.36 136.87 34.80 218.04 584.40 126.24 157.83 31.20 1,680.00 68.95 398.61

RECOMMENDED REPAIRS:

Loss of personal property or partial theft of automobile is not insured or protected against loss occasioned by theft, fire and vandalism while property remains with the repair facility. I hereby authorize the repair work to be done along with the necessary materials and sublet repairs. I hereby grant you and/or your employees permission to operate the vehicle herein described on street, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on vehicle to secure the amount of repairs thereto. In the event legal action is necessary to enforce this contract. I will pay reasonable attorney's fees and court fees. In addition I acknowledge notice & oral approval of an increase in the orginal estimated price. ITEMS 1-8

(Signature) (Date) QUOTES: 1 -06/09 455.00 08/03 15759.48 08:03am 10:04am Ph:510-886-6658 JOHN Ph:NA JON 2 06/16 10455.00 09/22 04:27pm 04:46pm 16936.45 JOHN JOHN In Person In Person ITEMS 1-5

CHECK	#	
HAZ WASTE:	\$	6.25
SRCHRG TOTAL:	\$	990 Juni 1998
FREIGHT:	\$	0.00
LABOR:	\$	9,781.00
PARTS:	\$	6,514.08
SUBLET:	\$	0.00
NON TAXABLE:	\$	0.00
DISCOUNT:	\$	0.00
SUBTOTAL:	\$	16,301.33
TAX:	\$	635.12
TOTAL:	\$	16936.45
PAYMENTS:	\$	16936.45
DUE:	\$.00

ALL NEW MECHANICAL PARTS AND ASSOCIATED LABOR HAVE A LIMITED WARRANTY FOR 6,000 MILES OR 6 MONTHS WHICHEVER OCCURS FIRST, SUBJECT TO DISCLAIMER OF WARRANTIES HEREON PRINTED AND TO THE CONDITIONS OF THE SONG-BEVERLY ACT. WARRANTY IS VALID ONLY IF VEHICLE IS RETURNED TO OUR FACILITY FOR REPAIRS AND/OR ADJUSTMENTS. WARRANTY IS VOID IF THERE IS ANY EVIDENCE OF NEGLECT, MISUSE, OR ABUSE CONTRIBUTING TO ANY FAILURE.

6117 DOUGHERTY ROAD DUBLIN, CA 94568

PH: 925-829-2050 BAR# ARDAC246747 EPA#000309663

000083021 REPAIR ORDER #

DATE: 06/09/09 08:00 am

PAGE: 3 REFERENCE: MIIN 55349 MIOUT 55403

CUSTOMER:

ADDRESS: CITY:

PHONE 1:

EMAIL:

PHONE 2:

VEHICLE: 70 PORSCHE

LICENSE: 6HEW185/CA

VIN: 9140431823

ENGINE: Cyl H6 MILEAGE: 55403

Disp 2.3 COLOR:

ALS CANNOT BE COMBINED

12.0930 105 043 00

1.0 BRAKE PASTE

1.0 PARTS CLEANER

REPAIR INSTRUCTIONS:

PAYMENT TERMS:

OUA

CASH, VISA, MASTERCARD

DISCOVER, NO CHECKS

NO PAYMENTS ACCEPTED OVER PHONE

914 - 6

PRICE

2.65

7.35

1,286.04

BUSINESS HOURS: Monday-Friday 7:30am-5:30pm

Part Number/Description

PARTS

ROCKER ARM

BRAKE PAD PASTE

SPRAY SOLVENT

LABOR OP DESCRIPTION CHARGE DISASSEMBLED ENGINE AND PERFORMED OVERHAUL. REPLACED ALL LISTED ITEMS WITH NEW, PERFORMED ALIGN BORE AND CYLINDER DECKING WAS PERFORMED SPIGT HOLES, REPLACED OIL RETURN TUBES, ROCKER ARMS, ROD BOLTS, ROT NUTS, FLYWHEEL, RECHECKED AFTER ASSEMBLY FOUND NO MORE OIL LEAKS FROM ENGINE. 350.00

07 DS ALIGNMENT

FOUND REAR WHEELS ARE RUBBING ON THE FENDER, PERFORM ALIGNMENT AND GIVE VEHICLE SOME NEGATIVE CAMBER.

DEFROSTER CABLE 08 408.00 FOUND DEFROSTER CABLES ARE STICKY ON VEHICLE, DISASSEMBLED, LUBED ALL CABLES AND INSTALLED BACK IN, FOUND HEATER CONTROLS ARE NOW WORKING NORMALLY.

09 DS FRONT BRAKES 272.00 INSTALLED CLIENT PROVIDED BRAKES ON VEHICLE, NO WARRANTY ON PARTS OR LABOR AS CLIENT PROVIDED ALL PARTS.

10 MR KAHLERS ENGINE WARRA 0.00

THIS IS KAHLERS ENGINE WARRANTY, WARRANTY IS FOR 12 MONTHS OR 12,000 MILES WHICHEVER OCCURS FIRST, FOR ANY ISSUES OR CONCERNS CONTACT KAHLERS DIRECTLY, DAMAGE DUE TO RACING, OVERHEATING, NEGLECT, LACK OF LUBRICATION, THEFT, MISUSE OR ABUSE IS NOT COVERED. FOR ANY ISSUES VEHICLE MUST BE BROUGHT TO KAHLERS FOR INSPECTION.

***VALVE ADJUSTMENT AND OIL AND FILTER CHANGE SHOULD BE PERFORMED IN 1,000 MILES.

RECOMMENDED REPAIRS:

ITEMS 1-5

Loss of personal property or partial theft of automobile is not insured or protected against loss occasioned by theft, fire and vandalism while property remains with the repair facility. I hereby authorize the repair work to be done along with the necessary materials and sublet repairs. I hereby grant you and/or your employees permission to operate the vehicle herein described on street, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on vehicle to secure the amount of repairs thereto. In the event legal action is necessary to enforce this contract. I will pay reasonable attorney's fees and court fees. In addition I acknowledge notice & oral approval of an increase in the orginal estimated price. TTEMS 1-8

(Signature) (Date) QUOTES: 06/09 08:03am 455.00 08/03 10:04am 15759.48 JOHN JON. Ph:510-886-6658 2 06/16 10455.00 09/22 16936.45 04:46pm 04:27pm In Person JOHN JOHN

In Person

6.25 HAZ WASTE: \$ SRCHRG TOTAL: \$ FREIGHT: \$ 0.00 9,781.00 LABOR: \$ PARTS: \$ 6,514.08 SUBLET: \$ 0.00 NON TAXABLE: \$ 0.00 DISCOUNT: \$ 0.00 SUBTOTAL: \$ 16,301.33 TAX: \$ 635.12 TOTAL: \$ 16936.45 PAYMENTS: \$ 16936.45

CHECK #

ALL NEW MECHANICAL PARTS AND ASSOCIATED LABOR HAVE A LIMITED WARRANTY FOR 6,000 MILES OR 6 MONTHS WHICHEVER OCCURS FIRST, SUBJECT TO DISCLAIMER OF WARRANTIES HEREON PRINTED AND TO THE CONDITIONS OF THE SONG-BEVERLY ACT. WARRANTY IS VALID ONLY IF VEHICLE IS RETURNED TO OUR FACILITY FOR REPAIRS AND/OR ADJUSTMENTS. WARRANTY IS VOID IF THERE IS ANY EVIDENCE OF NEGLECT, MISUSE, OR ABUSE CONTRIBUTING TO ANY FAILURE.

KAHLER'S WERKSTATT 000084362 REPAIR ORDER # DATE: 01/19/10 02:48 pm 6117 DOUGHERTY ROAD MINITED TO THE TOTAL PROPERTY OF THE PROPERTY PH: 925-829-2050 BAR# ARDAC246747 EPA#000309663 MIIN 55349 MTOUT 70 PORSCHE 914 VEHICLE: CUSTOMER: 6HEW185/CA LICENSE: ADDRESS: 9140431823 VTN: CITY: PHONE 1: ENGINE: Cyl H6 Disp 2.3 55349 COLOR: 914 MILEAGE: PHONE 2: REPAIR INSTRUCTIONS: TERMS: CASH, OR CREDIT CARD (VISA, MASTERCARD, DISCOVER) Monday-Friday 7:30am-5:30pm http://www.kahlers.com PARTS LABOR DESCRIPTION QUA Part Number/Description PRICE OP CHARGE BATTERY INTERSTATE 94.95 1.0 MT42 BATTERY 68.00 01 MR 3,500.00 1.0 PMO CARB SSYTEM REPLACE BATTERY ON VEHICLE. 544.00 02 CARBS MR REPLACE CARBS ON VEHICLE. RECOMMENDED REPAIRS: Loss of personal property or partial theft of automobile is not insured or protected against loss occasioned by theft, fire and vandalism while property CHECK # remains with the repair facility. I hereby authorize the repair work to be done HAZ WASTE: \$ 0.00 along with the necessary materials and sublet repairs. I hereby grant you and/or SRCHRG TOTAL: \$ your employees permission to operate the vehicle herein described on street, FREIGHT: \$ highways or elsewhere for the purpose of testing and/or inspection. An express 0.00 mechanic's lien is hereby acknowledged on vehicle to secure the amount of LABOR: \$ 612.00 repairs thereto. In the event legal action is necessary to enforce this 3,594.95 PARTS: \$ contract. I will pay reasonable attorney's fees and court fees. In addition I acknowledge notice & oral approval of an increase in the orginal estimated SUBLET: \$ 0.00 price. NON TAXABLE: \$ 0.00 (Date) (Signature)

ALL NEW MECHANICAL PARTS AND ASSOCIATED LABOR HAVE A LIMITED WARRANTY FOR 6,000 MILES OR 6 MONTHS WHICHEVER OCCURS FIRST, SUBJECT TO DISCLAIMER OF WARRANTIES HEREON PRINTED AND TO THE CONDITIONS OF THE SONG-BEVERLY ACT. WARRANTY IS VALID ONLY IF VEHICLE IS RETURNED TO OUR FACILITY FOR REPAIRS AND/OR ADJUSTMENTS. WARRANTY IS VOID IF THERE IS ANY EVIDENCE OF NEGLECT, MISUSE, OR ABUSE CONTRIBUTING TO ANY FAILURE.

QUOTES:

JOHN

01/19

4557.46

02:49pm

DISCOUNT: \$

SUBTOTAL: \$

TAX: \$

DUE: \$

TOTAL: \$
PAYMENTS: \$

0.00

0.00

0.00 **4,557.46**

350.51 4,557.46

000085986 REPAIR ORDER # KAHLER'S WERKSTATT DATE: 09/08/10 01:35 pm LAUL. LEFERGUOT. 6117 DOUGHERTY ROAD DUBLIN, CA MIIN 55576 TUOIM PH: 925-829-2050 BAR# ARDAC246747 EPA#000309663 914 VEHICLE: 70 PORSCHE CUSTOMER: 6HEW185/CA ADDRESS: LICENSE: CITY: 9140431823 VIN: PHONE 1: PHONE 2: Disp 2.3 Cvl H6 ENGINE: COLOR: 914 EMAIL: 55576 MILEAGE: CASH, VISA, MASTERCARD PAYMENT TERMS: REPAIR INSTRUCTIONS: DISCOVER, NO CHECKS HTTP://WWW.KAHLERS.COM WEB SPECIALS: BUSINESS HOURS: Monday-Friday 7:30am-5:30pm PARTS LABOR PRICE Part Number/Description CHARGE **OUA** DESCRIPTION OP 18.95 OIL FILTER 911 72 1.0 930 107 764 01 272.00 TURN SIGNAL 01 52.25 VALVOLINE 11.020 50 REPLACE TURN SIGNAL CUSTOMER SUPPLIED PART 72.50 VALVE COVER GASKET 540.00 1.0 KIT 4S 911 MAJOR 72-73 02 0.62 COPPER OR ALUMINUM MAJOR TUNE AND SERVICE, LUBE, OIL AND FILTER, ADJUST VALVES, COMPRESSION TEST, BALANCE ADJUST FUEL INJECTION STAKS, SET IDLE FUEL MIXTURE, SAFETY 1.0 SEAL RING 6.95 SPRAY SOLVENT 1.0 PARTS CLEANER INSPECTION. RECOMMENDED REPAIRS: Loss of personal property or partial theft of automobile is not insured or protected against loss occasioned by theft, fire and vandalism while property CHECK # remains with the repair facility. I hereby authorize the repair work to be done HAZ WASTE: \$ 4.75 along with the necessary materials and sublet repairs. I hereby grant you and/or your employees permission to operate the vehicle herein described on street, SRCHRG TOTAL: \$ highways or elsewhere for the purpose of testing and/or inspection. An express FREIGHT: \$ 0.00 mechanic's lien is hereby acknowledged on vehicle to secure the amount of LABOR: \$ 812.00 repairs thereto. In the event legal action is necessary to enforce this contract. I will pay reasonable attorney's fees and court fees. In addition I PARTS: \$ 151.27 acknowledge notice & oral approval of an increase in the orginal estimated 0.00 SUBLET: price. NON TAXABLE: \$ 0.00 (Date) (Signature) 0.00 DISCOUNT: \$ OUOTES: SUBTOTAL: \$ 968.02 982.77 09/08 01:41pm In Person 14.75

ALL NEW MECHANICAL PARTS AND ASSOCIATED LABOR HAVE A LIMITED WARRANTY FOR 6,000 MILES OR 6 MONTHS WHICHEVER OCCURS FIRST, SUBJECT TO DISCLAIMER OF WARRANTIES HEREON PRINTED AND TO THE CONDITIONS OF THE SONG-BEVERLY ACT. WARRANTY IS VALID ONLY IF VEHICLE IS RETURNED TO OUR FACILITY FOR REPAIRS AND/OR ADJUSTMENTS. WARRANTY IS VOID IF THERE IS ANY EVIDENCE OF NEGLECT, MISUSE, OR ABUSE CONTRIBUTING TO ANY FAILURE.

TAX: \$

DUE: \$

982.77

982.77

0.00

TOTAL: \$

PAYMENTS: \$

JOHN

000085986 REPAIR ORDER # KAHLER'S WERKSTATT DATE: 09/08/10 01:35 pm 6117 DOUGHERTY ROAD PAGE: 1 REFERENCE: DUBLIN, CA 94568 MIIN 55690 MIOUT 55690 PH: 925-829-2050 BAR# ARDAC246747 EPA#000309663 VEHICLE: 914 - 670 PORSCHE CUSTOMER: LICENSE: 6HEW185/CA ADDRESS: 9140431823 VIN: CITY: Cyl H6 Disp 2.3 ENGINE: PHONE 1: MILEAGE: 55690 COLOR: PHONE 2: EMAIL: PAYMENT TERMS: CASH. VISA. MASTERCARD REPAIR INSTRUCTIONS: DISCOVER, NO CHECKS NO PAYMENTS ACCEPTED OVER PHONE BUSINESS HOURS: Monday-Friday 7:30am-5:30pm PARTS LABOR Part Number/Description PRICE CHARGE QUA OP DESCRIPTION 243.67 1.0 911 613 301 30 SWITCH TURN SIGNAL 408.00 TURN SIGNAL 01 DS 100.00 CANCELING RING 1.0 901 613 325 05 REPLACE TURN SIGNAL CUSTOMER SUPPLIED PART. FOUND TURN SIGNAL CLIENT PROVIDED IS INCORRECT, INSTALLED 52.25 VALVOLINE 11.020 50 911 SWITCH WITH MODIFICATION AND INSTALLED NEW COPPER OR ALUMINUM 0.62 1.0 SEAL RING CANCELLING RING. 6.95 SPRAY SOLVENT 1.0 PARTS CLEANER 567.00 911 MAJOR 72-73 02 DS 26.85 MAJOR TUNE AND SERVICE, LUBE, OIL AND FILTER, ADJUST VALVES, COMPRESSION TEST, BALANCE ADJUST FUEL INJECTION STAKS, SET IDLE FUEL MIXTURE, SAFETY OIL FILTER 1.0 901 107 203 09 72.50 1.0 KIT 4 VALVE CVR GSKT SET 24.80 GASKET MUFFLER 2.0 901 111 193 00 INSPECTION. EXHAUST GASKETS 40.26 6.0 901 111 195 00 FRONT VALANCE 272.00 03 10.50 DS 6.0 NUTS BOLTS LOCK NUT INSTALL FRONT VALANCE ON VEHICLE. 4.25 SHIFT KNOB SPACER 999 532 001 00 0.00 1.0 SHIFT KNOB 04 1.0 911 701 953 00 65.00 PLATE MOUNT KIT INSTALL NEW SHIFT KNOB SPACER ON VEHICLE. 0.00 LICENSE PLATE 05 DS INSTALLED NEW LICENSE PLATE BRACKET KIT. RECOMMENDED REPAIRS: Loss of personal property or partial theft of automobile is not insured or protected against loss occasioned by theft, fire and vandalism while property CHECK # remains with the repair facility. I hereby authorize the repair work to be done 2.75 along with the necessary materials and sublet repairs. I hereby grant you and/or HAZ WASTE: your employees permission to operate the vehicle herein described on street, SRCHRG TOTAL: \$ highways or elsewhere for the purpose of testing and/or inspection. An express FREIGHT: \$ 0.00 mechanic's lien is hereby acknowledged on vehicle to secure the amount of 1,247.00 LABOR: \$ repairs thereto. In the event legal action is necessary to enforce this

ALL NEW MECHANICAL PARTS AND ASSOCIATED LABOR HAVE A LIMITED WARRANTY FOR 6,000 MILES OR 6 MONTHS WHICHEVER OCCURS FIRST, SUBJECT TO DISCLAIMER OF WARRANTIES HEREON PRINTED AND TO THE CONDITIONS OF THE SONG-BEVERLY ACT. WARRANTY IS VALID ONLY IF VEHICLE IS RETURNED TO OUR FACILITY FOR REPAIRS AND/OR ADJUSTMENTS. WARRANTY IS VOID IF THERE IS ANY EVIDENCE OF NEGLECT, MISUSE, OR ABUSE CONTRIBUTING TO ANY FAILURE.

(Date)

PARTS: \$

SUBLET: \$

DISCOUNT: \$

SUBTOTAL: \$

PAYMENTS: \$

TAX: \$

DUE: \$

TOTAL: \$

NON TAXABLE: \$

647.65

0.00

0.00

0.00

63.15

1.897.40

1960.55

1960.55

contract. I will pay reasonable attorney's fees and court fees. In addition I

acknowledge notice & oral approval of an increase in the orginal estimated

982.77

1960.55

In Person

Ph:NA

price.

JOHN

JOHN

(Signature)

QUOTES:

2 09/14

09/08

01:41pm

04:57pm

6117 DOUGHERTY ROAD DUBLIN, CA 94568

CUSTOMER:

ADDRESS:

PHONE 1:

PHONE 2:

EMAIL:

CITY:

PH: 925-829-2050 BAR# ARDAC246747 EPA#000309663

REPAIR ORDER # 000086187

DATE: 10/07/10 03:10 pm PAGE: 1 REFERENCE:

MIIN 55827 MIOUT

VEHICLE: 70 PORSCHE

914 - 6

LICENSE: 6HEW185/CA VIN: 9140431823

ENGINE: Cyl H6 Disp 2.3 MILEAGE: 55827 COLOR:

IALS CANNOT BE COMBINED

REPATR INSTRICTIONS.
FRONT AND REAR TIRES AT 32PSI.

PAYMENT TERMS: CASH, VISA, MASTERCARD

> DISCOVER, NO CHECKS NO PAYMENTS ACCEPTED OVER PHONE

BUSINESS HOURS: Monday-Friday 7:30am-5:30pm

		LABOR				PARTS	
OP 01	THE CAR. WITH WOULD (HOUR BUY TO SAME RESULD SPUTTERED CHECK AND REPLACED WALSO FOUNI	DESCRIPTION NO START ATES HE WAS DRIVING FOR 45 MINS THE TO START THE CAR ABOUT A HAIDRANK BUT NOT START, WAITED ANOTH THE TIN BETWEEN ABOUT A DOZENT OF THE TOTAL T	JF HOUR AND HER HALF N TIMES AND WAS N WAS N VEHICLE,	1.0 1.0 2.0 6.0 1.0 2.0 3.0	PEL-PT2862 911 603 120 06 CD 901 111 193 00 901 111 195 00 96434791701 944 538 041 00	ALTERNATOR UNIT GASKET MUFFLER MANI GASKET STEERING LOCK KEY HOLDER WITH LI LOCK NUT	984.81 575.00 24.80 40.26 660.74 56.24 5.94
02	CHECKED AM ENOUGH VOI	ALTERNATOR ADDITIONAL ALTERNATOR IS NOT PUTTING TO CHARGE BATTERY PROPERLY. LED WITH NEW ALONG WITH REBUILD (NG OUT REMOVED				
03	DS	HEADER/MUFFLER REPLACED HEADERS AND EXHAUST WITH	408.00				
04	CLIENT SUE	STEERING ENITION SWITCH AND STEERING LOCK PPLIED IGNITION SWITCH FOR VEHICI NO WARRANTY FROM KAHLERS IN REGA	E.				
05	DS REPLACE ST VEHICLE ST LIGHT ON V THE DOME I	STEERING LOCK TEERING LOCK ON VEHICLE WITH NEW. TARTS EACH TIME. ALSO INSTALLED NUTHICLE WITH NEW BULB. THE INTERINGHT FITS IS NOT PROPER ON VEHICLE STICK OUT A LITTLE BIT. TODE IS 326.	NOW IEW DOME OR WHERE				

RECOMMENDED REPAIRS:

protected a	against loss	occasioned by	theft, fire and v	le is not insured or andalism while property he repair work to be done	CHECK	#	
along with your employ	the necessa rees permiss	ry materials an ion to operate	d sublet repairs. the vehicle herei	I hereby grant you and/or n described on street,	HAZ WASTE: SRCHRG TOTAL:		0.00
				r inspection. An express ecure the amount of	FREIGHT:	\$	0.00
repairs the	ereto. In th	e event legal a	ction is necessar	y to enforce this	LABOR:	\$	2,609.90
				urt fees. In addition I he orginal estimated	PARTS:	\$	2,555.59
price.	. notice a o	rar approvar or	ITEMS 1-5	ne orginar escimated	SUBLET:	\$	0.00
(Signature)			110.10 1 0	(Date)	NON TAXABLE:	\$	0.00
QUOTES:				***************************************	DISCOUNT:	\$	0.00
1 10/07 JOHN	03:15pm	272.00 Ph:NA	3 12/02 JOHN	08:53am 4051.36	SUBTOTAL:	\$	5,184.91
0 01111		FII.IVA	ITEMS 1-5	In Person	TAX:	\$	249.17
2 12/02	08:35am	1295,43	4 03/15	01:40pm 5406.93	TOTAL:	\$	5434.08
JOHN ITEMS 1-5		In Person	JOHN	In Person	PAYMENTS: DUE:		5434.08



CUSTOMER SERVICE 1-800-327=4868

			1010	70		
Cust	omer No.	Orđer No.	Print	: Date/	Time	
2216	6518-000	05861941-00002	11/08/1	0	12:48:06	
В:	in No.	Batch No.	Order Dat	e	Page	
	001	0001038967	11/08/10		1	
Sls#	₽,0). Number	Order Type	Phone	e Number	
490			RTL	31	0	
mananan	ShipY.	۱Â	T6	rms		
	BESTWAY G	ROUND	VIS	A CARI)	

Prepayment

Balance Due

1936.45

00



Location	Part No.	Shpd	UM	Descriptio	n		В/О:	Unit Price	Sale Price	Amount	
D/S	P912028	1	EA	B&b Fabrication		USA	0	2265.95	1902.65	1902.65	
				Heat Ex Header Porse	change s						
				Cust. #:22166518-000 Order #:05861941-00002	INSPECT CONTENTS SHIPMENT FOR DAMA- SHORTAGES WITHIN PICK	GES AND) <u>2</u>	Tale Amount Shpg & Hndg Sales Tax Pkg Protect COD Charges	= ,	1902.65 31.05 2.75 .00 1936.45	0 10 10 10 10 10 10 10 10 10 10 10 10 10

ATTN: RETURNS DEPT.

ECKLER'S"

Comments:

M&K Specialties LLC

5171 Ruedebusch Road Burlington, WI 53105 262-364-7426

ben@mkexhaust.com www.mkexhaust.com

262-767-1235

Tax Registration #: 20-2397246



Bill To:

Ship To:

KAHLERS BERKSATT 6117 DOUGHERETY ROAD DUBLIN, CA 94568 Invoice

Invoice No:

1522

Date:

1/10/2011

Terms:

Net 00

Due Date:

1/10/2011

Order No:

Territory:

Salesperson:

Ship Date 1/10/2011 Ship Via

Tracking No.


FOB

UPS

1ZX641X80347400437

Code Description	Qty/Hours	Rate	Amount
2IN1 OUT MUFFLER FOR 911 IF USED ON A 914-6 THE MUFFLER NEEDS TO BE SUPPORTED LIKE A 911 MUFFLER	1.00	\$725.00	\$725.00*
SHIPPING	1.00	\$47.98	\$47.98*

	* Indicates non-taxable item
Subtotal \$772.	
Tax (5.50%) \$0	
Shipping \$0	
Total \$772	
Deposit \$0	
Balance Due \$772	

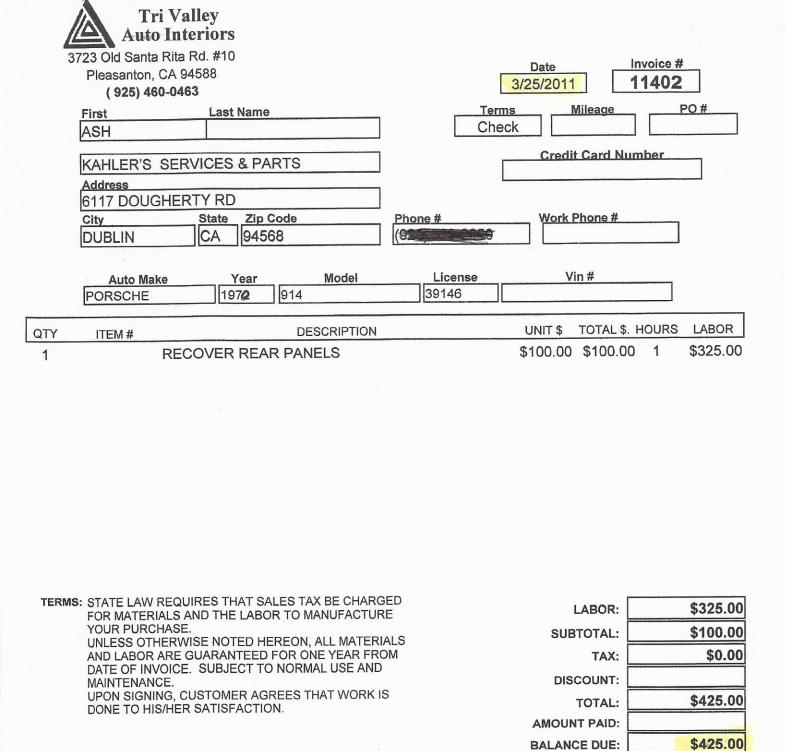

Thank you

Received By



Pelican Parts
1600 240th Street
Harbor City, CA 90710
310-626-8765
www.pelicanparts.com

Bill of Sale

Date: 8/1/11

Invoice No: | 13|2|3|8|8-640



Ship To: John Shaffer

1003 coffeen ave sheridan WY 8280 I US - United States

Phone #	Payment	Sales Rep	Shipping Methods	Car Type
I IIOIIC #		-	PRIORITY	

QTY	Status	Part Number	Description	Unit Price	Amount
QIII	Status	1 (2) (1)	II. No Ald Fools	29.99	59.98
2	Packed & Shipped	PEL-PP9 23 6	Seat Adjuster Handle, 914, Each	24.00	
				Shipping & Handling Sales Tax Rate:	6.00
		our support!		Total:	65.98

Any problems or questions about this order? Just give us a call toll-free at: 1-888-280-7799


Paid via PayPal \$65.98



PARTIE OF AUTOMOTIVE PARTS COMPANIES



Sold To:



Ship To:

9001

1-9001

Location	o. papa (JM Description	1	87 U	Unit Price Sale Price	Amount
G18-03-02 P905512 G47-03-04 P916241		BA Outer Door Handle Lock Inser	t, 914 70-76 2 Per USA USA	0	13.99 11.89 10.99 9.34	11.89
**** Parts with 'AL **** Parts with 'B/	I' are shippi O' are out of	ing from an alternate location. stock and will ship at a late	**** r date. ****			
ALT 88-0160-1 ALT P906279 ALT P906260	0 E	BA Battery Tender BA 914-6 Rear Valance Pan KT 914 Rear Spoiler	USA USA USA	0 1 0		
			1 2 2		ş	
	- 18 Jan				Đ	
			W 9			+
					A.	
						B
=						
					Colle Press	21 02
	A CONTRACTOR OF THE CONTRACTOR	Cust. #: 22999708-000 Order #: 11172256-00004	INSPECT CONTENTS OF SHIPMENT FOR DAMAGES AND SHORTAGES WITHIN 5 DAYS)	Sale Amount Shpg & Hndg Sales Tax Pkg Protect	21.23 .00 .00
i demonstrativati pretigen 12		(4) (5) (5) (5) (5) (5) (5) (5) (5) (5) (5	PICK PACK		COD Charges Total Prepayment Balance Due	.00 21.23 _00 21.23

5225 South Washington Ave. Titusville, FL 32780 ATTN: RETURNS DEPT.

Comments:

COUPON CODE NUY PLEASE ADD DISCOUNT



FAMILY OF AUTOMOTIVE PARTS COMPANIES

CUSTOMER SERVICE

1-800-327-4868

	Cust	comer No.	Order No.	Print	Print Date/Time			
	22999708-000 Bin No. 013		11172256-00003	6/11/1:	2	12:20:48		
			Batch No.	Order Dat	е	Page		
			0001254090	6/09/12		1		
S	ls#	P.(O. Number	Order Type	Pho	ne Number		
29	5			PIN	54-0-0-0-0-0-0-0-0-0-0-0-0-0-0-0-0-0-0-0			
		Ship V	ia	Te	rms			
		BESTWAY G	ROUND	PA	Z PAT	1		



5225 South Washington Ave. Titusville, FL 32780 ATTN: RETURNS DEPT.

Ship To:

Location	Down St	lov s	Tree	A 00 00 00 00 00 00 00 00 00 00 00 00 00	500.00 mm.		-			
Docarton	Part No.	Shpd	UM	Description	on		B/0	Unit Price	Sale Price	Amount
21-06-01	88-0160-1	1	EA	Battery Tender		USA	0	59.99	50.99	50.99
			1	The same of the sa		0011		33.33	30.99	50.55
** Part:	with 'ALT' are	ship	ding	from an alternate location	. ****					
"" Part:	with 'B/O' are	out (di 8	tock and will ship at a lat	er date. ****					
ALT	P916241	1	EA	K&n Oil Filter		USA	0			
	P905512	1	EA	Outer Door Handle Lock Inse	rt, 914 70-76	2 Per USA	0	-		
	P906279	1 0	EA	914-6 Rear Valance Pan		. USA	1			
ALT	P906260	1	KT	914 Rear Spoiler		USA	0			
		40								
		12						1		
								l i	İ	
								S		
								-		
									1	
						1				
								-	1	
								ŀ		
									İ	
								-		
						1				
									1	
								1		
				a a						
			11 1111	Cust. #: 22999708-000	INSPECT CONTE	NTS OF		Sale Amount		50.99
								Shpg & Hndg	3	.00
				Order #: 11172256-00003	Marie and the commence of the			Sales Tax		.00
				1881	SHORTAGES WIT	HIN 5 DAYS		Pkg Protect		.00
					PICK	PACK		COD Charges Total	5	.00 50.99
								Prepayment		.00

Comments:

COUPON CODE NUY PLEASE ADD DISCOUNT



1-800-327-4868

FAMILY OF AUTOMOTIVE PARTS COMPANIES



Sold To:

23023086-000 Bin No. 007		11191373-00001	7/11/1	7/11/12 Order Date 7/10/12		
		Batch No.	Order Dat			
		0001263732	7/10/12			
Sls#	Ρ,	O. Number	Order Type	Phor	ne Number	
295			PIN	510	9099331	
	Ship V	ia	Te	rms		
	BESTWAY C	ROUND	PA	Y PAL		

Ship To:

ocation	Part No.	Shpd	UM		Descriptio	n		D/U	Unit Price	Sale Price	Amount
6-06-12	P904205 P910271	1	EA	Gasket,Oil	Sump Plate,1976-	1989 911 Porsch		0	3.99	3.99	3.99
-05-12	P9102/1		EA	Gasket,Oil	Sump, 914-4, 911,	930 Porsche	USA	0	6.99	6.99	6.9
				11 =					8		
								-			
								1			
								ł			
			#	Cust. #:	23023086-000	INSPECT CONTEN	JTC OF		Sale Amoun		10.98
				Order #:	11191373-00001	SHIPMENT FOR I			Shpg & Hnd Sales Tax		7.99
						SHORTAGES WITH			Pkg Protec	+	.00

5225 South Washington Ave. Titusville, FL 32780 ATTN: RETURNS DEPT.

PICK PACK COD Charges .00 Total 18.97 Prepayment Balance Due .00

Comments:



6117 DOUGHERTY ROAD DUBLIN, CA 94568

PH: 925-829-2050 BAR# ARDAC246747 EPA#000309663

REPAIR ORDER # 000098663

DATE: 03/25/15 11:05 am

PAGE: 1 REFERENCE: MIIN 56226 MIOUT 56234

VEHICLE: 70 PORSCHE LICENSE: 6HEW185/CA

VIN: 9140431823

ENGINE: Cyl H6 Disp 2.3 MILEAGE: 56234 COLOR:

IALS CANNOT BE COMBINED

REPAIR INSTRUCTIONS:

CUSTOMER:

ADDRESS:

PHONE 1:

PHONE 2:

EMAIL:

CITY:

PAYMENT TERMS: CASH. VISA. MASTERCARD DISCOVER, NO CHECKS

NO PAYMENTS ACCEPTED OVER PHONE

914 - 6

BUSINESS HOURS: Monday-Friday 7:30am-5:30pm

		LABOR				PARTS	
OP		DESCRIPTION	CHARGE	QUA	Part Number	/Description	PRICE
01	DS	TUNE	775.00		GASOLINE	GASOLINE	22.05
		LD LIKE VEHICLE AIR AND FUEL TUN		2.0	PARTS CLEANER	SPRAY SOLVENT	19.90
	THAT AREA.	S IN WYOMING AND HAD BEEN CALIBRATE	RATED FOR		311-133-511 D	FUEL FILTER	
				1.0	914 612 316 10	FUSE BOX COVER	43.35
	CHARGED BAS	TTERY, ADDED FRESH FUEL, STARTED SE SETTINGS TIMING, ADJUST CARBS	ENGINE,		0 2 0 5 0	VALVOLINE	71.28
	SPEED ALONG	WITH MIXTURE. ROAD TESTED RUNN	ING DECENT.		SEAL RING	COPPER OR ALUMINUM	2.20
	FUEL TANK 1	VEEDS TO BE REMOVED AND SENT FOR	R CLEANING		901 107 203 09	OIL FILTER	18.95
		AS IT HAS RUST AND ITS AFFECTING	īG		900 031 011 30	WASHER	2.96
02	DS	OIL AND FILTER CHANG	155 00		930 101 391 01	SUMP GASKETS	
02	CHANGE OIL	AND FILTER, PERFORM SAFETY.	155.00		PARTS CLEANER	SPRAY SOLVENT	9.95
l l					930 101 902 00	SUMP PLATE	55.85
		REAR BRAKES AT 8MM, FRONT TIRES			999 025 193 30	WASHERS	16.64
03		AT 32PSI, ALL TIRES AT 6MM. BRAKE BLEED *PORSCHE			ATE DOT4	ATE DOT 4 BRAKE FL	54.50
05	PERFORM BRA	AKE FLUID FLUSH, FLUSH OLD FLUID	AND FILE		477 611 361	RESERVOIR CAP	10.71
1000	WITH NEW.				901 355 908 00	GASKET	11.19
04		FUEL TANK			477 919 133	GASKET FUEL SENDER	7.00
	FOUND FUEL	FILTERS ARE RUST ON VEHICLE, RE	MOVE FUEL		914 201 893 10	GASKET	16.37
	REPLACED FI	END OUT FOR BOILING OUT, REPAIR TTINGS WITH NEW PARTS AS NEW PA	AND RESEAL.	13.0	FUEL TANK	REPAIR	385.00
	AVAILABLE.		7744		FUEL TANK	NUTS AND BOLTS PARTS USED	64.74
05	DS	PARKING BRAKE			999 166 001 02	PARTS USED CLEVIS PIN	45.00
		NG BRAKE LEVER JAMMED/RUSTY AND			968 613 601 00	SWITCH	6.79
	LIGHT ON RU	ST ISSUES. REMOVE, INSPECT AND	FIX.	1.0	966 613 601 00	SWIICH	22.73
	CLEVIS PIN FOR CONTACT	NG BRAKE CONTACT IS BAD ALONG W NEEDED. ALSO FOUND WIRING REPAI SWITCH. PERFORMED REPAIR OKAY	R NEEDED				
06	TIME, DS	STEERING WHEEL	155.00				
0.0	טט	SIEEVING MUEET	155.00				
			1				

RECOMMENDED REPAIRS:

ITEMS 1-6

Loss of personal property or partial theft of automobile is not insured or protected against loss occasioned by theft, fire and vandalism while property remains with the repair facility. I hereby authorize the repair work to be done along with the necessary materials and sublet repairs. I hereby grant you and/or your employees permission to operate the vehicle herein described on street, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on vehicle to secure the amount of repairs thereto. In the event legal action is necessary to enforce this contract. I will pay reasonable attorney's fees and court fees. In addition I acknowledge notice & oral approval of an increase in the orginal estimated price.

(Signature) (Date) QUOTES: 02:41pm 3922. In Person 03/25 11:08am 775.00 3922.37 04/13 JULIE JOHN Ph: ITEMS 1-8 03/26 10:39am 3049.43 JOHN In Person

CHECK # HAZ WASTE: \$ 4.75 SRCHRG TOTAL: \$ FREIGHT: \$ 0.00 LABOR: \$ 2,712.50 PARTS: \$ 689.78 SUBLET: \$ 0.00 NON TAXABLE: \$ 407.05 DISCOUNT: \$ 0.00 SUBTOTAL: \$ 3,814.08 TAX: \$ 65.53 TOTAL: \$ 3879.61 PAYMENTS: \$ 0.00 DUE: \$ 3,879.61

ALL NEW MECHANICAL PARTS AND ASSOCIATED LABOR HAVE A LIMITED WARRANTY FOR 6,000 MILES OR 6 MONTHS WHICHEVER OCCURS FIRST, SUBJECT TO DISCLAIMER OF WARRANTIES HEREON PRINTED AND TO THE CONDITIONS OF THE SONG-BEVERLY ACT. WARRANTY IS VALID ONLY IF VEHICLE IS RETURNED TO OUR FACILITY FOR REPAIRS AND/OR ADJUSTMENTS. WARRANTY IS VOID IF THERE IS ANY EVIDENCE OF NEGLECT, MISUSE, OR ABUSE CONTRIBUTING TO ANY FAILURE.

6117 DOUGHERTY ROAD DUBLIN, CA 94568

PH: 925-829-2050 BAR# ARDAC246747 EPA#000309663

REPAIR ORDER # 000098663

DATE: 03/25/15 11:05 am PAGE: 2 REFERENCE: MIIN 56226 MIOUT 56234

CUSTOMER:

ADDRESS: CITY:

PHONE 1: PHONE 2:

EMAIL:

VEHICLE: 70 PORSCHE

LICENSE: 6HEW185/CA

VIN: 9140431823

ENGINE: Cyl H6 Disp 2.3 MILEAGE: 56234 COLOR:

IALS CANNOT BE COMBINED

QUA

1.0 MT47

REPAIR INSTRUCTIONS:

OP

PAYMENT TERMS:

CASH, VISA, MASTERCARD DISCOVER, NO CHECKS

NO PAYMENTS ACCEPTED OVER PHONE

BATTERY INTERSTATE

914 - 6

PRICE

150.95

BUSINESS HOURS: Monday-Friday 7:30am-5:30pm

Part Number/Description

PARTS

LABOR

DESCRIPTION CHARGE

FOUND STEERING WHEEL IS 90 DEGREES OFF CENTER. REMOVED WHEEL AND MOUNTED AGAIN IN CORRECT POSITION.

VEHICLE HAS AFTERMARKET STEERING WHEEL. 07 DS

HORN

155.00 FOUND HORN NOT WORKING ON VEHICLE. DIAGNOSE TO SEE WHAT IS NEEDED.

FOUND SHORTED WIRING GOING TO HORN. PERFORMED REPAIR

WORKING OKAY NOW. 08 DS BATTERY

77.50

PERFORM BATTERY REPLACEMENT ON VEHICLE. INTERSTATE BATTERIES HAVE A 72 MONTH WARRANTY. FIRST 24 MONTHS IS FREE REPLACEMENT, AFTER 24 MONTHS BATTERY IS PRORATED. LABOR WARRANTY FOR ALL BATTERIES IS 12 MONTHS ONLY. WORLDSOURCE BATTERIES HAVE 24 MONTH WARRANTY FOR PARTS AND 12 MONTHS WARRANTY FOR LABOR.

RECOMMENDED REPAIRS:

Loss of personal property or partial theft of automobile is not insured or protected against loss occasioned by theft, fire and vandalism while property remains with the repair facility. I hereby authorize the repair work to be done along with the necessary materials and sublet repairs. I hereby grant you and/or your employees permission to operate the vehicle herein described on street, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on vehicle to secure the amount of repairs thereto. In the event legal action is necessary to enforce this contract. I will pay reasonable attorney's fees and court fees. In addition I

acknowledge notice & oral approval of an increase in the orginal estimated price. (Signature) (Date)

QUOTES: 02:41pm 3722 In Person 03/25 11:08am 775.00 3922.37 04/13 JULIE Ph: JOHN ITEMS 1-8

2 03/26 10:39am 3049.43 JOHN In Person ITEMS 1-6

CHECK # HAZ WASTE: \$

4.75 SRCHRG TOTAL: \$ FREIGHT: \$ 0.00

2,712.50 LABOR: \$ PARTS: \$ 689.78

SUBLET: \$ 0.00 NON TAXABLE: \$ 407.05 DISCOUNT: \$

0.00 SUBTOTAL: \$ 3,814.08 TAX: \$ 65.53

TOTAL: \$ 3879.61 PAYMENTS: \$ 0.00

DUE: \$ 3,879.61

ALL NEW MECHANICAL PARTS AND ASSOCIATED LABOR HAVE A LIMITED WARRANTY FOR 6,000 MILES OR 6 MONTHS WHICHEVER OCCURS FIRST, SUBJECT TO DISCLAIMER OF WARRANTIES HEREON PRINTED AND TO THE CONDITIONS OF THE SONG-BEVERLY ACT. WARRANTY IS VALID ONLY IF VEHICLE IS RETURNED TO OUR FACILITY FOR REPAIRS AND/OR ADJUSTMENTS. WARRANTY IS VOID IF THERE IS ANY EVIDENCE OF NEGLECT, MISUSE, OR ABUSE CONTRIBUTING TO ANY FAILURE.

KAHLER'S WERKSTATT 000098663 REPAIR ORDER # DATE: 03/25/15 11:05 am 6117 DOUGHERTY ROAD PAGE: 1 REFERENCE: DUBLIN, CA 94568 PH: 925-829-2050 BAR# ARDAC246747 EPA#000309663 MIIN 55827 MIOUT VEHICLE: CUSTOMER: 70 PORSCHE 914 - 6ADDRESS: LICENSE: 6HEW185/CA 9140431823 VIN: CITY: PHONE 1: ENGINE: Cyl H6 Disp 2.3 PHONE 2: MILEAGE: 55827 COLOR: EMAIL: JECIALS CANNOT BE COMBINED PAYMENT TERMS: REPAIR INSTRUCTIONS: CASH, VISA, MASTERCARD DISCOVER, NO CHECKS NO PAYMENTS ACCEPTED OVER PHONE BUSINESS HOURS: Monday-Friday 7:30am-5:30pm LABOR PARTS QUA Part Number/Description PRICE OP DESCRIPTION CHARGE 01 MR TUNE 775.00 CLIENT WOULD LIKE VEHICLE AIR AND FUEL TUNED AS VEHICLE WAS IN WYOMING AND HAD BEEN CALIBRATED FOR THAT AREA. RECOMMENDED REPAIRS: Loss of personal property or partial theft of automobile is not insured or protected against loss occasioned by theft, fire and vandalism while property CHECK # remains with the repair facility. I hereby authorize the repair work to be done along with the necessary materials and sublet repairs. I hereby grant you and/or HAZ WASTE: \$ 0.00 your employees permission to operate the vehicle herein described on street, SRCHRG TOTAL: \$ highways or elsewhere for the purpose of testing and/or inspection. An express FREIGHT: \$ 0.00 mechanic's lien is hereby acknowledged on vehicle to secure the amount of LABOR: \$ 775.00 repairs thereto. In the event legal action is necessary to enforce this contract. I will pay reasonable attorney's fees and court fees. In addition I PARTS: \$ 0.00 acknowledge notice & oral approval of an increase in the orginal estimated SUBLET: \$ 0.00 price. NON TAXABLE: \$ 0.00 (Signature) DISCOUNT: \$ 0.00 QUOTES: SUBTOTAL: \$ 775.00 03/25 11:08am 775.00 JULIE TAX: \$ 0.00 TOTAL: \$ 775.00 PAYMENTS: \$ 0.00 775.00

ALL NEW MECHANICAL PARTS AND ASSOCIATED LABOR HAVE A LIMITED WARRANTY FOR 6,000 MILES OR 6 MONTHS WHICHEVER OCCURS FIRST, SUBJECT TO DISCLAIMER OF WARRANTIES HEREON PRINTED AND TO THE CONDITIONS OF THE SONG-BEVERLY ACT. WARRANTY IS VALID ONLY IF VEHICLE IS RETURNED TO OUR FACILITY FOR REPAIRS AND/OR ADJUSTMENTS. WARRANTY IS VOID IF THERE IS ANY EVIDENCE OF NEGLECT, MISUSE, OR ABUSE CONTRIBUTING TO ANY FAILURE.