

# 1987 Land Rover Defender 110



**VIN: SALLDHMB8BA297441**



# Vehicle History Report™

US \$39.99

VIN: SALLDHMB8BA297441



No accidents or damage reported to CARFAX



16 Service history records



28 Detailed records available



110,924 Last reported odometer reading



This CARFAX Vehicle History Report is based only on information supplied to CARFAX and available as of 5/24/22 at 9:43:26 AM (CDT). Other information about this vehicle, including problems, may not have been reported to CARFAX. Use this report as one important tool, along with a vehicle inspection and test drive, to make a better decision about your next used car.



## Title History

CARFAX guarantees the information in this section

### Summary

Salvage | Junk | Rebuilt | Fire | Flood | Hail | Lemon

Guaranteed No Problem

Not Actual Mileage | Exceeds Mechanical Limits

Guaranteed No Problem



**GUARANTEED** - None of these major title problems were reported by a state Department of Motor Vehicles (DMV). If you find that any of these title problems were reported by a DMV and not included in this report, CARFAX will buy this vehicle back. [Register](#) | [View Terms](#) | [View Certificate](#)



## Additional History

Not all accidents / issues are reported to CARFAX

### Summary

Total Loss  
No total loss reported to CARFAX.

No Issues Reported

Structural Damage  
No structural damage reported to CARFAX.

No Issues Reported

Airbag Deployment  
No airbag deployment reported to CARFAX.

No Issues Reported

Odometer Check  
No indication of an odometer rollback.

No Issues Indicated

Accident / Damage  
No accidents or damage reported to CARFAX.

No Issues Reported

Manufacturer Recall  
Check with an authorized dealer for any open recalls.

Ask Your Dealer







Basic Warranty  
No data reported to CARFAX.

No Data Reported



## Detailed History

Date	Mileage	Source	Comments
------	---------	--------	----------

11/22/2013		California Motor Vehicle Dept. Woodland Hills, CA	Title issued or updated
05/07/2014		California Motor Vehicle Dept. Woodland Hills, CA	Registration updated when owner moved the vehicle to a new location
08/12/2014	88,381	Sherman Oaks Exclusive Sherman Oaks, CA 818-986-1191 shermanoaksexclusive.com ★ 4.8 / 5.0 <a href="#">18 Verified Reviews</a> ✓ ♥ 14 Customer Favorites	 Vehicle serviced - Ignition system checked
03/17/2015		Sherman Oaks Exclusive Sherman Oaks, CA 818-986-1191 shermanoaksexclusive.com ★ 4.8 / 5.0 <a href="#">18 Verified Reviews</a> ✓ ♥ 14 Customer Favorites	 Vehicle serviced
05/13/2015		California Motor Vehicle Dept. Woodland Hills, CA	Registration updated when owner moved the vehicle to a new location
01/18/2016	90,955	Sherman Oaks Exclusive Sherman Oaks, CA 818-986-1191 shermanoaksexclusive.com ★ 4.8 / 5.0 <a href="#">18 Verified Reviews</a> ✓ ♥ 14 Customer Favorites	 Vehicle serviced - 90,000 mile service performed - Power steering fluid leak checked - Fluids checked - Engine oil/fluid leak checked - Drivability/performance checked - Brakes checked - Drive belt(s) replaced - Engine mount(s) replaced - Tire condition and pressure checked - Brake wheel cylinder(s) replaced
02/01/2016		Sherman Oaks Exclusive Sherman Oaks, CA 818-986-1191 shermanoaksexclusive.com ★ 4.8 / 5.0 <a href="#">18 Verified Reviews</a> ✓ ♥ 14 Customer Favorites	 Vehicle serviced - Two wheel alignment performed
03/19/2016		Dealer Inventory	Vehicle offered for sale
12/04/2016	91,924	Dealer Inventory	Vehicle offered for sale
03/10/2017	91,934	California Motor Vehicle Dept. Sonoma, CA	Odometer reading reported
03/27/2017	92,060	Metric Motors Sonoma, CA 707-996-4870 metircmotorsauto.com ★ 4.9 / 5.0 <a href="#">7 Verified Reviews</a> ✓ ♥ 10 Customer Favorites	 Vehicle serviced - Parking brake repaired/replaced - Parking brake shoes/pads replaced - Wiring repaired
04/07/2017		California Motor Vehicle Dept. Sonoma, CA	Title issued or updated - New owner reported
05/12/2017		Metric Motors Sonoma, CA 707-996-4870 metircmotorsauto.com	 Vehicle serviced - Drive belt(s) replaced - Door latch repaired/replaced - Front door latch replaced

		4.9 / 5.0 <a href="#">7 Verified Reviews</a> 10 Customer Favorites	
09/07/2017		California Motor Vehicle Dept. Sonoma, CA	<b>Title issued or updated</b> - Correction to record
05/25/2018	94,968	Metric Motors Sonoma, CA 707-996-4870 metircmotorsauto.com 4.9 / 5.0 <a href="#">7 Verified Reviews</a> 10 Customer Favorites	<b>Vehicle serviced</b> - Air filter checked - Fluids checked - Oil and filter changed - Tire condition and pressure checked - Body lubricated
06/14/2018	95,140	Metric Motors Sonoma, CA 707-996-4870 metircmotorsauto.com 4.9 / 5.0 <a href="#">7 Verified Reviews</a> 10 Customer Favorites	<b>Vehicle serviced</b>
08/03/2018	95,377	Metric Motors Sonoma, CA 707-996-4870 metircmotorsauto.com 4.9 / 5.0 <a href="#">7 Verified Reviews</a> 10 Customer Favorites	<b>Vehicle serviced</b> - Drive belt(s) replaced
02/15/2019	95,525	Metric Motors Sonoma, CA 707-996-4870 metircmotorsauto.com 4.9 / 5.0 <a href="#">7 Verified Reviews</a> 10 Customer Favorites	<b>Vehicle serviced</b> - Engine timing/front cover gasket replaced - Engine mount(s) replaced - Oil and filter changed
06/06/2019	98,137	Metric Motors Sonoma, CA 707-996-4870 metircmotorsauto.com 4.9 / 5.0 <a href="#">7 Verified Reviews</a> 10 Customer Favorites	<b>Vehicle serviced</b> - Oil and filter changed - Air filter checked - Fluids checked - Tire condition and pressure checked - Body lubricated - Washer nozzle(s) replaced
06/12/2019	98,637	Daves Muffler Service Sonoma, CA 707-939-1256 davesmufflerandbrake.com/ 5.0 / 5.0 <a href="#">7 Verified Reviews</a> 11 Customer Favorites	<b>Vehicle serviced</b>
10/02/2019	101,261	Metric Motors Sonoma, CA 707-996-4870 metircmotorsauto.com 4.9 / 5.0 <a href="#">7 Verified Reviews</a> 10 Customer Favorites	<b>Vehicle serviced</b> - Brake drum(s) replaced - Rear brake shoes replaced - Brake shoes replaced
02/14/2020	102,893	Metric Motors Sonoma, CA 707-996-4870 metircmotorsauto.com 4.9 / 5.0 <a href="#">7 Verified Reviews</a> 10 Customer Favorites	<b>Vehicle serviced</b> - Oil and filter changed - Power steering checked
09/02/2020		California Motor Vehicle Dept. Sonoma, CA	<b>Registration updated when owner moved the vehicle to a new location</b>

06/10/2021	108,023	California Inspection Station Irvine, CA	Failed emissions inspection
06/16/2021	108,050	California Inspection Station Irvine, CA	Passed emissions inspection
06/29/2021		California Motor Vehicle Dept. Sonoma, CA	Title issued or updated - Correction to record - Registration updated when owner moved the vehicle to a new location
11/04/2021	110,681	Metric Motors Sonoma, CA 707-996-4870 metircmotorsauto.com ★ 4.9 / 5.0 <a href="#">7 Verified Reviews</a> ♥ 10 Customer Favorites	Vehicle serviced - Alternator checked
11/19/2021	110,924	Metric Motors Sonoma, CA 707-996-4870 metircmotorsauto.com ★ 4.9 / 5.0 <a href="#">7 Verified Reviews</a> ♥ 10 Customer Favorites	Vehicle serviced

Have Questions? Please visit our Help Center at [www.carfax.com](http://www.carfax.com).



## Glossary

### Failed Emissions Inspection

The emissions check performed during a vehicle inspection indicated the vehicle was emitting more than allowable emissions standards and/or had missing or modified parts. Repeated failed emissions records can indicate engine problems and CARFAX recommends you have the vehicle inspected.

### New Owner Reported

When a vehicle is sold to a new owner, the Title must be transferred to the new owner(s) at a Department of Motor Vehicles.

### Ownership History

CARFAX defines an owner as an individual or business that possesses and uses a vehicle. Not all title transactions represent changes in ownership. To provide estimated number of owners, CARFAX proprietary technology analyzes all the events in a vehicle history. Estimated ownership is available for vehicles manufactured after 1991 and titled solely in the US including Puerto Rico. Dealers sometimes opt to take ownership of a vehicle and are required to in the following states: Maine, Massachusetts, New Jersey, Ohio, Oklahoma, Pennsylvania and South Dakota. Please consider this as you review a vehicle's estimated ownership history.

### Title Issued

A state issues a title to provide a vehicle owner with proof of ownership. Each title has a unique number. Each title or registration record on a CARFAX report does not necessarily indicate a change in ownership. In Canada, a registration and bill of sale are used as proof of ownership.

Follow Us:



[facebook.com/CARFAX](https://facebook.com/CARFAX)



[@CARFAXinc](https://twitter.com/CARFAXinc)



About CARFAX

CARFAX DEPENDS ON ITS SOURCES FOR THE ACCURACY AND RELIABILITY OF ITS INFORMATION. THEREFORE, NO RESPONSIBILITY IS ASSUMED BY CARFAX OR ITS AGENTS FOR ERRORS OR OMISSIONS IN THIS REPORT. CARFAX FURTHER EXPRESSLY DISCLAIMS ALL WARRANTIES, EXPRESS OR IMPLIED, INCLUDING ANY IMPLIED WARRANTIES OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE.

© 2022 CARFAX, Inc., part of S&P Global. All rights reserved.  
5/24/22 9:43:26 AM (CDT)

## DIRECT DEALER WARRANTY - VEHICLE DETAILS

### Basic Details

<b>VIN:</b>	LDHMB8BA 297441	<b>Reg Number:</b>	
<b>Description:</b>	LR 110 S.W. TURBO PRE 1995 model year MY		
<b>Despatched Date:</b>	12-Jun-1987	<b>CSO Number:</b>	297441
<b>Sold Date:</b>	26-Jun-1987	<b>Sold By:</b>	Z9999 - LAND ROVER WARRANTY
<b>Paint:</b>	No description found	<b>Trim Colour:</b>	

### Warranty Cover

### Open Field Service Actions

#### Code FSA

A255 WHITE ROGERS WINCH KIT  
SOLENOID POTENTIAL O/HEAT P

#### Message

This campaign only affects those vehicles fitted  
with WARN winch part number LRN50900.

### Claimed Field Service Actions

### Owner/Driver Details

### Warranty Referrals

### Features

### Trim Details

### Serial Numbers

### Aftermarket Fits - (Vehicle)

STATE OF CALIFORNIA

CERTIFICATE OF TITLE

VEHICLE HISTORY

D36170407N2

AUTOMOBILE

VEHICLE ID NUMBER

SALLDHMB8BA297441

BODY TYPE MODEL

UT

YR MODEL

1987 LNDR

MAKE

PLATE NUMBER

7XYV035

REGISTRATION EXPIRATION DATE

08/08/2017

ISSUE DATE

04/07/17

UNLADEN WEIGHT

YR 1ST SOLD

CLASS

\*YR

MO

EQUIPMT/TRUST NUMBER

FUEL TRANSFER DATE

D 03/10/17

FEES PAID

\$35

ODOMETER DATE

03/10/2017

ODOMETER READING

91934 MI

MOTORCYCLE ENGINE NUMBER

REGISTERED OWNER(S)

SONOMA CA 95476



I certify (or declare) under penalty of perjury under the laws of the State of California that THE SIGNATURE(S) BELOW RELEASES INTEREST IN THE VEHICLE.

1a. DATE X

SIGNATURE OF REGISTERED OWNER

1b. DATE X

SIGNATURE OF REGISTERED OWNER

Federal and State law requires that you state the mileage upon transfer of ownership. Failure to complete or providing a false statement may result in fines and/or imprisonment.

The odometer now reads [ ] (no tenths), miles and to the best of my knowledge reflects the actual mileage unless one of the following statements is checked. Mileage is VOID if altered or erased.

WARNING [ ] Odometer reading is not the actual mileage. [ ] Mileage exceeds the odometer mechanical limits.

I certify (or declare) under penalty of perjury under the laws of the State of California that the foregoing is true and correct.

Table with 4 columns: DATE, TRANSFEROR/SELLER SIGNATURE(S), DATE, TRANSFEREE/BUYER SIGNATURE(S). Includes printed names of seller and buyer.

IMPORTANT READ CAREFULLY

Any change of Lienholder (holder of security interest) must be reported to the Department of Motor Vehicles within 10 days.

LIENHOLDER(S)

2. X Signature releases interest in vehicle. (Company names must be countersigned) Release Date

CA172636792

022575

REG. 17.30RS (REV.02/2016)

KEEP IN A SAFE PLACE - VOID IF ALTERED

VOID WITHOUT BEAR WATERMARK. HOLD TO LIGHT TO VIEW.

VOID WITHOUT BEAR WATERMARK. HOLD TO LIGHT TO VIEW.

**REPAIR ORDERS**

**ENGINE REPLACEMENT**

**CERTIFICATE OF COMFORMANCE**



# METRIC MOTORS

19674 8TH ST EAST unit 1  
SONOMA, CA. 95476  
(707) 996-4870  
Writer: MIGUEL MACIAS




# ESTIMATE #3564

metricmotorsauto@gmail.com  
METRICMOTORSAUTO@GMAIL.COM  
BAR# ARD00286708

CUSTOMER	YEAR: 1987	TRANS/DRIVE: AUTO/4WD
SONOMA CA 95476	MAKE/MODEL: LAND ROVER DEFENDER	LICENSE/STATE: 53577D3/CA
Home:	VIN: SALLDHMB8BA297441	MILES IN/MILES 111368/111379
	ENGINE: 3.9L 8cyl	

In: 2/3/2022 Out: 2/3/2022 Email: nigel@bohohwy.com

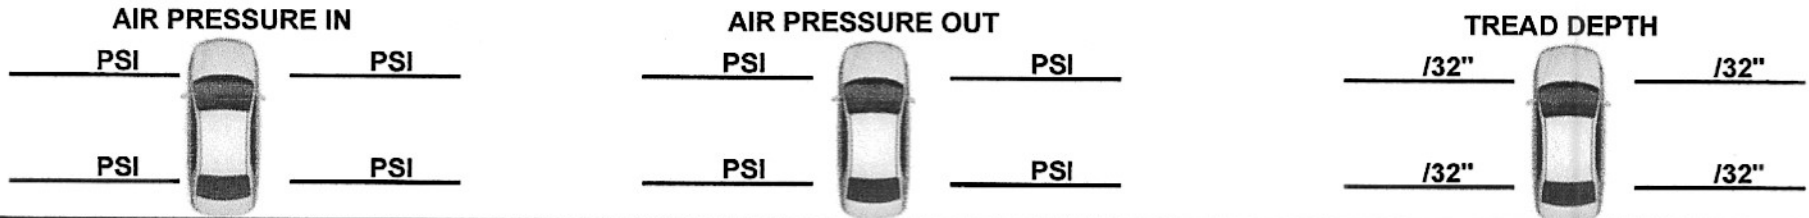

VEHICLE ISSUE #1: SERVICE				
TECH REPORT: PERFORMED OIL SERVICE				
PART: 078 115 561J	OIL FILTER SPIN-ON	1 @ \$15.33	\$15.33	NEW
PART: 5W-30B	SYNTHETIC BLEND OIL	6.5 @ \$10.95	\$71.17	NEW
LABOR:	OIL SERVICE		\$50.00	LABOR
VEHICLE ISSUE #2: ENGINE NOT RUNNING CORRECTLY.				
TECH REPORT: FOUND SEVERAL CYLINDERS NOT RUNNING. FOUND SPARK PLUG WIRES CORRODED AT COILS. REPLACED SPARK PLUG WIRES AND FOUND ENGINE STILL NOT RUNNING CORRECTLY. FOUND SEVERAL INJECTORS NOT INJECTOR FUEL. FOUND ECM IS NOT TELLING THE INJECTORS TO OPEN. SENT ECM OUT FOR TESTING. REPLACED ECM WITH REMAIN UNIT				
PART: HLS 102	IGNITION WIRE SET	1 @ \$94.68	\$94.68	NEW
SUBLET	ECM REPAIR		\$800.00	SUBLET
VEHICLE ISSUE #3: DOOR LATCH				
TECH REPORT: REPLACED LEFT REAR DOOR LATCH				
PART: MTC90203	LEFT REAR DOOR LATCH	1 @ \$157.50	\$157.50	NEW
LABOR:	REPLACE LEFT REAR DOOR LATCH		\$165.00	LABOR
VEHICLE ISSUE #4: TRANSFER CASE LEAKING OIL				
TECH REPORT: REMOVED TRANSFER CASE AND RESEALED. REINSTALLED TRANSFER CASE. FILLED TO CORRECT LEVEL				
PART: RTC3890G	TRANSFER CASE GASKET KIT	1 @ \$44.89	\$44.89	NEW
PART: 105787	GEAR OIL GEARBOX 80W90 1L	3 @ \$23.92	\$71.75	NEW
LABOR:	TRANSFER CASE, R&R, ALL MODELS		\$1,514.70	LABOR
VEHICLE ISSUE #5: TRANSMISSION COOLER LINES LEAKING FLUID				
TECH REPORT: REPLACED TRANSMISSION COOLER LINES WITH NEW.				
PART: ESR4219	TRANSMISSION COOLER LINE	1 @ \$314.50	\$314.50	NEW
PART: ESR4218G	TRANSMISSION COOLER LINE	1 @ \$351.50	\$351.50	NEW

Recommended Repairs:	Labor/Jobs	\$3,393.89
	Parts	\$1,585.86
Warranty: From the date of delivery for a period of [36] months or [36,000] miles, whichever comes first, this firm will repair free of charge any defects in material and workmanship to the repairs stated on the invoice. All work to be done in our shop only. This does not include towing charges or customer supplied parts. A storage fee of [125.00] per day will be charged 24 hours after notification that work is complete. Neglect/abuse of vehicle will immediately void any and all warranties. Used parts are warranty for 6 months 6,000 miles. Warranty is not transferable for purchasing customer only.	Sublet	\$800.00
	Total Fees	\$1.50
	Subtotal	\$5,781.25
	Tax @ 8.5%	\$134.80
	Total	\$5,916.05
	Payments	\$4,000.00
	Balance	\$1,916.05

Replaced parts may be requested by customer. I hereby authorize the above repair work to be done along with all necessary materials. You and your employees may operate the above vehicle for the purposes of testing, inspection or delivery at my risk. An express mechanic's lien is acknowledged on the above vehicle to secure the amount of repairs thereto. The shop will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. In the event legal action is necessary to enforce this contract, I understand that I am solely responsible for all costs including attorney's fees and court costs. I have read the above and acknowledge receipt of an estimate. Estimate prices are valid for 30 days,

X \_\_\_\_\_ Date 6/1/2022

# METRIC MOTORS

19674 8TH ST EAST unit 1  
SONOMA, CA. 95476  
(707) 996-4870  
Writer: MIGUEL MACIAS



## ESTIMATE #3564

metricmotorsauto@gmail.com  
METRICMOTORSAUTO@GMAIL.COM  
BAR# ARD00286708

CUSTOMER:	YEAR: 1987	TRANS/DRIVE: auto/4wd
SONOMA CA. 95476	MAKE/MODEL: Land Rover defender	LICENSE/STATE: 53577D3/CA
Home: 18	VIN: SALLDHMB8BA297441	MILES IN/OUT: 111368 111379
	ENGINE: 3.9L 8cyl	

PART: 88865544	AUTO TRANS FLUID DEXRON III (H) 1 QT.	1 @ \$13.33	\$13.33	NEW
LABOR:	REPLACE TRANSMISSION COOLER LINES		\$336.60	LABOR
VEHICLE ISSUE #6: POWER STEERING LINES LEAKING				
TECH REPORT: REPLACED POWER STEERING LINES WITH NEW. TOPPED UP POWER STEERING LEVEL				
PART: ANR 5782	P/S RESERVOIR LINE HOSE	1 @ \$140.96	\$140.96	NEW
PART: QEH102380	POWER STEERING HOSE	1 @ \$132.64	\$132.64	NEW
PART: 88865549	AUTO TRANS FLUID DEXRON VI / 1 QUART	1 @ \$15.08	\$15.08	NEW
LABOR:	P/S SUPPLY HOSE, R&R, DISCOVERY		\$201.96	LABOR
LABOR:	RESERVOIR, R&R, DEFENDER		\$99.00	LABOR
VEHICLE ISSUE #7: RIGHT FRONT HUB SEAL LEAKING OIL				
TECH REPORT: RESEALED RIGHT FRONT HUB				
PART: STC3321G	SWIVEL BALL SEAL KIT	1 @ \$103.43	\$103.43	NEW
PART: STC 3435	STEERING SWIVEL LUBE	1 @ \$28.17	\$28.17	NEW
LABOR:	RIGHT FRONT SWIVEL BALL RESEAL		\$673.20	LABOR
VEHICLE ISSUE #8: FOUND ENGINE OIL PAN LEAKING				
TECH REPORT: RESEALED ENGINE OIL PAN				
PART: 29208	GASKET MAKER THE RIGHT STUFF 5OZ	1 @ \$30.94	\$30.94	NEW
LABOR:	OIL PAN GASKET, R&R, DEFENDER, 4.0L		\$353.43	LABOR
HAZARDOUS WASTE: \$1.50				
Payment Rec'd	visa - AuthCode 00731G	Date: 5/31/2022	\$4,000.00	

Recommended Repairs:	Labor/Jobs	\$3,393.89
	Parts	\$1,585.86
Warranty: From the date of delivery for a period of [36] months or [36,000] miles, whichever comes first, this firm will repair free of charge any defects in material and workmanship to the repairs stated on the invoice. All work to be done in our shop only. This does not include towing charges or customer supplied parts. A storage fee of [125.00] per day will be charged 24 hours after notification that work is complete. Neglect/abuse of vehicle will immediately void any and all warranties. Used parts are warranty for 6 months 6,000 miles. Warranty is not transferable for purchasing customer only.	Sublet	\$800.00
	Total Fees	\$1.50
	Subtotal	\$5,781.25
	Tax @ 8.5%	\$134.80
	Total	\$5,916.05
	Payments	\$4,000.00
	Balance	\$1,916.05

Replaced parts may be requested by customer. I hereby authorize the above repair work to be done along with all necessary materials. You and your employees may operate the above vehicle for the purposes of testing, inspection or delivery at my risk. An express mechanic's lien is acknowledged on the above vehicle to secure the amount of repairs thereto. The shop will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. In the event legal action is necessary to enforce this contract, I understand that I am solely responsible for all costs including attorney's fees and court costs. I have read the above and acknowledge receipt of an estimate. Estimate prices are valid for 30 days,

X \_\_\_\_\_

Date 6/1/2022



www.esp-global.com

# Smog Check Vehicle Inspection Report (VIR)



www.autorepair.ca.gov

## Vehicle Information

Test Date/Time: 06/16/2021@12:14:21

Model Year: 1987	Make: LAND ROVER	Model: DEFENDER
License: NONE	State: XX	VIN: SALLDHMB8BA297441
Engine Size: 4.00 L	Type: Truck	Transmission: Automatic
GVWR: 6450	Test Weight: N/A	Cylinders: 8
Odometer: 108,050	Certification: California	VLT Record #: 1166
Fuel Type: Gasoline	Exhaust: Single	Inspection Reason: Initial Registration
Referee Label #: N0303765	Engine Year: 1987	Engine Make: LAND ROVER

## Overall Test Results

Comprehensive Visual Inspection: **Pass** Functional Check: **Pass** Emissions Test: **Pass**

Thank you for performing the needed emissions-related repairs to your vehicle. These repairs help California reach its daily goal of removing an extra 100 tons of smog-forming emissions from the air.

Smog Check Certificate Number: RO745541

DMV ID Number: 46500245R081

Your Smog Check certificate has been electronically transmitted to DMV.

Your certificate is valid for 90 days from date of issuance.

Please keep this copy for your records.

## Emission Control Systems Visual Inspection/Functional Check Results

(Visual/Functional tests are used to assist in the identification of oxides of nitrogen, crankcase and cold start emissions which are not measured during the Idle test.)

Result	ECS	Result	ECS	Result	ECS
Pass	PCV	Not applicable	Thermostatic Air Cleaner	Pass	Fuel Evaporative Controls
Pass	Catalytic Converter	Not applicable	Air Injection	Not applicable	OBD System Checks
Not applicable	EGR Visual	Pass	Vacuum Lines to Sensors / Switches	Pass	Carb Fuel Injection
Not applicable	EGR Functional	Non Adjustable	Ignition Timing N 00	Pass	Other Emission Related Components
Not Applicable	Fuel Cap Functional	Pass	Wiring to Sensors	Pass	Oxygen Sensor
Pass	Fuel Cap Visual	Not applicable	Fillpipe Restrictor	Pass	Liquid Fuel Leaks
Pass	Spark Controls	Not applicable	Fuel Evaporative Controls Functional		

## Idle Emission Test Results

Test	RPM	%CO2		%O2		HC (PPM)		CO (%)		MEAS	Results
		MEAS	MEAS	MAX	AVE	MEAS	MAX	AVE			
Idle	699	14.8	0.2	150	40	127	1.20	0.10	0.35	Pass	
2500 RPM	2421	14.1	1.2	180	35	21	1.20	0.20	0.00	Pass	

MAX = Maximum Allowable Emissions

AVE = Average Emissions For Passing Vehicles

MEAS = Amount Measured

## Smog Check Inspection Station Information

GOLDENWEST CA STATE SMOG REFEREE  
 15744 Goldenwest Huntington Beach CA 92647  
 1800-622-7733  
 Station Number: XF799202

Technician Name/Number: PHILLIPS ANTHONY EO022456  
 Repair Tech Name/Number:  
 Software Version/EIS Number: 2050 EP627258

I certify, under penalty of perjury, under the laws of the State of California, that I performed the inspection in accordance with all bureau requirements and that the information listed on this vehicle inspection report is true and accurate.  
 Pretest repairs performed on this vehicle were not tamper related.

Date: 6-16-2021

Technician's Signature:





**USED MODIFIER-CERTIFIED MOTOR VEHICLE  
CERTIFICATE OF CONFORMANCE**

THIS VEHICLE CONFORMS TO APPLICABLE STATE OF CALIFORNIA  
REGULATIONS FOR THE 1987 MODEL YEAR.

C of C Number UDI 2488

VIN SALLDHMB8BA297441 MAKE Land Rover ODOMETER 107,979 mi  
 MODEL Defender MODEL YEAR 1987 DATE OF MANUFACTURE 1/1/1987  
 CUSTOM'S ENTRY # unknown DATE OF ENTRY 9/2013 PORT OF ENTRY unknown  
 AGE OF VEHICLE AT ENTRY INTO CALIFORNIA 26 YRS. 8 MOS. DECLARED VALUE \$57,000.00  
 MODIFIER'S NAME G&K MODIFIER'S PHONE 714-545-9503  
 MODIFIER'S ADDRESS 2530 south birch street  
santa ana ca 92707  
 MODIFIER'S AUTOMOTIVE REPAIR DEALER REGISTRATION NUMBER ARD204045  
 DATE EMISSION SYSTEM MODIFICATION COMPLETED 5/14/2021

*I certify, under penalty of perjury under the laws of the State of California, that all information on this document is correct and that the above-described vehicle has been modified to conform with the requirements of Chapter 6, Part 5, Division 26, of the California Health and Safety Code and that the above vehicle is in compliance with applicable laws and regulations. I further certify, under penalty of perjury under the laws of the State of California, that I have received the U.S. Department of Transportation bond release for safety for the above described vehicle.*

SIGNATURE OF OWNER OR MGR. OF MODIFYING FACILITY GK

LICENSED LABORATORY'S E.O.# T-102-0026 E.O. DATE OF ISSUANCE 4/1/2021  
 LICENSED LABORATORY'S NAME CEE, LLC  
 LICENSED LABORATORY'S ADDRESS 2530 south birch street  
santa ana ca 92707

*I certify, under penalty of perjury under the laws of the State of California, that the vehicle described above has been inspected and emission tested in accordance with the federal test procedures, Title 40, Code of Federal Regulations, Part 86, Subpart B, as they existed on July 1, 1985 by the licensed laboratory described above, that the emission control system components listed below were installed and functional at the time the test was performed, that the owner's manual with the vehicle contains a true and accurate description of the emission control system's functioning and maintenance, that the vehicle has been inspected and complies with the required specifications for fillpipes and opening of fuel tanks, tune-up labels, idle air/fuel adjustments, and any other applicable requirements specified under the "California Certification Procedures for 1975 and Later Model-Year Used Modifier-Certified Motor Vehicles" and that the vehicle has been emission tested and conforms with the applicable California emission standards for the vehicle model-year. I further certify under penalty of perjury under the laws of the State of California, that the emission control system installed on the vehicle has no obvious engineering or installation defects at the time of inspection and that a detailed written description of the vehicle inspection is attached to this document.*

SIGNATURE OF LICENSED LABORATORY MANAGER [Signature]

CERTIFICATE OF CONFORMANCE DATE OF ISSUANCE 5/24/2021

**CRITICAL EMISSION CONTROL COMPONENTS**

Emission Control Component	Vendor	Part Number
1. Catalytic Converter	<u>G&amp;K/G&amp;K</u>	<u>10434A/112004M</u>
2. O2 Sensor	<u>NTK</u>	<u>25017</u>
3. Electronic Control Unit	<u>Land Rover</u>	<u>80630A</u>
4. EGR System	<u>N/A</u>	<u>N/A</u>
5. Air Injection System	<u>N/A</u>	<u>N/A</u>
6. Other canister	<u>Purolator</u>	<u>00701</u>

**EXHAUST AND EVAPORATIVE EMISSIONS**

	HC	CO	NOx	Evap.	Part
Emission Standards	<u>0.50</u>	<u>9.0</u>	<u>1.0</u>	<u>2.00</u>	<u>N/A</u>
Emission Test Results	<u>0.28</u>	<u>1.5</u>	<u>0.07</u>	<u>1.26</u>	<u>N/A</u>

**IMPORTANT: ORIGINAL (WHITE) COPY OF THIS DOCUMENT MUST ACCOMPANY DMV APPLICATION FOR REGISTRATION**

**8545**

**G&K AUTOMOTIVE CONVERSION, INC**  
**2530 SOUTH BIRCH ST SANTA ANA CA 92707**  
**PHONE 714-545-9503 FAX 714-545-7667**  
**BAR # ARD204045**

DATE IN 11/26/21  
 Approximate completion date 11/16/21

Name  Nigel Weekes  
 ADDRESS 4166 France St.  
 CITY Sonoma, CA 94976  
 STATE CA ZIP 92110  
 YEAR, MAKE & MODEL 1984 Land Rover Defender  
 SERIAL NO. & I.N. SA LLDHMB8BA297441

Cell PHONE 6838  
 HOME PHONE 338  
 LICENSE NO. 107958  
 MILEAGE

NOTES  
 TERMS

SERVICES REQUESTED/DESCRIPTION OF WORK  
 AMOUNT

MODIFY VEHICLE TO MEET  
 CARB STANDARDS  
 TRUCK ALSO NEEDS AIR FILTER,  
 FUEL FILTER, OIL FILTER, SPARK PLUGS,  
 SPARK WIRES ESTIMATED COST \$1500

This estimate does not include cost of shipping, custom services & charges,  
 bonds, petition fees & costs and other government charges.

ESTIMATED COSTS		Total Parts
PARTS	LABOR	Total Labor
	TOTAL \$9,950.00	
AUTHORIZED BY	IN PERSON	BY PHONE
DATE	TIME	TESTING
		CARB Cert
REVISED ESTIMATE / ADDITIONAL WORK		Referee Handling
PARTS	LABOR	TAX
AUTHORIZED BY	IN PERSON	BY PHONE
DATE	TIME	Sub Total
		Deposit
		TOTAL

Customers will be notified when vehicle is ready for pick-up. Storage fees will be applied if vehicle is not picked up within 7 days of notification.

Estimated cost for teardown and reassembly \$ \_\_\_\_\_  
 TEARDOWN ESTIMATE: I understand that my vehicle will be reassembled within days \_\_\_\_\_ of the date shown above if I choose not to authorize the services recommended.

I hereby authorize the above repair work to be done along with the necessary materials. You and your employees may operate vehicle for purposes of testing, inspection, or delivery at my risk. An express mechanics lien is acknowledged on above vehicle to secure the amount of repairs thereto. I agree to pay reasonable legal fees incurred to secure payment for these repairs. It is understood that you will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft or any other cause beyond your control.

SIGNATURE  02/03/21

# METRIC MOTORS

19674 8TH ST EAST unit 1  
 SONOMA, CA. 95476  
 (707) 996-4870  
 Writer: SELIA VELASQUEZ



# INVOICE #2409

metricmotorsauto@gmail.com  
 METRICMOTORSAUTO@GMAIL.COM  
 BAR# ARD00286708

CUSTOMER:	YEAR:	1987	TRANS/DRIVE:	/
Home: (707) SONOMA, CA. 95476 38	MAKE/MODEL:	Land Rover	LICENSE/STATE:	/
	VIN:	SALLDHMB8BA297441	MILES IN/OUT:	107943 107943
	ENGINE:	L CYL		

VEHICLE ISSUE #7: REPAIR TAILGATE HINGE				
TECH REPORT: REPLACED MISSING HINGE HARDWARE.				
PART: HHK	HIDGE HARDWARE KIT	1 @ \$14.98	\$14.98	NEW
LABOR:	REPAIR TAILGATE HINGE		\$75.00	LABOR
VEHICLE ISSUE #8: REPLACED HIGH OUTPUT ALTERNATOR				
TECH REPORT: INSTALLED NEW HIGH OUTPUT ALTERNATOR				
PART: DHOPA160	HIGH OUTPUT ALTERNATOR	1 @ \$298.00	\$298.00	NEW
LABOR:	REPLACE ALTERNATOR		\$150.00	LABOR
			HAZARDOUS WASTE: \$1.50	
Payment Rec'd	visa - AuthCode 03147G	Date: 1/20/2021	\$1,623.27	

Recommended Repairs: *** CUSTOMER DECLINED: INSTALL FACTORY AIR FILTER BOX ( \$214.20) *** CUSTOMER DECLINED: INSTALL CARCOAL CANISTER ( \$285.60) *** CUSTOMER DECLINED: INSTALL DISCOVERY FUEL TANK ( \$856.80)	Labor/Jobs	\$526.50
	Parts	\$1,011.80
Warranty: From the date of delivery for a period of 36 months or 36000 miles, whichever comes first, this firm will repair free of charge any defects in material and workmanship to the repairs stated on the invoice. All work to be done in our shop only. This does not include towing charges or customer supplied parts. A storage fee of 125.00 per day will be charged 24 hours after notification that work is complete. Neglect/abuse of vehicle will immediately void any and all warranties.	Sublet	\$0.00
	Total Fees	\$1.50
	Subtotal	\$1,539.80
	Tax @ 8.25%	\$83.47
	Total	\$1,623.27
	Payments	\$1,623.27
	Balance	\$0.00

Replaced parts may be requested by customer. I hereby authorize the above repair work to be done along with all necessary materials. You and your employees may operate the above vehicle for the purposes of testing, inspection or delivery at my risk. An express mechanic's lien is acknowledged on the above vehicle to secure the amount of repairs thereto. The shop will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. In the event legal action is necessary to enforce this contract, I understand that I am solely responsible for all costs including attorney's fees and court costs. I have read the above and acknowledge receipt of an estimate.

**Metric Motors**  
 19674 8th Street East Suite# 1  
 Sonoma, CA. 95476  
 Phone - 707-996-4870 Fax - 707-996-4855

Print Date: 06/01/2022

**Customer and Vehicle Report**

Sonoma, CA, 95476

**Vehicle: 1987 Land Rover - Defender 110**

Invoice: 011443, Posted On: 06/06/2019, SW: Posey, Bo

Average Daily Mileage: 26

Odometer in: 98,137 Odometer Out: 98,137

Time Description	Part No.	Category	Technician	Qty	Sale	Extd	Price	Rate
1.50 Right rear jump seat bottom is broken. Remove seat bottom replace wood frame on seat bottom. Install repaired seat to vehicle.				1.50	202.50	202.50		135.00
- Seat frame wood.	38PLYW			1.00	32.22	32.22	32.22	
- Washer jet.	LR061677			1.00	25.00	25.00	25.00	
0.50 Washer jet came apart. Replace washer jet.				0.50	67.50	67.50		135.00
0.40 Lube, oil, and filter, Up to 5 quarts Lubricate and check chassis. Change oil and oil filter. Check air filter and breather filter. Check all fluid levels and tire pressures.		Lube Oil Filter		0.40	50.00	50.00		135.00
- Motor Oil 10W-30 - 1 Quart	19369683			6.50	11.28	73.32	11.28	
- Oil Filter .	L254012			1.00	15.98	15.98	15.98	
1.00 Found left rear tail light socket and right front blinker bulb socket corroded. Replace bulb sockets with new				2.00	38.21	76.42	38.21	
- Bulb socket housing	BSH3121							
<b>Totals for Invoice:</b>					222.94	677.94	0.00	
					0.00	0.00	18.39	696.33

Invoice: 011078, Posted On: 02/15/2019, SW: Posey, Bo

Odometer in: 95,525 Odometer Out: 95,525

Time Description	Part No.	Category	Technician	Qty	Sale	Extd	Price	Rate
60.00 Customer request drivetrain swap./ Remove drivetrain and all components needed from donor vehicle. Remove drivetrain from customers vehicle. Install all drivetrain and components needed for swap.				60.00	8,100.00	8,100.00		135.00



# Customer and Vehicle Report

Print Date: 06/01/2022

Vehicle: 1987 Land Rover - Defender 110

Average Daily Mileage: 26

Invoice: 011078, Posted On: 02/15/2019, SW: Posey, Bo

Odometer in: 95,525 Odometer Out: 95,525

Time Description	Part No.	Category	Technician	Qty	Sale	Extd	Price	Rate
- Parts vehicle	Used			1.00	2,000.00	2,000.00	2,000.00	
<b>Notes - 12/24/2018 Deposit of \$5000.00</b>								
- Valve Cover Screw	ERR 7370			4.00	7.12	28.48	7.12	
- Valve Cover Screw	ERR 7371			4.00	6.70	26.80	6.70	
- Engine Mount	KKB 103120			4.00	12.98	51.92	12.98	
- Oil Filter OEM	078 115 561J			1.00	21.63	21.63	21.63	
- Crankshaft Seal-Front	ERR 6490			1.00	40.41	40.41	40.41	
- Cylinder Head Gasket Set w/ Valve Stem Seals	STC 4082			1.00	256.40	256.40	256.40	
- Timing Cover Gasket	ERR 7280			1.00	24.15	24.15	24.15	
- Cylinder Head Bolt	ERR 2943			14.00	5.46	76.44	5.46	
- Cylinder Head Bolt	ERR 2944			6.00	6.92	41.52	6.92	
- Crankshaft Seal-Rear	ERR2640			1.00	32.04	32.04	32.04	
- Crankshaft Seal-Rear Rear	LUN 000010			2.00	7.18	14.36	7.18	
- Cetner console conversion kit	CCCD1S			1.00	1,285.31	1,285.31	1,285.31	
- Oil cooler and power steering hose modifications.					326.56	326.56	326.56	
Tube source. Modified oil cooler and power steering hoses to fit new engine to vehicle.								
- AT Shift Indicator	BTR 9926LNF			1.00	285.23	285.23	285.23	
- Breather Hose Rocker to Ram Housing	LLH 500090			1.00	11.12	11.12	11.12	
- Exh. Man. to Pipe Gasket	ETC 4524			1.00	13.33	13.33	13.33	
- Breather Hose Rocker to Plenum	LLH 500100			1.00	11.70	11.70	11.70	
<b>Totals for Invoice:</b>					<b>4,220.84</b>	<b>8,426.56</b>	<b>0.00</b>	<b>12,647.40</b>
					<b>5.00</b>	<b>0.00</b>	<b>342.94</b>	<b>12,995.34</b>

Invoice: 010709, Posted On: 08/03/2018, SW: Posey, Bo

Odometer in: 95,377 Odometer Out: 95,378

Time Description	Part No.	Category	Technician	Qty	Sale	Extd	Price	Rate
8.00 Symptoms - A/C unit install: Modify roof, Install rooftop a/c unit, Install inner roof panel. Wire A/C unit. Install and wire 2000w inverter.			Alex B.	8.00	1,000.00	1,000.00	125.00	
- 12 volt rooftop A/C Unit	Mach 8 Cub		Alex B.	1.00	1,441.26	1,441.26	1,231.85	

# Customer and Vehicle Report

Print Date: 06/01/2022

## Vehicle: 1987 Land Rover - Defender 110

Average Daily Mileage: 26

Invoice: 010709, Posted On: 08/03/2018, SW: Posey, Bo

Odometer in: 95,377 Odometer Out: 95,378

Time Description	Part No.	Category	Technician	Qty	Sale	Extd	Price	Rate
- 3000 watt inverter	Novopal 3000w		Alex B.	1.00	519.98	519.98	480.98	
- Deluxe ceiling Panel	9430D715			1.00	136.13	136.13	136.13	
2.00 <b>Symptoms</b> - Perform alternator upgrade for inverter: Install 120 amp alternator, upgrade power wire for alternator.				2.00	250.00	250.00		125.00
- 120 amp alternator	YLE10113			1.00	404.58	404.58	404.58	
- V-belt	7400			1.00	32.36	32.36	32.36	
4.00 <b>Symptoms</b> - Need to install second alternator.: Make alternator mount. Install second alternator. Wire alternator to vehicle.				4.00	500.00	500.00		125.00
- 140Amp alternator	578021			1.00	349.63	349.63	349.63	
<b>Totals for Invoice:</b>					5.00		234.32	4,873.26

Invoice: 010671, Posted On: 06/14/2018, SW: Posey, Bo

Odometer in: 95,140 Odometer Out: 95,142

Time Description	Part No.	Category	Technician	Qty	Sale	Extd	Price	Rate
- Shipping Fedex					200.00	200.00		
2.50 Installed bumper				2.50	312.50	312.50		125.00
1.00 <b>Symptoms</b> - Installation of side steps: Mounted side steps to vehicle.				1.00	125.00	125.00		125.00
<b>Totals for Invoice:</b>					0.00		0.00	637.50

Invoice: 010627, Posted On: 05/25/2018, SW: Posey, Bo

Odometer in: 94,968 Odometer Out: 94,969

Time Description	Part No.	Category	Technician	Qty	Sale	Extd	Price	Rate
0.40 Lube, oil, and filter, Up to 5 quarts Lubricate and check chassis. Change oil and oil filter. Check air filter and breather filter. Check all fluid levels and tire pressures.		Lube Oil Filter	Alex B.	0.40	50.00	50.00		125.00
- Oil Filter OEM	078 115 561J		Alex B.	1.00	20.18	20.18	20.18	
- Motor Oil 15W-40 Diesel - 1 Qt	88865910		Alex B.	8.00	9.36	74.88	9.36	

# Customer and Vehicle Report

Print Date: 06/01/2022

Vehicle: 1987 Land Rover - Defender 110

Average Daily Mileage: 26

Invoice: 010627, Posted On: 05/25/2018, SW: Posey, Bo

Odometer in: 94,968 Odometer Out: 94,969

Time Description	Part No.	Category	Technician	Qty	Sale	Extd	Price	Rate
- Rear step bumper	RNB065		Alex B.	1.00	900.00	900.00	1,332.00	
- Side Steps	PLB110		Alex B.	1.00	525.00	525.00	777.00	
<b>Totals for Invoice:</b>								
					1,520.06	1,570.06		
					50.00			
					5.00		123.50	1,698.56

Invoice: 009924, Posted On: 05/12/2017

Odometer in: 0 Odometer Out: 0

Time Description	Part No.	Category	Technician	Qty	Sale	Extd	Price	Rate
- Inspect drivers door latch			Alex B.	0.00	0.00	0.00	125.00	
0.50 <b>Symptoms</b> - Alternator making noise: Inspect alternator fins and bearings.			Alex B.	0.50	62.50	62.50	125.00	
0.50 Replace alternator belt	7390		Alex B.	0.50	62.50	62.50	125.00	
- Belt			Alex B.	1.00	26.26	26.26	26.26	
1.50 <b>Symptoms</b> - Drivers front door not closing at times: Replace drivers door latch			Alex B.	1.50	187.50	187.50	125.00	
- Drivers door latch	PLI788		Alex B.	1.00	123.80	123.80	123.80	
<b>Totals for Invoice:</b>								
					150.06	462.56		
					312.50			
					0.00		12.94	475.50

Invoice: 009832, Posted On: 03/27/2017

Odometer in: 92,060 Odometer Out: 92,062

Time Description	Part No.	Category	Technician	Qty	Sale	Extd	Price	Rate
<b>Notes</b> - Notes: Vehicle will not roll								
1.00 Diagnostic time				1.00	125.00	125.00	91.56	
<b>Notes</b> - Notes: Vehicle was towed to shop								
1.00 TOWING				1.00	68.00	68.00	91.56	
<b>Notes</b> - Notes: Install Engine to frame ground and frame to battery ground								
1.50 Installed ground cables				1.50	187.50	187.50	91.56	
- Ground cable	03333			2.00	19.32	38.64	19.32	
<b>Notes</b> - Notes: Replace Park brake cable, Replace park brake shoes								
2.50 Replace park brake cable and shoes				2.50	312.50	312.50	91.56	
- Park Brake cable	NRC5089			1.00	115.17	115.17	115.17	

**Customer and Vehicle Report**

Print Date: 06/01/2022

**Vehicle: 1987 Land Rover - Defender 110**

Average Daily Mileage: 26

Invoice: 009832, Posted On: 03/27/2017

Odometer in: 92,060 Odometer Out: 92,062

Time Description	Part No.	Category	Technician	Qty	Sale	Extd	Price	Rate
- Park Brake shoes	RND446			1.00	136.24	136.24	136.24	
<b>Totals for Invoice:</b>								
		<b>Parts</b>	<b>Discount</b>	<b>Subtotal</b>	<b>Haz Mat</b>	<b>Supplies</b>	<b>Tax</b>	<b>Total</b>
		290.05	0.00	983.05	0.00	0.00	23.93	1,006.98

<b>Totals for Owner:</b>				<b>Subtotal</b>	<b>Haz Mat</b>	<b>Supplies</b>	<b>Tax</b>	<b>Total</b>
		9,287.89	12,324.56	21,612.45	15.00	0.00	756.02	22,383.47

# METRIC MOTORS

19674 8TH ST EAST unit 1  
SONOMA, CA. 95476  
(707) 996-4870  
Writer: BO POSEY




# INVOICE #1247

metricmotorsauto@gmail.com  
METRICMOTORSAUTO@GMAIL.COM  
BAR# ARD00286708

CUSTOMER:	YEAR: 1987	TRANS/DRIVE: /
SONOMA, CA. 95476	MAKE/MODEL: LAND ROVER	LICENSE/STATE: /
Home: (541) 338-4138	VIN: SALLDHMB8BA297441	MILES IN/MILES 101261/101261
	ENGINE: L CYL	

In: 10/1/2019 Out: 10/2/2019 Email: nigel@bohohwy.com

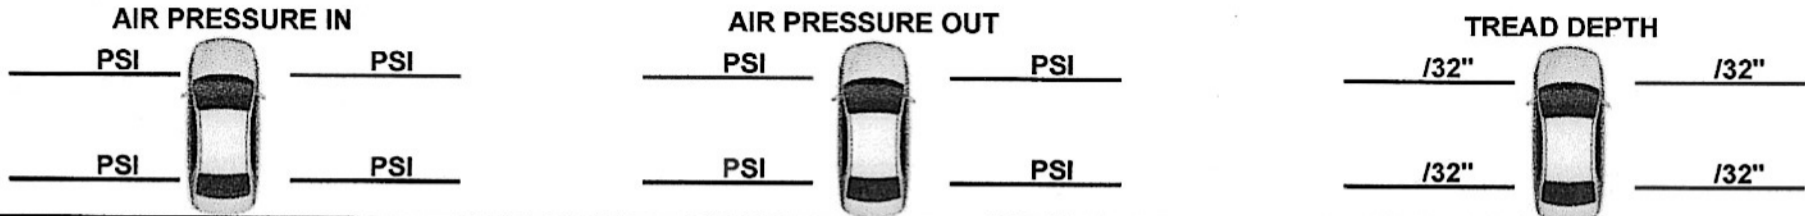

<b>VEHICLE ISSUE #1: REAR BRAKES</b>				
TECH REPORT: REPLACED REAR BRAKE SHOES AND DRUMS.				
PART: 576973	BRAKE DRUM	2 @ \$121.39	\$242.78	NEW
PART: STC2797G	BRAKE SHOE KIT	1 @ \$169.90	\$169.90	NEW
LABOR:	REPLACE REAR BRAKE SHOES AND DRUMS		\$285.60	LABOR
			HAZARDOUS WASTE: \$1.50	
Payment Rec'd	VISA	Date: 10/2/2019	\$733.83	

Recommended Repairs:	Labor/Jobs	\$285.60
	Parts	\$412.68
Warranty: From the date of delivery for a period of 36 months or 36000 miles, whichever comes first, this firm will repair free of charge any defects in material and workmanship to the repairs stated on the invoice. All work to be done in our shop only. This does not include towing charges or customer supplied parts. A storage fee of 125.00 per day will be charged 24 hours after notification that work is complete. Neglect/abuse of vehicle will immediately void any and all warranties.	Sublet	\$0.00
	Total Fees	\$1.50
	Subtotal	\$699.78
	Tax @ 8.25%	\$34.05
	Total	\$733.83
	Payments	\$733.83
	Balance	\$0.00

Replaced parts may be requested by customer. I hereby authorize the above repair work to be done along with all necessary materials. You and your employees may operate the above vehicle for the purposes of testing, inspection or delivery at my risk. An express mechanic's lien is acknowledged on the above vehicle to secure the amount of repairs thereto. The shop will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. In the event legal action is necessary to enforce this contract, I understand that I am solely responsible for all costs including attorney's fees and court costs. I have read the above and acknowledge receipt of an estimate.

# METRIC MOTORS

19674 8TH ST EAST unit 1  
SONOMA, CA. 95476  
(707) 996-4870  
Writer: MIGUEL MACIAS




# ESTIMATE #3564

metricmotorsauto@gmail.com  
METRICMOTORSAUTO@GMAIL.COM  
BAR# ARD00286708

CUSTOMER:	YEAR: 1987	TRANS/DRIVE: AUTO/4WD
SONOMA, CA. 95476	MAKE/MODEL: LAND ROVER DEFENDER	LICENSE/STATE: 53577D3/CA
Home: ( )	VIN: SALLDHMB8BA297441	MILES IN/MILES 111352/
	ENGINE: 3.9L 8cyl	

In: 2/3/2022 Out: 2/3/2022 Email: nigel@bohohwy.com

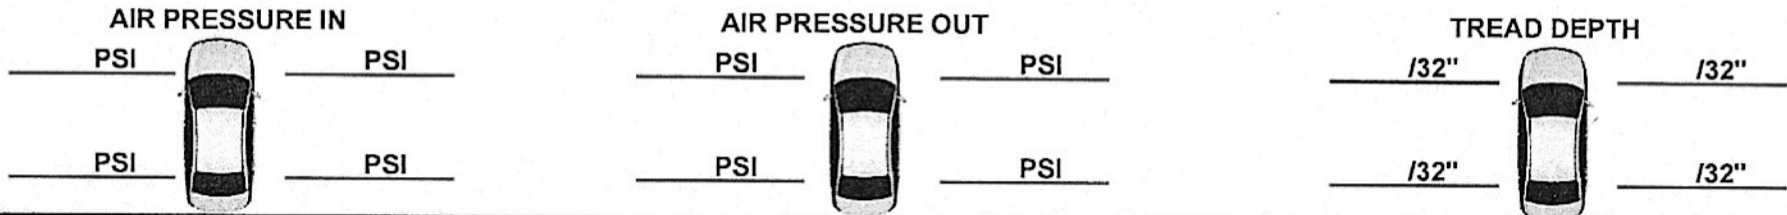

VEHICLE ISSUE #1: SERVICE				
PART: 078 115 561J	OIL FILTER SPIN-ON	1 @ \$15.33	\$15.33	NEW
PART: 5W-30B	SYNTHETIC BLEND OIL	6.5 @ \$10.95	\$71.17	NEW
LABOR:	OIL SERVICE		\$50.00	LABOR
VEHICLE ISSUE #2: ENGINE NOT RUNNING CORRECTLY.				
TECH REPORT: FOUND SEVERAL CYLINDERS NOT RUNNING. FOUND SPARK PLUG WIRES CORRODED AT COILS. REPLACED SPARK PLUG WIRES AND FOUND ENGINE STILL NOT RUNNING CORRECTLY. FOUND SEVERAL INJECTORS NOT INJECTOR FUEL. FOUND ECM IS NOT TELLING THE INJECTORS TO OPEN. SENT ECM OUT FOR TESTING.				
PART: HLS 102	IGNITION WIRE SET	1 @ \$94.68	\$94.68	NEW
SUBLET	ECM REPAIR		\$500.00	SUBLET
VEHICLE ISSUE #3: DOOR LATCH				
PART: MTC90203	LEFT REAR DOOR LATCH	1 @ \$157.50	\$157.50	NEW
LABOR:	REPLACE LEFT REAR DOOR LATCH		\$165.00	LABOR
VEHICLE ISSUE #4: TRANSFER CASE LEAKING OIL				
PART: RTC3890G	TRANSFER CASE GASKET KIT	1 @ \$44.89	\$44.89	NEW
PART: 105787	GEAR OIL GEARBOX 80W90 1L	3 @ \$23.92	\$71.75	NEW
LABOR:	TRANSFER CASE, R&R, ALL MODELS		\$1,514.70	LABOR
VEHICLE ISSUE #5: TRANSMISSION COOLER LINES LEAKING FLUID				
PART: ESR4219	TRANSMISSION COOLER LINE	1 @ \$314.50	\$314.50	NEW
PART: ESR4218G	TRANSMISSION COOLER LINE	1 @ \$351.50	\$351.50	NEW
PART: 88865544	AUTO TRANS FLUID DEXRON III (H) 1 QT.	1 @ \$13.33	\$13.33	NEW
LABOR:	REPLACE TRANSMISSION COOLER LINES		\$336.60	LABOR
VEHICLE ISSUE #6: POWER STEERING LINES LEAKING				
PART: ANR 5782	P/S RESERVOIR LINE HOSE	1 @ \$140.96	\$140.96	NEW

Recommended Repairs:	Labor/Jobs	\$3,393.89
	Parts	\$1,585.86
Warranty: From the date of delivery for a period of [36] months or [36,000] miles, whichever comes first, this firm will repair free of charge any defects in material and workmanship to the repairs stated on the invoice. All work to be done in our shop only. This does not include towing charges or customer supplied parts. A storage fee of [125.00] per day will be charged 24 hours after notification that work is complete. Neglect/abuse of vehicle will immediately void any and all warranties. Used parts are warranty for 6 months 6,000 miles. Warranty is not transferable for purchasing customer only.	Sublet	\$500.00
	Total Fees	\$1.50
	Subtotal	\$5,481.25
	Tax @ 8.5%	\$134.80
	Total	\$5,616.05
	Payments	\$0.00
	Balance	\$5,616.05

Replaced parts may be requested by customer. I hereby authorize the above repair work to be done along with all necessary materials. You and your employees may operate the above vehicle for the purposes of testing, inspection or delivery at my risk. An express mechanic's lien is acknowledged on the above vehicle to secure the amount of repairs thereto. The shop will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. In the event legal action is necessary to enforce this contract, I understand that I am solely responsible for all costs including attorney's fees and court costs. I have read the above and acknowledge receipt of an estimate. Estimate prices are valid for 30 days.

**METRIC MOTORS**

19674 8TH ST EAST unit 1  
 SONOMA, CA. 95476  
 (707) 996-4870  
 Writer: MIGUEL MACIAS



**ESTIMATE #3564**

metricmotorsauto@gmail.com  
 METRICMOTORSAUTO@GMAIL.COM  
 BAR# ARD00286708

CUSTOMER:	YEAR: 1987	TRANS/DRIVE: auto/4wd
SONOMA, CA. 95476	MAKE/MODEL: Land Rover defender	LICENSE/STATE: 53577D3/CA
Home: (	VIN: SALLDHMB8BA297441	MILES IN/OUT: 111352
8	ENGINE: 3.9L 8cyl	

PART: QEH102380	POWER STEERING HOSE	1 @ \$132.64	\$132.64	NEW
PART: 88865549	AUTO TRANS FLUID DEXRON VI / 1 QUART	1 @ \$15.08	\$15.08	NEW
LABOR:	P/S SUPPLY HOSE, R&R, DISCOVERY		\$201.96	LABOR
LABOR:	RESERVOIR, R&R, DEFENDER		\$99.00	LABOR
VEHICLE ISSUE #7: RIGHT FRONT HUB SEAL LEAKING OIL				
PART: STC3321G	SWIVEL BALL SEAL KIT	1 @ \$103.43	\$103.43	NEW
PART: STC 3435	STEERING SWIVEL LUBE	1 @ \$28.17	\$28.17	NEW
LABOR:	RIGHT FRONT SWIVEL BALL RESEAL		\$673.20	LABOR
VEHICLE ISSUE #8: FOUND ENGINE OIL PAN LEAKING				
PART: 29208	GASKET MAKER THE RIGHT STUFF 5OZ	1 @ \$30.94	\$30.94	NEW
LABOR:	OIL PAN GASKET, R&R, DEFENDER, 4.0L		\$353.43	LABOR
			HAZARDOUS WASTE: \$1.50	

Recommended Repairs:	Labor/Jobs	\$3,393.89
	Parts	\$1,585.86
Warranty: From the date of delivery for a period of [36] months or [36,000] miles, whichever comes first, this firm will repair free of charge any defects in material and workmanship to the repairs stated on the invoice. All work to be done in our shop only. This does not include towing charges or customer supplied parts. A storage fee of [125.00] per day will be charged 24 hours after notification that work is complete. Neglect/abuse of vehicle will immediately void any and all warranties. Used parts are warranty for 6 months 6,000 miles. Warranty is not transferable for purchasing customer only.	Sublet	\$500.00
	Total Fees	\$1.50
	Subtotal	\$5,481.25
	Tax @ 8.5%	\$134.80
	Total	\$5,616.05
	Payments	\$0.00
	Balance	\$5,616.05

Replaced parts may be requested by customer. I hereby authorize the above repair work to be done along with all necessary materials. You and your employees may operate the above vehicle for the purposes of testing, inspection or delivery at my risk. An express mechanic's lien is acknowledged on the above vehicle to secure the amount of repairs thereto. The shop will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. In the event legal action is necessary to enforce this contract, I understand that I am solely responsible for all costs including attorney's fees and court costs. I have read the above and acknowledge receipt of an estimate. Estimate prices are valid for 30 days.

**IMPORTATION  
DOCUMENTATION**



[Print](#) | [Close Window](#)

**Subject:** Fwd: 110 Defender

**From:** [redacted] <[redacted]@olf.com>

**Date:** Tue, Aug 22, 2017 8:10 am

**To:** [redacted] <[redacted]@m>

**Attach:** 117082216064101823.png

ATT00001.htm

doc31927520170822150210.pdf

ATT00002.htm

Georgie!

Sent from my iPhone

Begin forwarded message:

**From:** [redacted] <[redacted]@group.co.uk>  
**Date:** August 22, 2017 at 8:06:34 AM PDT  
**To:** "ric" <[redacted]@olf.com>  
**Subject:** 110 Defender

Have attached the front sheet from the Land Rover warranty site. Chassis number matches ok. Because of the age no records on line but it is a LHD chassis number so presumably built for mainland Europe market. 110 is long wheel base , D4 is 4 cylinder diesel engine. Rovers North are pretty good I remember using them lots of times & they ship all over the country usually overnight. Lots of things wear out on them over time but if it has had the amount of money spent on it that he says everything must have been done. The standard engine is probably the old Land Rover Turbo diesel. Not the most powerful. Im sure if he gets the engine upgraded to a V8 they will probably also upgrade the transmission to an auto. I think it probably will have drum brakes on the rear at this age so an upgrade to discs might be a good idea.

Anything else I can help with let me know.

De Car-Pass staat garant voor de juiste kilometerstand.

**Nummer certificaat:** 3214-2383-5313

**Chassisnummer**  
SALLDHMB8BA297441

**Merk/Model**

**Prijs (incl. BTW)**  
0.00 EUR

**Eerste ingebruikname**  
26/06/1987

**Eerste inschrijving in België**

**Geldig tot**  
10/12/2012

**Datum**  
10/10/2012

**Km-stand**  
85678

**Datum**

**Km-stand**

**Datum**

**Km-stand**

Over de periode van datum eerste ingebruikname tot datum oudste km stand zijn geen gegevens bekend.

A. Inschrijvingsnummer

10YE771

B. Datum 1ste inschrijving

26/06/1987

B.1. Bouwjaar

\*\*\*\*\*

I. Datum laatste inschrijving

14/11/2012

I.1. Status en uitgiftedatum: **Origineel van 14/11/2012**Afzender: **DIV City Atrium - Vooruitgangstraat 56, 1210 Brussel****C. Identificatie van de houder**

C1.1. + C1.2. Naam

Thonissenlaan 19 0002

3500 Hasselt



C.4. c) Dit certificaat is geen eigendomsbewijs van het voertuig

C.9. Identificatie houder: **7001528627**

KBO nr van houder: \*\*\*\*\*

Z.1. Nationaal codenummer verzekeringsmaatschappij: **00051****Identificatie van het voertuig en technische kenmerken**D.1. Merk: **LANDROVER**D.3. **LAND-ROVER 110**

D.2.1. Fabrikstype: \*\*\*\*\*

D.2.2. Variant: \*\*\*\*\*

D.2.3. Versie: \*\*\*\*\*

E. VIN: **SALLDHMB8BA297441(01)**E.1. Code: **221**

F.1. Tech. toelaatbare maximummassa: \*\*\*\*\* kg

F.2. Nationale toelaatbare maximummassa: \*\*\*\*\* kg

G. Massa in rijklare toestand: \*\*\*\*\* kg

J. Voertuigcategorie: \*\*\*

J.1. Nationale Aard: **AUTO DUBBEL GEBRUIK**

J.2. Koetswerktype: \*\*\*\*\*

K. WVTA: \*\*\*\*\*

K.1. Belg.referentienr.: **834026**P.1. Motorinhoud: **2478 cm<sup>3</sup>**

P.2. Motorvermogen: \*\*\*\*\* kW

P.3. Brandstof: **DIESEL**

Q. Verhouding vermogen/gewicht: \*\*\*\*\* kW/kg

R. Kleur: **Onbekend**

S.1. Zitplaatsen bestuurder inbegrepen: \*\*\*

S.2. Staanplaatsen: \*\*\*

T. Maximum snelheid: \*\*\* km/h

V.7. CO2-uitstoot: \*\*\* g/km

V.9. Milieuklasse: \*\*\*\*\*

**Kenmerken van de inschrijving**Inschrijving onder kentekenplaat **Oldtimer**

Plaat toegekend op 14/11/2012

**403522209**

Adreswijziging

\*\*

\*\*\*\*\*

\*\*\*\*\*

\*\*\*\*\*



## Directe Dealer Garantie - Voertuiggegevens

### Basisgegevens

<b>VIN:</b>	LDHMB8BA 297441	<b>Kenteken:</b>	
<b>Beschrijving:</b>	LR 110 S.W. TURBO PRE 1995 model year MY		
<b>Verzonden op:</b>	12-Jun-1987	<b>CSO- nummer:</b>	297441
<b>Verkocht op:</b>	26-Jun-1987	<b>Verkocht door:</b>	Z9999 - LAND ROVER WARRANTY
<b>Lak:</b>	Geen beschrijving gevonden	<b>Kleur van bekleding:</b>	

### Garantie

### Open campagnes

#### Code FSA

A255 WHITE ROGERS LIER-KIT SOLENOIDE,  
MOGELIJKE OVERVERHITTING P

#### Bericht

This campaign only affects those vehicles fitted with WARN winch part number LRN50900.

**Campagne  
is al  
geclaimt**

### Eigenaar/bestuurder gegevens

### Verwijzingen naar garantieclaims

### Voorzieningen

### Gegevens bekleding

### Serienummers

### Aftermarket Fits - (Vehicle)



LAND ROVER HASSELT

Herckenrodesingel 39 - 3500 HASSELT  
Tel. 011/85.09.60 - Fax 011/87.41.69  
BTW BE 459 346 369  
KBC 455-7203401-35 • Fortis 001-4692435-39

*Handwritten signature*



BY APPOINTMENT  
TO HER MAJESTY THE QUEEN  
MANUFACTURERS OF  
LAND ROVER VEHICLES  
LAND ROVER, WARWICK



BY APPOINTMENT  
TO HRH THE DUKE OF EDINBURGH  
MANUFACTURERS OF  
LAND ROVER VEHICLES  
LAND ROVER, WARWICK



BY APPOINTMENT  
TO HRH THE PRINCE OF WALES  
MANUFACTURERS OF  
LAND ROVER VEHICLES  
LAND ROVER, WARWICK

**RANGE  
ROVER**



**CERTIFICAT DE CONFORMITE / GELIJKVORMIGHEIDSATTEST**

*Je soussigné / De ondergetekende (1) :*

*atteste que le véhicule / bevestigt dat het voertuig :*

- 1. *Genre / Aard :* *Voiture mixte/auto dubbel gebruik*
- 2. *Marque / Merk :* *LANDROVER*
- 3. *Type :* *110D4*
- 4. *Numéro de châssis / Chassisnummer :* *SALLDHMB8BA297441*

*est entièrement conforme au type décrit dans la notice descriptive figurant dans la demande d'agrément, identifié par le Ministère des Communications et faisant l'objet du procès-verbal numéro :*

*overeenstemt met het type beschreven in de in de aanvraag om goedkeuring voorkomende beschrijving, geïdentificeerd door het Ministerie van Verkeerswezen en opgenomen in het proces-verbaal van goedkeuring nummer :*

*No P.V.A. / P.V.G. Nr :* *83/4026*

*Fait à / Gedaan te 1082 Bruxelles / Brussel, le / op:* *26/06/1987*

*Duplicata délivré le / duplikaat afgeleverd op :* *07/05/2012*

Land Rover Belux nv/sa  
Hunderenveldlaan 10  
1082 Brussel  
Tel. 02 709 79 79  
BTW/TVA BE 444 831 508

*Signature / Handtekening :*

*(1) Seules les personnes autorisées par le Constructeur ou son mandataire sont habilitées à signer le présent document.*

*Slechts de personen gemachtigd door de Constructeur of zijn mandataris zijn bevoegd om dit dokument te onderteken.*

LAND ROVER BELUX NV/SA  
Avenue du Hunderenveldlaan 10  
B-1082 Brussel  
Tel +32 2 709 79 79  
Fax +32 2 709 79 80  
www.landrover.be

Vorbesitzer

~~Am 1. August 1978~~

~~zurückgegeben~~



# Verkoopovereenkomst tussen particulieren

Aankoopdatum: 01 / 04 / 13

Leveringsdatum van het voertuig: 29 / 06 / 13

<b>VERKOPER</b>	
Naam: E	Voornaam: J N
Adres: THOMAS	HASSELT - BELGIUM
Telefoon: .....	

<b>KOPER</b>	
Naam: HA	Voornaam: .....
Adres: WOODLAND HILLS, CA 91367 LOS ANGELES U.S.A.	
Telefoon: .....	

<b>VOERTUIG</b>	
Merk: LAND-ROVER	Type: DEFENDER 110 TD
Kleur: WHITE	Bouwjaar: 26/06/1987
Cilinderinhoud: 2500 CC	Motorvermogen: 63 kW
Chassisnummer: [S][A][L][L][D][H][M][B][8][B][A][2][9][7][4][4][1]	
Datum van eerste inverkeerstelling: 26 / 06 / 1987	
Kilometerstand bij de verkoop: 86.216 MLS	
<b>Het voertuig wordt verkocht in de staat waarin het zich bevindt. Deze staat is door de koper gekend en goedgekeurd.</b>	

### Meegeleverde documenten (aankruisen wat van toepassing is)

- Gelijkvormigheidsattest
- Aanvraag tot inschrijving van een tweedehandsvoertuig
- CAR-PASS
- Inschrijvingsbewijs
- Laatste keuringsbewijs
- Onderhoudsboekje

### Eventuele schade & opties

BULL BAR - external lights - NAS pack - Alu wheels - Bin leather interior  
New ipod interface radio



Verkoopprijs (in letters): FORTY THOUSAND USD (\$ 40.000)

GEDAAN te: HASSELT op 01 / 04 / 13' in 2 exemplaren

Voor akkoord,  
De koper

De verkoper

(handtekeningen)

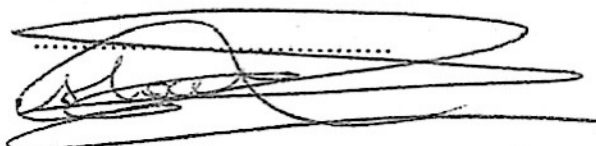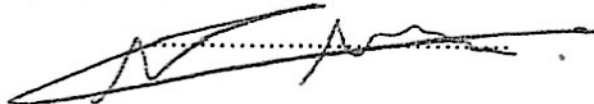



**MEDITERRANEAN SHIPPING COMPANY S.A.**

Website: www.msogva.ch

SCAC Code: MSCU

**SEA WAYBILL No.**

**MSCUAV353360**

**DRAFT**

"Port-To-Port" or "Combined Transport" (see Clause 1)

NO. & SEQUENCE OF SEA WAYBILLS

NO. OF RIDER PAGES  
**0 Zero**

SHIPPER:  
C  
10  
**1070 BRUXELLES**

CARRIER'S AGENTS ENDORSEMENTS: (Include Agent(s) at POD)

SHIPPER'S LOAD, COUNT AND SEALED  
FCLFCL

Lloyds/IMO Number: 9292149  
HOUSE/HOUSE

SHIPPER DECLARES THAT ANY APPLICABLE WOOD PACKAGING MATERIALS COMPLY WITH ISPM15 REGULATIONS. FAILURE TO COMPLY WILL RESULT IN CONTAINERS BEING RETURNED TO LOAD PORT OR CARGO DESTROYED - ALL COSTS / FINES/PENALTIES WILL BE FOR SHIPPERS ACCOUNTS  
SHIPPER'S LOAD, STOW AND COUNT

CONSIGNEE:  
1  
**LOS ANGELES**

NOTIFY PARTIES: (No responsibility shall attach to Carrier or to his Agent for failure to notify - see Clause 20)

OP

**1045 SARAH ST  
PHILADELPHIA, PA 19125**

PORT OF DISCHARGE AGENT:

**MEDITERRANEAN SHIPPING COMPANY  
(USA) INC. 420, 5TH AVENUE (AT 37TH  
STREET)  
8TH FLOOR  
New York, NY 10018**



VESSEL AND VOYAGE NO. (see Clause 8 & 9)

**HS LIVINGSTONE - NU326A**

PORT OF LOADING

**ANTWERPEN**

PLACE OF RECEIPT: (Combined Transport ONLY - see Clauses 1 & 5.2)

XXXXXXXXXXXXXXXXXXXX

BOOKING REF. (or)

SHIPPER'S REF.

**213B0041793**

XXXXXXXXXXXXXXXXXXXX

PORT OF DISCHARGE

**NEW YORK**

PLACE OF DELIVERY: (Combined Transport ONLY - see Clauses 1 & 5.2)

XXXXXXXXXXXXXXXXXXXX

**PARTICULARS FURNISHED BY THE SHIPPER - NOT CHECKED BY CARRIER - CARRIER NOT RESPONSIBLE (see Clause 14)**

Container Numbers, Seal Numbers and Marks	Description of Packages and Goods (Continued on attached Bill of Lading Rider page(s), if applicable)	Gross Cargo Weight	Measurement
FSCU6117971 40' High Cube  Seal Number: 0544117	1 Unit(s) , CAR, LAND ROVER DEFENDER 110 TD CHASSIS: SALLDHMB8BA297441  EXPRESS BILL OF LADING Total Items: 1 PARTLOAD 2/2 FREIGHT PREPAID SHIPPED ON BOARD	2,950.000kgs.	
		<b>Total :</b> 2,950.000kgs.	

**FREIGHT & CHARGES** Cargo shall not be delivered unless Freight & Charges are paid (see Clause 16)

FREIGHT & CHARGES	BASIS	RATE	PREPAID	COLLECT

RECEIVED by the Carrier from the Shipper in apparent good order and condition unless otherwise stated herein the total number or quantity of containers or other packages or units indicated in box entitled "Carrier's Receipt" for carriage subject to all the terms hereof from the Place of Receipt or the Port of Loading, to the Port of Discharge or Place of Delivery, whichever is applicable. IN ACCEPTING THIS SEA WAYBILL THE SHIPPER EXPRESSLY ACCEPTS AND AGREES TO, ON HIS OWN BEHALF AND ON BEHALF OF THE CONSIGNEE, THE OWNER OF GOODS AND THE MERCHANT, AND WARRANTS HE HAS AUTHORITY TO DO SO, ALL THE TERMS AND CONDITIONS WHETHER PRINTED, STAMPED OR OTHERWISE INCORPORATED ON THIS SIDE AND ON THE REVERSE SIDE AND TERMS AND CONDITIONS OF THE CARRIER'S APPLICABLE TARIFF AS IF THEY WERE ALL SIGNED BY THE SHIPPER.

Unless instructed otherwise in writing by the Shipper delivery of the Goods will be made only to the Consignee or his authorized representatives. This Sea Waybill is not a document of title to the Goods and delivery will be made, after payment of any outstanding Freight and charges, only on provision of proper proof of identity and of authorization at the Port of Discharge or Place of Delivery, as appropriate, without the need to produce or surrender a copy of this Sea Waybill.

IN WITNESS WHEREOF the Carrier, Master or their Agent has signed this Sea Waybill.

DECLARED VALUE (Only applicable if Ad Valorem charges paid - see Clause 7.3)

XXXXXXXXXXXXXXXXXXXX

CARRIER'S RECEIPT (No. of Cntrs or Pkgs rcvd by Carrier - see Clause 14.1)

**1 cntr**

SIGNED on behalf of the Carrier MSC Mediterranean Shipping Company S.A. by **MSC BELGIUM N.V.** As Agent

PLACE AND DATE OF ISSUE

**ANTWRP RF**

SHIPPED ON BOARD DATE



# Verkoopovereenkomst tussen particulieren

Aankoopdatum: 01/04/13'

Leveringsdatum van het voertuig: 07/07/13'

<b>VERKOPER</b>	
Naam:	Voornaam:
Adres: THONISSENLAAN 19 - 3500 HASSELT - BELGIUM	
Telefoon: .....	

<b>KOPER</b>	
Naam:	Voornaam:
Adr: WOODLAND HILLS, CA 91367 LOS ANGELES U.S.A.	
Telefoon: .....	

<b>VOERTUIG</b>	
Merk: LAND-ROVER	Type: DEFENDER 110 TD
Kleur: WHITE	Bouwjaar: 26/06/1987
Cilinderinhoud: 2500 CC	Motorvermogen: 63 kW
Chassisnummer: [S][A][L][L][D][H][M][B][8][B][A][2][9][7][4][4][1]	
Datum van eerste inkeerstelling: 26 / 06 / 1987	
Kilometerstand bij de verkoop: 86.216 MLS	
Het voertuig wordt verkocht in de staat waarin het zich bevindt. Deze staat is door de koper gekend en goedgekeurd.	

### Meegeleverde documenten (aankruisen wat van toepassing is)

- Gelijkvormigheidsattest
- Aanvraag tot inschrijving van een tweedehandsvoertuig
- CAR-PASS
- Inschrijvingsbewijs
- Laatste keuringsbewijs
- Onderhoudsboekje

### Eventuele schade & opties

- \* Bullbar
- \* External lights
- \* Nas spec.
- \* ALU wheels
- \* Bio leather interior
- \* Radio CD


Verkoopprijs (in letters): Dertig duizend zeshonderd euro (30.600,00 €)


GEDAAN te: HASSELT op 01/04/13' in 2 exemplaren

Voor akkoord,  
De koper

De verkoper

(handtekeningen)

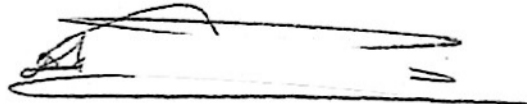

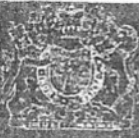

**RANGE  
ROVER**



**CERTIFICAT DE CONFORMITE / GELIJKVORMIGHEIDSATTEST**

*Je soussigné / De ondergetekende (1) : ALEX VOORHELST*

*atteste que le véhicule / bevestigt dat het voertuig :*

- |  |  |
|--|--|
| 1. Genre / Aard :                      | <i>Voiture mixte/auto dubbel gebruik</i> |
| 2. Marque / Merk :                     | <b>LANDROVER</b>                         |
| 3. Type :                              | <b>110D4</b>                             |
| 4. Numéro de châssis / Chassisnummer : | <b>SALLDHMB8BA297441</b>                 |

*est entièrement conforme au type décrit dans la notice descriptive figurant dans la demande d'agrément, identifié par le Ministère des Communications et faisant l'objet du procès-verbal numéro :*

*overeenstemt met het type beschreven in de in de aanvraag om goedkeuring voorkomende beschrijving, geïdentificeerd door het Ministerie van Verkeerswezen en opgenomen in het proces-verbaal van goedkeuring nummer :*

**No P.V.A. / P.V.G. Nr :** 83/4026

**Fait à / Gedaan te 1082 Bruxelles / Brussel, le / op:** 26/06/1987

**Duplicata délivré le / duplicaat afgeleverd op :** 07/05/2012

Land Rover Belux nv/sa  
Hunderenveldlaan 10  
1082 Brussel  
Tel. 02 709 79 79  
BTW/TVA BE 444 831 508

**Signature / Handtekening :**

*(1) Seules les personnes autorisées par le Constructeur ou son mandataire sont habilitées à signer le présent document.*

*Slechts de personen gemachtigd door de Constructeur of zijn mandataris zijn bevoegd om dit dokument te onderteken.*

**LAND ROVER BELUX NV/SA**  
Avenue du Hunderenveldlaan 10  
B-1082 Brussel  
Tel +32 2 709 79 79  
Fax +32 2 709 79 80  
www.landrover.be

## Verkoopovereenkomst tussen particulieren

Aankoopdatum: 01/04/13

Leveringsdatum van het voertuig: 20/04/13

### VERKOPER

Naam: ..... Voornaam: T .....  
Adres: ..... 19 .....  
..... B-35 .....  
Telefoon: 0477725321 ..... Nummer identiteitskaart: .....  
Land van uitgifte: België .....

### KOPER

Naam: N ..... Voornaam: L .....  
Adres: ..... 65 B .....  
.....  
Telefoon: 04 ..... Nummer identiteitskaart: 591-0119709-76 .....  
Land van uitgifte: .....

### VOERTUIG

Merk: Land-Rover ..... Type: Defender .....  
Kleur: wit ..... Bouwjaar: 26-06-1987 .....  
Cilinderinhoud: 2498 CC ..... Motorvermogen: 63 kW .....  
Chassisnummer: [5][A][L][L][D][H][M][B][8][B][A][2][5][7][4][4][1]

Datum van eerste inkeerstelling: 26/06/1987 (zie inschrijvingsbewijs)

Kilometerstand bij de verkoop: 86.000 MLK (zie CAR-PASS)

Het voertuig wordt verkocht in de staat waarin het zich bevindt. Deze staat is door de koper gekend en goedgekeurd.

### Meegedeleverde documenten (aankruisen wat van toepassing is)


- Gelijkvormigheidsattest
- Aanvraag tot inschrijving van een tweedehandsvoertuig
- CAR-PASS (kilometerstand)  
nr. [ ] [ ] [ ] [ ] - [ ] [ ] [ ] [ ] - [ ] [ ] [ ] [ ]
- Inschrijvingsbewijs (roze kaart)  
nr. [ ] [ ] [ ] [ ] - [ ] [ ] [ ] [ ] - [ ] [ ] [ ] [ ]
- Laatste keuringsbewijs
- Onderhoudsboekje

### Eventuele schade & opties


Bullbar, Roof rack, ALU velgen zwart, BF Goodrich AT (5)  
Radio - cd - ipod, sunroof, 10 seats

Verkoopprijs (in letters): five thousand euro  
GEDAAN te: MASSELT op 01/04/2013 in 2 exemplaren

Voor akkoord,  
De koper

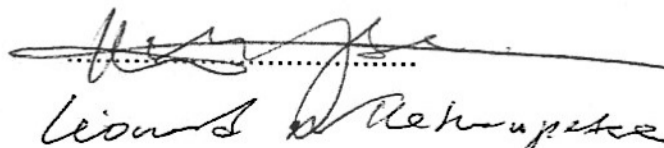 (handtekeningen)  
Leonard W. Reheupke

De verkoper

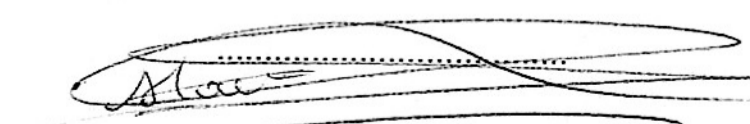  
Jonathan Schraepen

A. Inschrijvingsnummer

10YE771

B. Datum 1ste inschrijving

26/06/1987

B.1. Bouwjaar

\*\*\*\*\*

I. Datum laatste inschrijving

14/11/2012

I.1. Status en uitgiftedatum: Origineel van 14/11/2012

Afzender: DIV City Atrium - Vooruitgangstraat 56, 1210 Brussel

C. Identificatie van de houder

S. n M

C. -

3!



C.4. c) Dit certificaat is geen eigendomsbewijs van het voertuig

C.9. Identificatie houder: 7001528627

KBO nr van houder: \*\*\*\*\*

Z.1. Nationaal codenummer verzekeringsmaatschappij: 00051

## Identificatie van het voertuig en technische kenmerken

D.1. Merk: LANDROVER

D.3. LAND-ROVER 110

D.2.1. Fabrikstype: \*\*\*\*\*

D.2.2. Variant: \*\*\*\*\*

D.2.3. Versie: \*\*\*\*\*

E. VIN: SALLDHMB8BA297441(01)

E.1. Code: 221

F.1. Tech. toelaatbare maximummassa: \*\*\*\*\* kg

F.2. Nationale toelaatbare maximummassa: \*\*\*\*\* kg

G. Massa in rijklare toestand: \*\*\*\*\* kg

J. Voertuigcategorie: \*\*\*

J.1. Nationale Aard: AUTO DUBBEL GEBRUIK

J.2. Koetswerktype: \*\*\*\*\*

K. WVT: \*\*\*\*\*

K.1. Belg.referentienr.: 834026

P.1. Motorinhoud: 2478 cm<sup>3</sup>

P.2. Motorvermogen: \*\*\*\* kW

P.3. Brandstof: DIESEL

Q. Verhouding vermogen/gewicht: \*\*\*\*\* kW/kg

R. Kleur: Onbekend

S.1. Zitplaatsen bestuurder inbegrepen: \*\*\*

S.2. Staanplaatsen: \*\*\*

T. Maximum snelheid: \*\*\* km/h

V.7. CO2-uitstoot: \*\*\* g/km

V.9. Milieuklasse: \*\*\*\*\*



## Kenmerken van de inschrijving

Inschrijving onder kentekenplaat Oldtimer

Plaat toegekend op 14/11/2012

403522209

Adreswijziging

\*\*

\*\*\*\*\*

\*\*\*\*\*

\*\*\*\*\*



## Directe Dealer Garantie - Voertuiggegevens

### Basisgegevens

**VIN:** LDHMB8BA  
297441      **Kenteken:**

**Beschrijving:** LR 110 S.W. TURBO PRE 1995  
model year MY

**Verzonden op:** 12-Jun-1987      **CSO-  
nummer:** 297441

**Verkocht op:** 26-Jun-1987      **Verkocht  
door:** Z9999 - LAND  
ROVER  
WARRANTY

**Lak:** Geen beschrijving  
gevonden      **Kleur van  
bekleding:**

### Garantie

### Open campagnes

#### Code FSA

A255 WHITE ROGERS LIER-KIT SOLENOIDE,  
MOGELIJKE OVERVERHITTING P

#### Bericht

This campaign only affects those vehicles  
fitted with WARN winch part number  
LRN50900.

### Campagne

is al  
geclaimt

### Eigenaar/bestuurder gegevens

### Verwijzingen naar garantieclaims

### Voorzieningen

### Gegevens bekleding

### Serienummers

### Aftermarket Fits - (Vehicle)



LAND ROVER HASSELT

Herckenrodesingel 39 - 3500 HASSELT  
Tel. 011/85.09.60 - Fax 011/87.41.69  
BTW BE 459 346 369  
KBC 455-7203401-35 • Fortis 001 4692435-39

A. Inschrijvingsnummer

10YE771

B. Datum 1ste inschrijving

26/06/1987

B.1. Bouwjaar

\*\*\*\*\*

I. Datum laatste inschrijving

14/11/2012

I.1. Status en uitgiftedatum: Origineel van 14/11/2012

Afzender: DIV City Atrium - V

ssel

C. Identificatie van de houder

C

C

Th

02

C.4. c) Dit certificaat is geen eigendomsbewijs van het voertuig

C.9. Identificatie houder: 7001528627

KBO nr van houder: \*\*\*\*\*

Z.1. Nationaal codenummer verzekeringsmaatschappij: 00051

Identificatie van het voertuig en technische kenmerken

D.1. Merk: LANDROVER	D.3. LAND-ROVER 110
D.2.1. Fabriekstype: *****	
D.2.2. Variant: *****	
D.2.3. Versie: *****	
E. VIN: SALLDHMB8BA297441(01)	E.1. Code: 221
F.1. Tech. toelaatbare maximummassa: ***** kg	F.2. Nationale toelaatbare maximummassa: ***** kg
G. Massa in rijklare toestand: ***** kg	
J. Voertuigcategorie: ***	
J.1. Nationale Aard: AUTO DUBBEL GEBRUIK	
J.2. Koetswerktype: *****	
K. WVTA: *****	K.1. Belg.referentienr.: 834026
P.1. Motorinhoud: 2478 cm <sup>3</sup>	P.2. Motorvermogen: **** kW
	P.3. Brandstof: DIESEL
Q. Verhouding vermogen/gewicht: ***** kW/kg	R. Kleur: Onbekend
S.1. Zitplaatsen bestuurder inbegrepen: ***	S.2. Staanplaatsen: ***
	T. Maximum snelheid: *** km/h
V.7. CO2-uitstoot: *** g/km	V.9. Milieuklasse: *****



Kenmerken van de inschrijving

Inschrijving onder kentekenplaat Oldtimer

Plaat toegekend op 14/11/2012

403522209

418-212-4318760004-852-85210YE771

A.V. Station nr 44  
Industriezone A2 II/7  
3290 Diest-Webbekom  
tel: (078) 05 90 44  
fax: (078) 05 91 44

# KEURINGSBEWIJS

Autokeuring  
Ticketnr 777 4443 44 839001

Te bewaren in het voertuig

uitgereikt op : 10/10/2012

## STAAT VAN HET VOERTUIG

Nummerplaat: **B \*297441** 1ZAG131 Kilometerstand: **85.678** (--) Plaatsen: **5 + 1**  
Chassisnummer: **SALLDHMB8BA297441 / 22** Aard: **Auto dubbel gebruik** SW  
Merk: **LAND ROVER DEFENDER** Gebruik: **Old-timer**  
1e indienstelling: **26/06/1987** Referentiedatum: **10/10**

DIT KEURINGSBEWIJS STEM T OVEREEN MET DE STAAT VAN HET VOERTUIG OP HET OGENBLIK VAN DE KEURING.

### Gebreken nauwlettend in het oog te houden :

ASSEN--bevestiging--Vooraan Links  
OLIEVERLIES EN-OF KOELVLOEISTOFLEK--

Code

214 4  
509 4

### Opmerkingen

Uitgevoerde prestaties Inschrijvingsaanvraag, Verzoek agent, CarPass gratis  
Dit document geldt niet als technische keuring daar de staat van het voertuig niet is nagezien

026 4  
027 4

De DIV levert geen nummerplaat meer af aan het loket. Vlugges en zekere  
inschrijving via uw verzekeraar dankzij WebDIV. Levering door bpost.

GDDA - 15/06/01 - FM820 - FT



BOX # 285

209

Form Approved OMB No. 1551-0021  
EXP. 08-31-2014

DEPARTMENT OF HOMELAND SECURITY  
U.S. Customs and Border Protection

ENTRY SUMMARY

1. Filer Code/Entry No. 814-0209296-9	2. Entry Type 01 ABI/P	3. Summary Date 07/25/2013
4. Surety No. 098	5. Bond Type 8	6. Port Code 4601
7. Entry Date 07/12/2013		11. Import Date 07/08/2013
10. Country of Origin BE		15. Export Date 06/25/2013

8. Importing Carrier MSCU-HS LIVINGSTO-326A	9. Mode of Transport 11
12. B/L or AWB No. MSCUAV353360	13. Manufacturer ID GBCARPLA10BRU
16. I.T. No.	17. I.T. Date
18. Missing Docs NONE	

19 Foreign Port of Lading 42305	20. U.S. Port of Unlading 4601
23. Importer No. 11-298946800	24. Reference No.

21. Location of Goods/G.O. No. F577	22. Consignee No. SAME
--	---------------------------

25. Ultimate Consignee Name and Address  
AI NC.  
203 WES AD  
City HUNTINGTON STATION State NY Zip 11746

26. Importer of Record Name and Address  
AUTOS TIGNS, INC.  
203 WES AD ROAD  
City HUNTINGTON STATION State NY Zip 11746

27. Line No.	28. Description of Merchandise	29. A. HTSUS No. B. ADA/CVD No.	30. A. Grossweight B. Manifest Qty.	31. Net Quantity in HTSUS Units
--------------	--------------------------------	------------------------------------	--	---------------------------------

32. A. Entered Value B. CHGS C. Relationship	33. A. HTSUS Rate B. ADA/CVD Rate C. IRC Rate D. Visa No.	34. Duty and I.R. Tax Dollars Cents
--	--	--

001	1 CTNS INV# 001, 1 CTNS 1987 LANDROVER DEFENDER SALLDHMB8BA297441 PASSG VEH:USED;>1500&<=3000CC 8703.23.0090 2960 MERCHANDISE PROCESSING FEE HARBOR MAINTENANCE FEE G.I.V. US\$ 40000.00 N.I.V. 40000.00			
-----	--	--	--	--

N	2.5% .3464% .125%	1000.00 138.56 50.00
---	-------------------------	----------------------------

Other Fee Summary for Block 39	35. Total Entered Value
499 138.56 501 50.00	\$ 40000.00
Total Other Fees	\$ 188.56

CBP USE ONLY		TOTALS
B. Ascertained Duty	37. Duty	1000.00
C. Ascertained Tax	38. Tax	.00
D. Ascertained Other	39. Other	188.56
E. Ascertained Total	40. Total	1188.56

36. DECLARATION OF IMPORTER OF RECORD (OWNER OR PURCHASER) OR AUTHORIZED AGENT

I declare that I am the  Importer of record and that the actual owner, purchaser, or consignee for CBP purposes is as shown above, OR  owner or purchaser or agent thereof. I further declare that the merchandise  was obtained pursuant to a purchase or agreement to purchase and that the prices set forth in the invoices are true, OR  was not obtained pursuant to a purchase or agreement to purchase and the statements in the invoices as to value or price are true to the best of my knowledge and belief. I also declare that the statements in the documents herein filed fully disclose to the best of my knowledge and belief the true prices, values, quantities, rebates, drawbacks, fees, commissions, and royalties and are true and correct, and that all goods or services provided to the seller of the merchandise either free or at reduced cost are fully disclosed.

41. DECLARANT NAME: COMET CUSTOMS BROKERS, ATTY IN FACT  
TITLE: SIGNATURE: DATE: 08/16/2013

42. Broker/Filer Information (Name, address, phone number)

43. Broker/Importer File No.



A.V. Station nr 44  
Industriezone A2 II/7  
3290 Diest-Webbekom  
tel: (078) 05 90 44  
fax: (078) 05 91 44

## KEURINGSBEWIJS

Autokeuring  
Ticketnr 777 4443 44 839001

Te bewaren in het voertuig

uitgereikt op : 10/10/2012

# STAAT VAN HET VOERTUIG

Nummerplaat : B \*297441 1ZAG131  
Chassisnummer SALLDHMB8BA297441 / 22  
Merk LAND ROVER DEFENDER  
1e indienststelling 26/06/1987

Kilometerstand : 85.678 (--) Plaatsen : 5+1  
Aard : Auto dubbel gebruik SW  
Gebruik : Old-timer  
Referentiedatum : 10/10

DIT KEURINGSBEWIJS STEMT OVEREEN MET DE STAAT VAN HET VOERTUIG OP HET OGENBLIK VAN DE KEURING.

### Gebreken nauwlettend in het oog te houden :

ASSEN--bevestiging--Vooraan Links  
OLIEVERLIES EN-OF KOELVLOEISTOFLEK--

Code

214 4  
509 4

### Opmerkingen


Uitgevoerde prestaties Inschrijvingsaanvraag, Verzoek agent, CarPass gratis  
Dit document geldt niet als technische keuring daar de staat van het voertuig niet is nagezien

026 4  
027 4

De DIV levert geen nummerplaat meer af aan het loket. Vlugges en zekere  
inschrijving via uw verzekeraar dankzij WebDIV. Levering door bpost.



6004-1-0906-00- Fm020 - FT

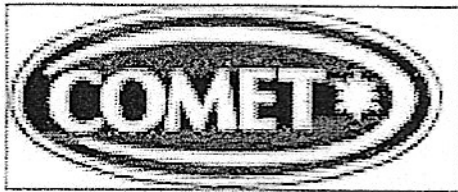

**Comet**  
**Customs Brokers, Inc.**

420 W. Merrick Rd, Suite 201 Valley Stream, NY 11580 Tel: (516)861-2163 or

(516-861-2161)  
Fax : (516)861-2171

EMAIL ADDRESS: mariem@cometcustoms.com

DATE: August 16-2013

U.S. Customs and Border Protection  
Bldg 77  
JFK Airport  
Jamaica, New York, 11434

Attention: TEAM 2T7  
Howard Eisenstat

RE: CERTIFICATION OF ENTRY SUMMARY CF 7501  
Entry no. 0209296-9 - IMPORTER Autosport Designs,  
Inc.

CUSTOMS AND BORDER PROTECTION  
JFK AIRPORT BLDG. 77  
JAMAICA, N.Y. 11430  
I HEREBY CERTIFY THE ABOVE TO  
BE A TRUE COPY OF THE ORIGINAL  
ON FILE IN THIS OFFICE  
ENTRY OFFICER Howard Eisenstat

AUG 19 2013

Dear Mr. Eisenstat:

ATTACHED FIND OUR CHECK

CHECK NO. 0436 P8


Please provide Comet Customs Brokers, Inc. with a certified copy fo the Customs Entry - form CF7501. The importer of records needs this stamped form to register his automobile with the Department of Motor Vehicles.

Please return the stamped copy to our BOX 285 so our messenger can pick it up and return it to us.

Thank you for your kind cooperation. Any questions, call the undersigned.

Very truly yours

Marie Mulieri

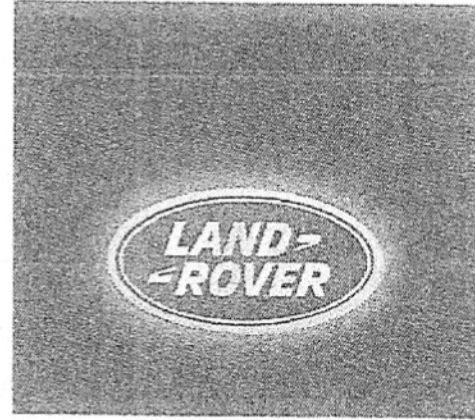

Land Rover UK - Solihull

### COMPLETE VEHICLES - CERTIFICAT OF CONFORMITY

Land-Rover UK ltd. Hereby certifies that the vehicle:

Make:

**LAND ROVER**

Type:

**110D4**

Vehicle identification number:

**SALLDHMB8BA297441**

Name and address of manufacturer:

**Land Rover  
Banbury road  
Gaydon Warwick  
CV35 0RR, UK**

Location of the vehicle identification number:

**Right Hand Front Chassis Member**

### ENVIRONMENTAL PERFORMANCES

CO2 emissions/fuel consumption/electric energy consumption:

1. All power train except pure electric vehicle

CO2 emissions

Urban conditions:

**357 g/km**

Extra-urban conditions

**252 g/km**

Combined:

**291 g/km**

Weighted, combined:

**- g/km**

Fuel consumption

Urban conditions:

**13.5 l/100 km**

Extra-urban conditions:

**9.5 l/100 km**

Combined:

**11.0 l/100 km**

Weighted, combined:

**- l/100 km**

Conforms in all respects to the type described in approval

Issued on

**26.06.1987**

And can be permanently registered in Member States having hand traffic.

**right**

13.11.2013

Solihull

(date)

(Place)

(Signature)

# Sherman Oaks Exclusive

4601 Van Nuys Blvd.  
Sherman Oaks, CA 91403

**818-986-1130**

BAR # ARD 00237614 EPA # CAD 983655275

**Invoice 0001357**  
Original Estimate #:0001500

WOODLAND HILLS, CA 91367-  
Cell:  
Work:(818) \_\_\_\_\_ HN  
Advisor : A

1987 LAND Defender 110  
DIESEL  
VIN : SALLDHMB8BA297441  
Mileage 90955  
Trans :  
License : 7CIP298  
Hat : 1/18/2016  
12:43 pm

## Service Requests:

Technician	Service Description	Parts	Labor	Job Total
RS1	Loss of Power: Customer states that on acceleration the vehicle loses power. Found the pipe from the turbo to the exhaust warped and the clamp is stripped. Recommend replacement of the clamp and the pipe. Replaced the pipe and the clamp. After road test, found the vehicle has added power and there is no exhaust odor in the vehicle.	53.45	975.23	1028.68
	CLAMP DOWN PIPE	53.45	1	53.45
RS1	Leak: Customer states there is brake fluid leak under the car. Found brake fluid leaking from the front brake hoses and the rear brake hoses. Replaced all of the brake hoses but due to discontinuation, rebuilt the left rear hose. Performed fluid fill and air bleed procedure.	491.44	598.45	1089.89
	BRAKE HOSE FRONT	176.44	2	352.88
	BRAKE FLUID	39.00	2	78.00
	BRAKE PIPE	60.56	1	60.56
	BRAKE PIPE LOCAL REBUILT	0.00	1	0.00
RS1	Customer states the gears are hard to put in. Not able to duplicate this at this time due to the lack of power hindering road testing ability. After making the vehicle drivable, found the transmission synchros faulty. Found wear on clutch disc. Replaced the transmission, the clutch, and associated parts. Adjusted and road tested, no further fault found at this time.	5978.21	1676.05	7654.26
	GROMMET TRANSFER LEVER	93.94	1	93.94
	TRANSMISSION	4882.64	1	4882.64
	CLUTCH KIT	890.71	1	890.71
	BUSHING FLYWHEEL PINION	83.03	1	83.03
	CLUTCH ALIGNMENT TOOL	27.89	1	27.89
RS1	90,000 Mile Service: Customer states to perform 90,000 mile interval service. Performed engine oil change, oil filter replacement, air filter change, fuel filter replacement front and rear differential oil change and transfer case oil change. Set the tire pressures.	238.09	954.12	1192.21
	ENGINE OIL	12.00	8	96.00
	OIL FILTER	39.26	1	39.26
	FUEL FILTER	67.83	1	67.83
	AIR FILTER	35.00	1	35.00
RS1	Upon inspection, found drive belt cracked. Recommend replacement of the drive belt. Replaced the drive belt.	24.95	289.78	314.73
	DRIVE BELT	24.95	1	24.95
RS1	Upon inspection found the rear left and right wheel cylinder leaking. Recommend replacement of the wheel cylinder. Replaced both rear wheel cylinders. No further leak detected.	158.70	747.53	906.23
	WHEEL CYLINDER LH REAR 110	79.35	1	79.35
	WHEEL CYLINDER RH REAR 110	79.35	1	79.35
RS1	Steering Leak: Customer requests to check for a power steering fluid leak. Found an oil leak from the power steering box. Recommend replacement of the steering box. Replaced the power steering box.	1484.21	971.75	2455.96
	POWER STEERING BOX	1484.21	1	1484.21
RS1	Customer states there is a clunk noise from underneath the vehicle when switching gears. Found the rear driveshaft u-joint loose. Recommend replacement of the rear driveshaft assembly. Also recommend replacement of the front driveshaft due to cracking and play in the U-Joint as a preventative maintenance measure. Replaced the front and rear drive shaft assemblies.	1591.94	1046.50	2638.44
	DRIVESHAFT FRONT	795.97	1	795.97
	DRIVESHAFT REAR	795.97	1	795.97
RS1	Upon visual inspection, found an oil leak from the transmission and transfer case gaskets, rear differential leak and the rear main seal leak. Replaced the transmission per previous line. Removed the transfer case assembly and replaced the transfer case gaskets and the rear main seal.	600.14	3421.03	4021.17
	TRANSFER BOX GASKET	50.48	1	50.48
	TRANSMISSION GASKET	134.57	1	134.57
	SEAL REAR MAIN	157.91	1	157.91
	OIL SEAL OUTPUT	94.35	2	188.70
	GASKET TRANSFER BOX	68.48	1	68.48
RS1	Upon visual inspection found the engine motor mounts cracked and dry rotted.	123.90	1249.61	1373.51

# Sherman Oaks Exclusive

4601 Van Nuys Blvd.  
Sherman Oaks, CA 91403

**818-986-1130**

BAR # ARD 00237614 EPA # CAD 983655275

**Invoice 0001357**  
Original Estimate #:0001500

22 \_\_\_\_\_ J7A  
WOODLAND HILLS, CA 91367-  
C \_\_\_\_\_  
Work:(81 \_\_\_\_\_  
Advisor : AMIR JAVADI

1987 LAND Defender 110  
DIESEL  
VIN : SALLDHMB8BA297441  
Mileage 90955  
Trans :  
License : 7CIP298  
Hat : 1/18/2016  
12:43 pm

Technician	Service Description	Parts	Labor	Job Total
------------	---------------------	-------	-------	-----------

fluid, and the coolant based on the condition. Exchanged the brake fluid, power steering fluid, and the coolant.

POWER STEERING FLUID	30.86	2	61.72
COOLANT/ANTIFREEZE	39.00	2	78.00
BRAKE FLUID	39.00	3	117.00

RS1 Check Brake Pads: Upon inspection, found the rear brake shoes worn to 1mm. Recommend replacement of the rear brake shoes. Found the front brake pads at 6mm. Found the front calipers rusted and leaking brake fluid. Found the rotors are scored. Found the brake dust shields rusted. Recommend replacement of the front brake pads, brake rotors, brake dust covers and brake calipers. Replaced the front calipers, brake pads, brake rotors and dust covers. Replaced the rear brake shoes and the transfer case brake shoes per maintenance due to accessibility. Found the parking brake cable stuck or frozen. Replaced the cable and adjusted parking brake.

BRAKE SHOES TRANSFER BOX	219.45	1	219.45
BRAKE DISC	188.41	2	376.82
CALIPER RIGHT FRONT	435.28	1	435.28
CALIPER LEFT FRONT	435.28	1	435.28
BRAKE PIN KIT	87.94	1	87.94
BRAKE PAD FRONT	246.31	1	246.31
HUB SEAL 12MM.	15.82	2	31.64
HUB SEAL INNER	14.15	2	28.30
HUB CAP	25.04	2	50.08
GASKET HUB FLANGE DRIVE	2.40	2	4.80
LOCK WASHER	2.66	1	2.66
WHEEL BEARING	33.23	1	33.23
BRAKE SHOES REAR	219.45	1	219.45
MUDSHIELD RIGHT FRONT	125.50	1	125.50
MUDSHIELD LEFT FRONT	125.50	1	125.50
CABLE PARKING BRAKE	0.00	1	0.00

S1 Upon inspection, found the exhaust pipe rusted throughout. Recommend replacement of the exhaust pipe complete. Replaced the complete exhaust system from the front to the rear of the car including ancillary parts and hardware.

PIPE FRONT EXHAUST	213.75	1	213.75
U-BOLT EXHAUST	22.53	2	45.06
SILENCER MIDDLE	248.51	1	248.51
TAIL PIPE ASSEMBLY	516.41	1	516.41
RUBBER WASHER EXHAUST HANGER	17.02	6	102.12
SPACER EXHAUST HANGER	12.02	3	36.06
WASHER	1.90	9	17.10
BOLT M8X70MM.	3.76	3	11.28
NUT	2.76	9	24.84
U BOLT EXHAUST HANGER FRONT	55.94	1	55.94
WASHER EXHAUST HANGER	4.33	6	25.98
BRACKET EXHAUST CLAMP	83.15	1	83.15
CLAMP BRACKET FRONT PIPE	74.18	1	74.18

RS1 Upon inspection, found the suspension springs rusted out and the customer requests to replace all four shocks and springs. Replaced all four shocks and springs front and rear.

COIL SPRING SET	1094.60	1	1094.60
SHOCK KIT	1631.70	1	1631.70

RS1 Upon inspection, found the rear suspension ball joint cracked and worn out. Recommend replacement of the ball joint. Customer authorized replacement of the ball joint. In the process of replacing the ball joint, it was found that most of the rear suspension components were rusted out. Found the anti roll bar rusted and the bushings dryrotted, the rear fulcrum assembly is discontinued so a replacement bracket is recommended along with the conversion process. Replaced the rear anti sway bar, bushings, fulcrum bracket conversion and hardware. \*\*\*NOTE\*\*\* There are still many components that have rust on this vehicle including but not limited to the frame of the vehicle and the shock and strut towers. The customer has been advised and photos have been taken. Customer agreed to all work that was performed on the vehicle and the customer was walked through each step of the repairs on this work order.

REAR ANTI ROLL BAR BUSHING	38.41	2	76.82
BRACKET REAR SWAY BAR BUSHING	64.82	2	129.64

**Sherman Oaks Exclusive**

4601 Van Nuys Blvd.  
Sherman Oaks, CA 91403

**818-986-1130**

BAR # ARD 00237614 EPA # CAD 983655275

**Invoice 0001357**  
Original Estimate #:0001500

22 07A  
WOODLAND HILLS, CA 91367-  
C  
Wor J. IN  
Advisor : AMIR JAVADI

1987 LAND Defender 110  
DIESEL  
VIN : SALLDHMB8BA297441  
Mileage 90955  
Trans :  
License : 7CIP298  
Hat : 1/18/2016  
12:43 pm

Technician	Service Description	Parts	Labor	Job Total
	NUT M8	6.76	8	54.08
	BRACKET FULCRUM	749.51	1	749.51
	BOLT	37.80	2	75.60
	NUT	6.10	2	12.20
	BALL JOINT REAR SUSPENSIC. LINK	218.95	1	218.95
	SHIPPING TOTAL OF ALL PARTS	650.00	1	650.00
	ANTI ROLL BAR REAR	383.32	1	383.32
	BUSHING REAR ANTI ROLL BAR	42.88	2	85.76
	SHOCK BUSHING REAR BOTTOM	12.19	4	48.76
	BOLT M10 X 175MM.	37.00	4	148.00
	BALL JOINT SWAY BAR	208.66	2	417.32
	BOLT ANTI ROLL BAR REAR AXLE	19.81	2	39.62
	SPLIT PIN	5.16	2	10.32
	WASHER PLAIN	9.06	2	18.12
	PLAIN WASHER M12 X 28MM	5.27	2	10.54
	REAR SHOCK BUSHING	10.81	4	43.24
	PLAIN WASHER 16MM	12.56	2	25.12
	PLAIN WASHER 16MM	12.56	2	25.12
	NYLON LOCK NUT M16	23.35	2	46.70
	BOLT REAR BRACKET	35.74	4	142.96
	WASHER 20MM.	4.50	1	4.50
	LOCK NUT 20MM.	23.24	1	23.24
	SPLIT PIN	4.80	1	4.80

**Authorizations**

Approved By	Approval Given to:	Date	Time	Difference	Total Authorized	Method
MULELE NIKESHA	GEO	8/10/15	9:04 am	\$149.50	\$149.50	In Person
Reason: LEAKS						
MULELE NIKESHA	AMIR	8/18/15	12:16 am	\$13,669.88	\$13,819.38	By Email
Reason: AUTHORIZING ALL REPAIRS ESTIMATED						
MULELE NIKESHA	AMIR	10/27/15	11:09 am	\$16,748.24	\$30,567.62	By Email
Reason: GEARBOX						
MULELE NIKESHA	AMIR	11/5/15	3:15 pm	\$8,437.30	\$39,004.92	In Person
Reason: FRONT DRIVESHAFT/FRONT EXHAUST/REAR SWAR BAR						
MULELE NIKESHA	AMIR	11/5/15	3:17 pm	\$0.00	\$39,004.92	In Person
Reason: BUSHINGS/WHEEL CYLINDER/BRAKE SHOES						
MULELE NIKESHA	AMIR	11/10/15	3:03 pm	\$4,130.75	\$43,135.67	By Phone
Reason: FRONT BRAKE PADS ROTORS AND CALIPERS						
MULELE NIKESHA	AMIR	1/14/16	6:29 pm	\$1,088.57	\$44,224.24	In Person
Reason: BRAKE HOSES REAR AND REPLACE EMERGENCY BRAKE CABLE						

**California Environmental Engineering**

**ENVIRONMENTAL TESTING LABORATORY**

2530 South Birch Street, Santa Ana, CA 92707

Phone (714) 545-9822 - Fax (714) 545-7667

**STATEMENT BY OWNER OF VEHICLE STATUS FOR  
CALIFORNIA AIR RESOURCES BOARD  
CERTIFICATE OF CONFORMITY**

I, \_\_\_\_\_, am the owner/importer  
(insert name of importer/owner)

of one 1987, Land Rover Defender VIN, SALLDHMB8BA297441  
(year) (make, model)

This vehicle is currently registered in the State of California  
(Insert State or N/A)

The vehicle was first brought into the State of California on 2013  
(Date vehicle 1st entered CA)

The declared value of this vehicle at U.S. Customs or Bill of Sale price for subsequent owner is  
\$ 57,000 U.S. Dollars.

The foregoing is true and correct to the best of my knowledge;

[Signature]  
Signature of Importer/Owner (Circle one please)

02/03/21  
Date signed

If vehicle has been registered in another State, please attach a copy of the out of State registration.

If vehicle was imported into California (port of Long Beach, San Francisco, etc.) upon original entry, but was never registered in California and has been registered in another State, insert the date the vehicle was brought back into California for registration above (date vehicle 1st entered CA), not the date of entry.

Thank you!

107958 ~~888~~

**Sherman Oaks Exclusive**

4601 Van Nuys Blvd.  
Sherman Oaks, CA 91403

**818-986-1130**

BAR # ARD 00237614 EPA # CAD 983655275

**Invoice 0001357**  
Original Estimate #:0001500

WOODLAND HILLS, CA 91367-  
Ce  
Work:(818)  
Advisor : AMIR JAVADI

1987 LAND Defender 110  
DIESEL  
VIN : SALLDHMB8BA297441  
Mileage 90955  
Trans :  
License : 7CIP298  
Hat : 1/18/2016  
12:43 pm

Technician	Service Description	Parts	Labor	Job Total
------------	---------------------	-------	-------	-----------

**Repair Order Notes**

The customer authorized by email on 8/18/15 at 12:16am. to repair all of the mechanical issues estimated: exhaust pipe, front brake hoses, wheel cylinder, 90k service, belt, power steering box, rear drive shaft, engine mounts, fluid exchange, transfer box gasket, transmission gasket, and rear main seal. he authorized amount is \$13,819.38

I hereby acknowledge notice and oral approval of an increase in the original estimated price. All parts are new unless otherwise specified. WARRANTY IS 12 MONTHS OR 12,000 MILES WHICH EVER OCCURS FIRST, UNLESS SPECIFIED OTHERWISE. PARTS AND LABOR WARRANTY WORK MUST ONLY BE PERFORMED BY SHERMAN OAKS EXCLUSIVE.

I acknowledge notice and oral approval of an increase in the original estimated price.

Customer Signature: \_\_\_\_\_ Date: \_\_\_\_\_

TOTAL PARTS	\$21,208.67
TOTAL LABOR	\$21,165.29
SUBLET	\$0.00
	\$0.00
SUBTOTAL	\$42,373.96
OTHER FEES	\$0.00
SALES TAX	\$1,850.28

**TOTAL REPAIR ORDER \$44,224.24**

PAID	\$28,000.00
DUE	\$16,224.24



## Sherman Oaks Exclusive

4601 Van Nuys Blvd.  
Sherman Oaks, CA 91403

**818-986-1130**

BAR # ARD 00237614 EPA # CAD 983655275

**Invoice 0001357**  
Original Estimate #:0001500

NI  
2  
WOODLAND HILLS, CA 91367-  
Cell:  
Work:(818)  
Advisor : AMIR JAVADI

1987 LAND Defender 110  
DIESEL  
VIN : SALLDHMB8BA297441  
Mileage 90955  
Trans :  
License : 7CIP298  
Hat : 1/18/2016  
12:46 pm

### Service Requests:

Technician	Service Description	Parts	Labor	Job Total
RS1	Loss of Power: Customer states that on acceleration the vehicle loses power. Found the pipe from the turbo to the exhaust warped and the clamp is stripped. Recommend replacement of the clamp and the pipe. Replaced the pipe and the clamp. After road test, found the vehicle has added power and there is no exhaust odor in the vehicle.	53.45	975.23	1028.68
	CLAMP DOWN PIPE	53.45	1	53.45
RS1	Leak: Customer states there is brake fluid leak under the car. Found brake fluid leaking from the front brake hoses and the rear brake hoses. Replaced all of the brake hoses but due to discontinuation, rebuilt the left rear hose. Performed fluid fill and air bleed procedure.	491.44	598.45	1089.89
	BRAKE HOSE FRONT	176.44	2	352.88
	BRAKE FLUID	39.00	2	78.00
	BRAKE PIPE	60.56	1	60.56
	BRAKE PIPE LOCAL REBUILT	0.00	1	0.00
RS1	Customer states the gears are hard to put in. Not able to duplicate this at this time due to the lack of power hindering road testing ability. After making the vehicle drivable, found the transmission synchros faulty. Found wear on clutch disc. Replaced the transmission, the clutch, and associated parts. Adjusted and road tested, no further fault found at this time.	5978.21	1676.05	7654.26
	GROMMET TRANSFER LEVER	93.94	1	93.94
	TRANSMISSION	4882.64	1	4882.64
	CLUTCH KIT	890.71	1	890.71
	BUSHING FLYWHEEL PINION	83.03	1	83.03
	CLUTCH ALIGNMENT TOOL	27.89	1	27.89
RS1	90,000 Mile Service: Customer states to perform 90,000 mile interval service. Performed engine oil change, oil filter replacement, air filter change, fuel filter replacement front and rear differential oil change and transfer case oil change. Set the tire pressures.	238.09	954.12	1192.21
	ENGINE OIL	12.00	8	96.00
	OIL FILTER	39.26	1	39.26
	FUEL FILTER	67.83	1	67.83
	AIR FILTER	35.00	1	35.00
RS1	Upon inspection, found drive belt cracked. Recommend replacement of the drive belt. Replaced the drive belt.	24.95	289.78	314.73
	DRIVE BELT	24.95	1	24.95
RS1	Upon inspection found the rear left and right wheel cylinder leaking. Recommend replacement of the wheel cylinder. Replaced both rear wheel cylinders. No further leak detected.	158.70	747.53	906.23
	WHEEL CYLINDER LH REAR 110	79.35	1	79.35
	WHEEL CYLINDER RH REAR 110	79.35	1	79.35
RS1	Steering Leak: Customer requests to check for a power steering fluid leak. Found an oil leak from the power steering box. Recommend replacement of the steering box. Replaced the power steering box.	1484.21	971.75	2455.96
	POWER STEERING BOX	1484.21	1	1484.21
RS1	Customer states there is a clunk noise from underneath the vehicle when switching gears. Found the rear driveshaft u-joint loose. Recommend replacement of the rear driveshaft assembly. Also recommend replacement of the front driveshaft due to cracking and play in the U-Joint as a preventative maintenance measure. Replaced the front and rear drive shaft assemblies.	1591.94	1046.50	2638.44
	DRIVESHAFT FRONT	795.97	1	795.97
	DRIVESHAFT REAR	795.97	1	795.97
RS1	Upon visual inspection, found an oil leak from the transmission and transfer case gaskets, rear differential leak and the rear main seal leak. Replaced the transmission per previous line. Removed the transfer case assembly and replaced the transfer case gaskets and the rear main seal.	600.14	3421.03	4021.17
	TRANSFER BOX GASKET	50.48	1	50.48
	TRANSMISSION GASKET	134.57	1	134.57
	SEAL REAR MAIN	157.91	1	157.91
	OIL SEAL OUTPUT	94.35	2	188.70
	GASKET TRANSFER BOX	68.48	1	68.48
RS1	Upon visual inspection found the engine motor mounts cracked and dry rotted.	123.90	1249.61	1373.51

# Sherman Oaks Exclusive

4601 Van Nuys Blvd.

Sherman Oaks, CA 91403

**818-986-1130**

BAR # ARD 00237614 EPA # CAD 983655275

**Invoice 0001357**

Original Estimate #:0001500

WOODLAND HILLS CA 91367-

Work: AMIR JAVADI  
Advisor : AMIR JAVADI

1987 LAND Defender 110

DIESEL

VIN : SALLDHMB8BA297441

Mileage 90955

Trans :

License : 7CIP298

Hat :

1/18/2016

12:46 pm

Technician	Service Description	Parts	Labor	Job Total
------------	---------------------	-------	-------	-----------

fluid, and the coolant based on the condition. Exchanged the brake fluid, power steering fluid, and the coolant.

POWER STEERING FLUID	30.86	2	61.72
COOLANT/ANTIFREEZE	39.00	2	78.00
BRAKE FLUID	39.00	3	117.00

RS1	Check Brake Pads: Upon inspection, found the rear brake shoes worn to 1mm. Recommend replacement of the rear brake shoes. Found the front brake pads at 6mm. Found the front calipers rusted and leaking brake fluid. Found the rotors are scored. Found the brake dust shields rusted. Recommend replacement of the front brake pads, brake rotors, brake dust covers and brake calipers. Replaced the front calipers, brake pads, brake rotors and dust covers. Replaced the rear brake shoes and the transfer case brake shoes per maintenance due to accessibility. Found the parking brake cable stuck or frozen. Replaced the cable and adjusted parking brake.	2422.24	2990.00	5412.24
-----	---	---------	---------	---------

BRAKE SHOES TRANSFER BOX	219.45	1	219.45
BRAKE DISC	188.41	2	376.82
CALIPER RIGHT FRONT	435.28	1	435.28
CALIPER LEFT FRONT	435.28	1	435.28
BRAKE PIN KIT	87.94	1	87.94
BRAKE PAD FRONT	246.31	1	246.31
HUB SEAL 12MM	15.82	2	31.64
HUB SEAL INNER	14.15	2	28.30
HUB CAP	25.04	2	50.08
GASKET HUB FLANGE DRIVE	2.40	2	4.80
LOCK WASHER	2.66	1	2.66
WHEEL BEARING	33.23	1	33.23
BRAKE SHOES REAR	219.45	1	219.45
MUDSHIELD RIGHT FRONT	125.50	1	125.50
MUDSHIELD LEFT FRONT	125.50	1	125.50
CABLE PARKING BRAKE	0.00	1	0.00

RS1	Upon inspection, found the exhaust pipe rusted throughout. Recommend replacement of the exhaust pipe complete. Replaced the complete exhaust system from the front to the rear of the car including ancillary parts and hardware.	1454.38	1420.25	2874.63
-----	---	---------	---------	---------

PIPE FRONT EXHAUST	213.75	1	213.75
U-BOLT EXHAUST	22.53	2	45.06
SILENCER MIDDLE	248.51	1	248.51
TAIL PIPE ASSEMBLY	516.41	1	516.41
RUBBER WASHER EXHAUST HANGER	17.02	6	102.12
SPACER EXHAUST HANGER	12.02	3	36.06
WASHER	1.90	9	17.10
BOLT M8X70MM.	3.76	3	11.28
NUT	2.76	9	24.84
U BOLT EXHAUST HANGER FRONT	55.94	1	55.94
WASHER EXHAUST HANGER	4.33	6	25.98
BRACKET EXHAUST CLAMP	83.15	1	83.15
CLAMP BRACKET FRONT PIPE	74.18	1	74.18

RS1	Upon inspection, found the suspension springs rusted out and the customer requests to replace all four shocks and springs. Repalced all four shocks and springs front and rear.	2726.30	1495.00	4221.30
-----	---	---------	---------	---------

COIL SPRING SET	1094.60	1	1094.60
SHOCK KIT	1631.70	1	1631.70

RS1	Upon inspection, found the rear suspension ball joint cracked and worn out. Recommend replacement of the ball joint. Customer authorized replacement of the ball joint. In the process of replacing the ball joint, it was found that most of the rear suspension components were rusted out. Found the anti roll bar rusted and the bushings dryrotted, the rear fulcrum assembly is discontinued so a replacement bracket is recommended along with the conversion process. Replaced the rear anti sway bar, bushings, fulcrum bracket conversion and hardware. ***NOTE*** There are still many components that have rust on this vehicle including but not limited to the frame of the vehicle and the shock and strut towers. The customer has been advised and photos have been taken. Customer agreed to all work that was performed on the vehicle and the customer was walked through each step of the repairs on this work order.	3604.00	2990.00	6594.00
-----	--	---------	---------	---------

REAR ANTI ROLL BAR BUSHING	38.41	2	76.82
BRACKET REAR SWAY BAR BUSHING	64.82	2	129.64

### Sherman Oaks Exclusive

4601 Van Nuys Blvd.  
Sherman Oaks, CA 91403

**818-986-1130**

BAR # ARD 00237614 EPA # CAD 983655275

**Invoice 0001357**  
Original Estimate #:0001500

WOODLAND HILLS, CA 91367-  
Cell:(310)  
Work:(818)  
Advisor : AMIR JAVADI

1987 LAND Defender 110  
DIESEL  
VIN : SALLDHMB8BA297441  
Mileage 90955  
Trans :  
License : 7CIP298  
Hat : 1/18/2016  
12:46 pm

Technician	Service Description	Parts	Labor	Job Total
	NUT M8	6.76	8	54.08
	BRACKET FULCRUM	749.51	1	749.51
	BOLT	37.80	2	75.60
	NUT	6.10	2	12.20
	BALL JOINT REAR SUSPENSION LINK	218.95	1	218.95
	SHIPPING TOTAL OF ALL PARTS	650.00	1	650.00
	ANTI ROLL BAR REAR	383.32	1	383.32
	BUSHING REAR ANTI ROLL BAR	42.88	2	85.76
	SHOCK BUSHING REAR BOTTOM	12.19	4	48.76
	BOLT M10 X 175MM.	37.00	4	148.00
	BALL JOINT SWAY BAR	208.66	2	417.32
	BOLT ANTI ROLL BAR REAR AXLE	19.81	2	39.62
	SPLIT PIN	5.16	2	10.32
	WASHER PLAIN	9.06	2	18.12
	PLAIN WASHER M12 X 28MM	5.27	2	10.54
	REAR SHOCK BUSHING	10.81	4	43.24
	PLAIN WASHER 16MM	12.56	2	25.12
	PLAIN WASHER 16MM	12.56	2	25.12
	NYLON LOCK NUT M16	23.35	2	46.70
	BOLT REAR BRACKET	35.74	4	142.96
	WASHER 20MM.	4.50	1	4.50
	LOCK NUT 20MM.	23.24	1	23.24
	SPLIT PIN	4.80	1	4.80

**Payments:**

- Check, \$6000.00, on 08/25/15  
CheckNo: [16-24/12204404], AuthorizationNo: []
- Check, \$7000.00, on 08/28/15
- Check, \$5000.00, on 11/13/15
- Check, \$10000.00, on 11/23/15  
CheckNo: [087], AuthorizationNo: []
- Check, \$16224.24, on 01/18/16

Approved By	Approval Given to:	Date	Time	Difference	Total Authorized	Method
MULELE NIKESHA	GEO	8/10/15	9:04 am	\$149.50	\$149.50	In Person
Reason: LEAKS						
MULELE NIKESHA	AMIR	8/18/15	12:16 am	\$13,669.88	\$13,819.38	By Email
Reason: AUTHORIZING ALL REPAIRS ESTIMATED						
MULELE NIKESHA	AMIR	10/27/15	11:09 am	\$16,748.24	\$30,567.62	By Email
Reason: GEARBOX						
MULELE NIKESHA	AMIR	11/5/15	3:15 pm	\$8,437.30	\$39,004.92	In Person
Reason: FRONT DRIVESHAFT/FRONT EXHAUST/REAR SWAR BAR						
MULELE NIKESHA	AMIR	11/5/15	3:17 pm	\$0.00	\$39,004.92	In Person
Reason: BUSHINGS/WHEEL CYLINDER/BRAKE SHOES						
MULELE NIKESHA	AMIR	11/10/15	3:03 pm	\$4,130.75	\$43,135.67	By Phone
Reason: FRONT BRAKE PADS ROTORS AND CALIPERS						
MULELE NIKESHA	AMIR	1/14/16	6:29 pm	\$1,088.57	\$44,224.24	In Person
Reason: BRAKE HOSES REAR AND REPLACE EMERGENCY BRAKE CABLE						

**Sherman Oaks Exclusive**

4601 Van Nuys Blvd.  
Sherman Oaks, CA 91403

**818-986-1130**

BAR # ARD 00237614 EPA # CAD 983655275

**Invoice 0001357**  
Original Estimate #:0001500

22 A  
WOODLAND HILLS, CA 91367-  
Cell:(310) 7  
Work:  
Advisor : AMIR JAVADI

1987 LAND Defender 110  
DIESEL  
VIN : SALLDHMB8BA297441  
Mileage 90955  
Trans :  
License : 7CIP298  
Hat : 1/18/2016  
12:46 pm

Technician	Service Description	Parts	Labor	Job Total
------------	---------------------	-------	-------	-----------

**Repair Order Notes**  
The customer authorized by email on 8/18/15 at 12:16am. to repair all of the mehanical issues estimated: exhaust pipe, front brake hoses, wheel cylinder, 90k service, belt, power steering box, rear drive shaft, engine mounts, fluid exchange, transfer box gasket, transmission gasket, and rear main seal. he authorized amount is \$13,819.38

I hereby acknowledge notice and oral approval of an increase in the original estimated price. All parts are new unless otherwise specified.  
**WARRANTY IS 12 MONTHS OR 12,000 MILES WHICH EVER OCCURS FIRST, UNLESS SPECIFIED OTHERWISE. PARTS AND LABOR WARRANTY WORK MUST ONLY BE PERFORMED BY SHERMAN OAKS EXCLUSIVE.**

I acknowledge notice and oral approval of an increase in the original estimated price.  
Customer Signature: \_\_\_\_\_ Date: \_\_\_\_\_

TOTAL PARTS	\$21,208.67
TOTAL LABOR	\$21,165.29
SUBLET	\$0.00
	\$0.00
SUBTOTAL	\$42,373.96
OTHER FEES	\$0.00
SALES TAX	\$1,850.28

**TOTAL REPAIR ORDER \$44,224.24**

PAID	\$44,224.24
DUE	\$0.00

Automotive Component Remanufacturing Ltd  
 J Reid Trading Estate, Factory Road  
 Sandycroft, Deeside  
 Flintshire  
 UK  
 CH5 2QJ  
 VAT Reg No: 647 9116 12  
 TEL: 01244 539196  
 FAX: 01244 539529



CARPLAN BVBA  
 RUE SERGEANT DE BRUYNE 10  
 1070 BRUSSELS  
 BELGIUM  
 VAT: BE 0 465.827.949

3777

24/04/2013

DPCONCEP

+32 11 91.52.97/+32 477 72.53.

Qty Ordered	Product Code	Product Description	Unit Price	Net Price
1.00	S3	<p>Complete Turbo D engine assembly, type 19J indirect injection turbo diesel engine for Land Rover 90 / 110 Non Aircon, with power steering.</p> <p>ACR remanufactured stripped engine assembly, complete with cylinder head, but less ancillaries etc            £ 2449 outright sale</p> <p>Set of remanufactured fuel injection equipment, with drive delt and tennsioner, setup and timed            £1590</p> <p>New set of ancillaries, including turbo, manifolds, starter, alternator, clutch, flywheel, belts and pulley's all mounterd            £ 1067</p> <p>Total price for complete turnkey engine assembly ready to run, with first fill oil included</p>	5,106.00	5,106.00
1.00	D80	<p>DELIVERY door to door CARVAN Stevoortsekiezel 10 3511 Kuringen (Hasselt)</p>	95.00	95.00

CARVAN  
 STEVOORTSEKIEZEL 10  
 3511 KURINGEN (HASSELT)  
 BELGIUM  
 Cont: Patrick Vandickelen  
 Tel: +32 498 12 88 34  
 CURRENCY  
 POUNDS STERLING (GBP)

<b>Total Net Amount</b>	5,201.00
<b>Carriage</b>	0.00
<b>Total VAT Amount</b>	0.00
<b>Order Total</b>	5,201.00