


I ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATED PRICE.

[Handwritten Signature]
CUSTOMER SIGNATURE

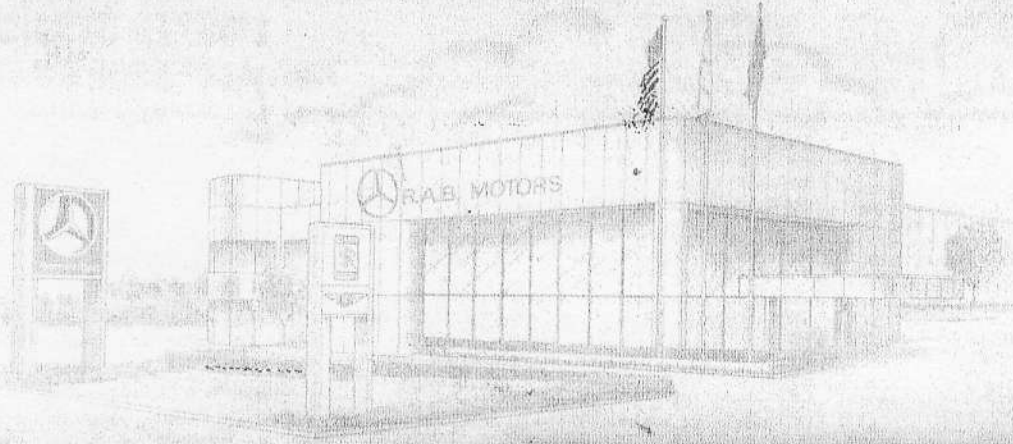

540 Francisco Boulevard West Telephone 415-454-0582
San Rafael, CA 94901-3925 FAX 415-457-9121

RAB MOTORS

B.A.R. # AB 006021
EPA ID # CAD 982370223

PAGE 2 OF 2

[END OF INVOICE]

10:25:48

540 Francisco Boulevard West Telephone 415-454-0582 Mercedes Benz
 San Rafael, CA 94901-3925 FAX 415-457-9121 Rolls Royce
 Bentley



**R.A.B
 MOTORS**

B.A.R. # AB 006021

NOTICE TO CONSUMER: PLEASE READ IMPORTANT WARRANTY INFORMATION ON BACK.

*Sausalito
 CA 94966*

*PAID
 m/c*

CUSTOMER NO. 606715	ADVISOR JAMES F MDNAHAN 33	HAT NO. 666	INVOICE DATE 03/12/92	INVOICE NO. RRC975831
<i>[Signature]</i> MILL VALLEY, CA 94941	LABOR RATE 65.00	LICENSE NO.	MILEAGE 3281	COLOR WHITE/TAN
	YEAR / MAKE / MODEL 89/ROLLS ROYCE/SPIRIT/SD		DELIVERY DATE 03/23/90	STOCK NO.
	VEHICLE ID. NO. 5 C A Z S 0 2 A 0 K C X 2 7 5 9 1		DELIVERY MILES 65	PRODUCTION DATE
	F.T.E. NO.	P.O. NO.	SELLING DEALER NO.	
			R.O. DATE 03/09/92	
COMMENTS				

ESTIMATE
 CUSTOMER HEREBY ACKNOWLEDGES RECEIVING
 ORIGINAL ESTIMATE OF \$150.00 (+TAX)
 APPROVED REVISED ESTIMATE (# 1) OF \$800.00 (+TAX) ON 03/09/92 AT 12:39pm
 BY JOE K LING COMMENTS
 TOTALS

REPAIR ESTIMATE INCLUDES CHARGES FOR HAZARDOUS WASTE MGMT.
 EPA I.D. #CAD 982370223

TO OUR SERVICE CUSTOMERS:
 THIS DEALERSHIP UTILIZES THE HOURS PUBLISHED IN MERCEDES
 BENZ OF NORTH AMERICA AND ROLLS-ROYCE OF NORTH AMERICA LABOR
 TIME GUIDE WHICH REFLECTS AN AVERAGE TIME REQUIREMENT FOR
 THE PERFORMANCE OF SPECIFIC VEHICLE REPAIRS, AND WHICH MAY
 THEREFORE BE EITHER MORE OR LESS THAN THE ACTUAL CLOCK TIME
 IN ANY GIVEN INSTANCE.

TOTAL LABOR..	487.50
TOTAL PARTS..	200.32
TOTAL SUBLET..	0.00
TOTAL G.O.G..	45.00
TOTAL MISC..	0.89
TOTAL TAX....	17.80
TOTAL INVOICE \$	751.51

I ACKNOWLEDGE AND APPROVE EXTRA WORK PERFORMED.

[Signature]
 CUSTOMER SIGNATURE

540 Francisco Boulevard West
San Rafael, CA 94901-3925

Telephone 415-454-0582
FAX 415-457-9121

Mercedes Benz
Rolls Royce
Bentley



R.A.B.
MOTORS

B.A.R. # AB 006021

NOTICE TO CONSUMER: PLEASE READ IMPORTANT WARRANTY INFORMATION ON BACK.

PO Box 159
Sausalito
CA 94966

CUSTOMER NO. 606715	ADVISOR JAMES F MONAHAN 33	HAT NO. 666	INVOICE DATE 03/12/92	INVOICE NO. RRC575931
J	LABOR RATE 65.00	LICENSE NO.	MILEAGE 3281	COLOR WHITE/TAN
MILL VALLEY, CA 94941	YEAR / MAKE / MODEL 89/ROLLS ROYCE/SPIRIT/SD		DELIVERY DATE 03/23/90	DELIVERY MILES 65
	VEHICLE ID. NO. 5CAZ502AOKCX27591		SELLING DEALER NO.	PRODUCTION DATE
	F.T.E. NO.	P.O. NO.	R.O. DATE 03/09/92	
COMMENTS				

QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE	
LABOR & PARTS				
J# 1	00RRZE	E SERVICE/1 YR INT. HOURS: 7.50 TECH(S):150		487.50
CUSTOMER REQUESTS INITIAL 3000 MILE SERVICE/INSPECTION				
TIME-DRIVEN INTERVAL UPGRADE TO 'E' SERVICE (1 YEAR				
INTERVAL)				
COMPLETED 1 YEAR INTERVAL 'E' SERVICE				
JOB # 1	1	UE-70123	AIR FILTER	32.72
JOB # 1	8	RH-12050	NGK SPARK PLUG	15.01
JOB # 1	1	UE-40893	OIL FILTER	28.95
JOB # 1	3	XB-1093-R	WASHER JOINT	1.98
JOB # 1	1	GM-14079550	GASKET OIL DRAIN PLU	3.71
JOB # 1	1	001-986-19-71-11	CLEANER	3.42
JOB # 1	1	TECHRON	ADDITIVE	5.50
			JOB # 1 TOTAL PARTS	200.32
			JOB # 1 TOTAL LABOR & PARTS	687.82

TIMING/VALVE TRAIN HOURS: 3.20 TECH(S):150
CUST STATES BURNING SMELL AFTER HE TURNS OFF CHECK AND ADV
REPLACED B BANK ROCKER COVER GASKET

WARRANTY

QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE	WARRANTY
JOB # 2	1	UE-4324	VALVE COVER GASKET N	
JOB # 2	4	UE-3425B	SEAL STRIP	
JOB # 2	2	CD-6000-GMF	ACC SPHERE CHRGD	
JOB # 2 TOTAL PARTS				0.00
JOB # 2 TOTAL LABOR & PARTS				0.00

J# 3 05RRZ01 TIMING/VALVE TRAIN HOURS: 0.80 TECH(S):150
CUST STATES ROUGH IDLE CHECK AND ADVISE
SET CO AND SET IDLE

QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE	WARRANTY
JOB # 3	1	UE-43628	BLANKING PLUG	
JOB # 3 TOTAL PARTS				0.00
JOB # 3 TOTAL LABOR & PARTS				0.00

J# 4*43RRZ12 SPHERES #1 & #2 R&R HOURS: 1.00 TECH(S):150
EXAMINATION REVEALED BRAKE PRESSURE WARNING LIGHT ON.
REPLACED PRESSURE ACCUMULATOR SPHERES #1 AND #2.

QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE	WARRANTY
JOB # 4	2	GMF-1225	O RING.	
JOB # 4 TOTAL PARTS				0.00
JOB # 4 TOTAL LABOR & PARTS				0.00

G.D.G. & SUPPLIES				
JOB # 1	10.0	20W50 MOTOR OIL	@ 2.500	/UNIT 25.00
JOB # 1	4.0	AUTOMATIC TRANS FLUID	@ 2.500	/UNIT 10.00
JOB # 1	4.0	REAR AXLE FLUID	@ 2.500	/UNIT 10.00
TOTAL - GOG				45.00

MISC				
JOB # 1	HRR	HAZARDOUS WASTE - OIL		0.89
TOTAL - MISC				0.89

540 Francisco Boulevard West Telephone 415-454-0582 Mercedes Benz
San Rafael, CA 94901-3925 FAX 415-457-9121 Rolls Royce
Bentley



71010B2
B7B

KCX27591

106447

BRITISH MOTOR CAR DIST., LTD.

901 Van Ness Avenue
San Francisco, CA 94109
(415) 776-7700

"Since 1947"

INVOICE



MILL VALLEY, CA 94941

PAGE 1

733

SERVICE ADVISOR: 132 GINO POTTER

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG
WHITE	1989	ROLLS ROYCE SILVER S	SCAZS02A0KCX27591	JOEO	12916/12916	TW178
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	PAYMENT	INV. DATE
01JAN1989	01JUN89		16:30 20NOV98		0.00 CASH	24NOV1998
R.O. OPENED	READY	OPTIONS: DLR:0517 ENG:6.8 Liter FI With Catalyst				
05OCT98	24NOV98					

LINE	OPCODE	TECH	TYPE	HOURS	DESCRIPTION	LIST	NET	TOTAL
A	CK	& ADVISE,	CUSTOMER REPORTS GRINDING TYPE NOISE HEARD INTERMITTENTLY FROM INSTRUMENT CLUSTER AREA					
					XRN REFER TO TECH NOTES BELOW FOR REPAIR			
				23	CRR		169.90	169.90
					12916 NO GRINDING NOISE EVIDENT, HOWEVER FOUND A BUZZING NOISE FORM THE DASH AREA. REMOVED THE THE FACIA, REMOVED THE TOP ROLL AND THE DIMISTER PANEL, SECURED LOOSE PLUG AND SOCKETS. REFITTED ALL DISPLACED PARTS, ROAD TESTED VEHICLE. CHECKS O.K. AT THIS TIME.			

B	CK	& ADVISE,	CUSTOMER REPORTS CLICKING TYPE NOISE HEARD FROM TURN SIGNAL STALK AREA.					
					UDS UNABLE TO DUPLICATE SYMPTOM			
				23	CRR		0.00	0.00
					12916 COULD NOT DUPLICATE COMPLAINT.			

C	CK	& ADVISE ON NEEDED SERVICE	SC PERFORM USED CAR SAFETY CHECK(NO OIL CHANGE)					
				23	IRR			(N/C)
					12916 CARRIEDOUT A SAFETY INSPECTION AS REQUESTED, A LIST OF RECOMMENDATIONS WAS SUPPLIED.			

D	INSPECT	EXTERIOR AND TOUCH UP PAINT CHIPS AS NEEDED.	SA PLEASE SEE SERVICE ADVISOR					
				23	CRR		0.00	0.00
					12916 SUBLET FOR PAINT TOUCH-UP			

E**	PERFORM	3 YEAR/30,000 MILE SERVICE AS RECOMMENDED (SEASONAL C SERVICE)	SCR SERVICE COMPLETED					
				23	CRR		1529.10	1529.10
					1 UE40893 OIL FILTER	24.00	24.00	24.00
					3 XB1093R WASHER JOINT	2.83	2.83	8.49
					1 RISLONE OIL ADD	9.23	9.23	9.23

Hours: Monday - Friday 7:30 am - to 6:00 pm	ORIGINAL ESTIMATE: \$ _____			FINAL REVISED ESTIMATE: \$ _____			DESCRIPTION	TOTALS
							LABOR AMOUNT	
							PARTS AMOUNT	
	DATE	TIME	PHONE #	AUTHORIZED	ADDITIONAL AMOUNT	REVISED TOTAL	GAS, OIL, LUBE	
							SUBLET AMOUNT	
							MISC. CHARGES	
							TOTAL CHARGES	
							ADJUSTMENTS	
							SALES TAX	
							PLEASE PAY THIS AMOUNT	

ALL PARTS ARE NEW UNLESS SPECIFIED OTHERWISE.

BAR# AC 012735

EPA# CAD 983615535

KCX27591

106447

BRITISH MOTOR CAR DIST., LTD.

901 Van Ness Avenue
San Francisco, CA 94109
(415) 776-7700

"Since 1947"

INVOICE



PAGE 2

1133

SERVICE ADVISOR: 132 GINO POTTER

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG
WHITE	1989	ROLLS ROYCE SILVER S	SCAZS02A0KCX27591	JOEO	12916/12916	TW178
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	PAYMENT	INV. DATE
01JAN1989	01JUN89		16:30 20NOV98		0.00 CASH	24NOV1998
R.O. OPENED	READY	OPTIONS: DLR:0517 ENG:6.8 Liter FI With Catalyst				
05OCT98	24NOV98					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
1	WW16	MSTR	CLEANER	W/S	4.95	4.95	4.95
1	JAG-101	TECH	FLUID		16.23	16.23	16.23
1	UE70123	AIR	FILTER		29.41	29.41	29.41
8	RH12050	S/PLUG	BPR4EVX		10.67	10.67	85.36
14	UG2427	DUST	CAP	ACCUM	1.16	1.16	16.24
2	RTC7601	ANTI-FREEZE			14.41	14.41	28.82
2	P-37	BRAKE	CLNR		4.16	4.16	8.32
4	UT13741PA	MINERAL	OIL		7.34	7.34	29.36
1	67009	GM	INTAKE	CLEANER	13.60	13.60	13.60
1	24-210386	GEARBOX	FIL		11.81	11.81	11.81
1	8-655625	SUMP	GASKET		7.19	7.19	7.19
1	1363951	O	RING		2.22	2.22	2.22
1	UE74370	FUEL	FILTER		45.16	45.16	45.16
1	SPM1522	WASHER	SEALING		2.52	2.52	2.52
1	SPM1482	WASHER	SEALING		2.52	2.52	2.52
1	UE35022	O	RING	BREATHER	4.08	4.08	4.08
1	UE43628	PLUG	BLANKING	A	10.04	10.04	10.04
2	UD74794	BLADE	WIPERS	18	22.76	22.76	45.52
1	UD71282	HOOK	CLIP	REVER	3.00	3.00	3.00
1	UE70477	CAP	EXPANSION	B	32.34	32.34	32.34
2	UW18752	FOAM	FILTER		12.26	12.26	24.52
1	CD6401	DIST	CAP		80.65	80.65	80.65
1	CD6077	ROTOR	ARM	DISTR	47.88	47.88	47.88
1	UE46097	ASSY	BELTS	STG	54.13	54.13	54.13
1	SPC3430	BELT	ALTERNATOR		17.32	17.32	17.32
1	SPC3429	BELT	COMPRESSOR		37.12	37.12	37.12
1	SPC3431	BELT	AIR	PUMP D	13.82	13.82	13.82
1	UE75318	HOSE	BOTTOM	RAD	101.61	101.61	101.61
1	UE72484	HOSE	TOP	RAD TO	86.51	86.51	86.51
1	UE72489	HOSE	BOTTLE	TO	48.40	48.40	48.40
1	UE70665	HOSE	RAD	TO EXP	40.62	40.62	40.62
1	UD24913	FLEXIBLE	HOSE		65.05	65.05	65.05
1	UD70021	HOSE	ENGINE	FEE	51.84	51.84	51.84
1	UD25829	HOSE			43.20	43.20	43.20



SINCE 1947

Hours: Monday - Friday 7:30 am - to 6:00 pm	ORIGINAL ESTIMATE: \$ _____		FINAL REVISED ESTIMATE: \$ _____			DESCRIPTION	TOTALS	
	DATE	TIME	PHONE #	AUTHORIZED	ADDITIONAL AMOUNT	REVISED TOTAL	LABOR AMOUNT	
							PARTS AMOUNT	
							GAS, OIL, LUBE	
							SUBLET AMOUNT	
							MISC. CHARGES	
							TOTAL CHARGES	
I ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATE PRICE.		I ACKNOWLEDGE RECEIPT OF VEHICLE AND I HAVE RECEIVED A COPY OF THIS INVOICE.					ADJUSTMENTS	
							SALES TAX	
							PLEASE PAY THIS AMOUNT	

ALL PARTS ARE NEW UNLESS SPECIFIED OTHERWISE.

BAR# AC 012735 EPA# CAD 983615535

CUSTOMER COPY

KCX27591

106447

BRITISH MOTOR CAR DIST., LTD.

901 Van Ness Avenue
San Francisco, CA 94109
(415) 776-7700

"Since 1947"

INVOICE



NG

PAGE 3

33

SERVICE ADVISOR: 132 GINO POTTER

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG
WHITE	1989	ROLLS ROYCE SILVER S	SCAZS02A0KCX27591	JOEO	12916/12916	TW178
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	PAYMENT	INV. DATE
01JAN1989	01JUN89		16:30 20NOV98		0.00 CASH	24NOV1998
R.O. OPENED	READY	OPTIONS: DLR:0517 ENG:6.8_Liter_FI_With_Catalyst				
05OCT98	24NOV98					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
1	UE36600		THERMOSTAT		46.11	46.11	46.11
1	UE73635		GASKET THERMOST		10.66	10.66	10.66
1	UE70368		OXYGEN SENSOR L		279.41	279.41	279.41
2	CD6591		PLUG DRAIN RAD		15.34	15.34	30.68
1	2A		JUBILEE CLIP		1.77	1.77	1.77
1	0X		JUBILEE CLIP		1.72	1.72	1.72
1	2		JUBILEE CLIP		1.71	1.71	1.71
1	1A		JUBILEE CLIP		1.72	1.72	1.72
2	00		JUBILEE CLIP		1.65	1.65	3.30
4	UT13741PA		MINERAL OIL		7.34	7.34	29.36
1	P-37		BRAKE CLNR		4.16	4.16	4.16
HWO HAZARDOUS WASTE DISPOSAL-OIL & FILTER							
	23		CHW			1.96	1.96
HWA HAZARDOUS WASTE DISPOSAL-ANTIFREEZE							
	23		CHW			4.37	4.37
LUBE FLUIDS FOR SERVICE							
			CL			21.50	21.50

12916 CARRIED OUT A 3 YEAR SERVICE AS PER ROLLS ROYCE. THE FOLLOWING ARE THE HYDRULIC TEST RESULTS #1-550, #2-600LBS REAR PADS APPROX-40% LEFT FRONT PADS NEED SERVICING.

F** CK & ADVISE, INSPECTION REVEALED #2 SYSTEM LIGHT DISPLAYS LONGER THAN NORMAL

XRN REFER TO TECH NOTES BELOW FOR REPAIR DESCRIPTION

23	CRR					169.90	169.90
1	GMF1026		DIAPHRAGM PRES		46.74	46.74	46.74
1	UD17876		PLUNGER BRAKE P		17.02	17.02	17.02

12916 DIAGNOSIS REVEALED A FAULTY BRAKE PRESSURE SWITCH. REMOVED AND OVER HAULED BRAKE SWITCH AS NEEDED. REFITTED AND BLED THE HYDRULIC SYSTEM. TOPPED UP LEVELS. RECHECKED FOR PROPER OPERATION CHECKED O.K.

G** CK & ADVISE, INSPECTION REVEALED FRONT BRAKE PADS WORN TO SENSORS, ALSO WHEEL BEARINGS VERY NOISY

Hours: Monday - Friday 7:30 am - to 6:00 pm	ORIGINAL ESTIMATE: \$ _____			FINAL REVISED ESTIMATE: \$ _____			DESCRIPTION	TOTALS
	DATE			PHONE #			LABOR AMOUNT	
	AUTHORIZED			ADDITIONAL AMOUNT			PARTS AMOUNT	
	REVISED TOTAL						GAS, OIL, LUBE	
							SUBLET AMOUNT	
							MISC. CHARGES	
							TOTAL CHARGES	
							ADJUSTMENTS	
							SALES TAX	
							PLEASE PAY THIS AMOUNT	

ALL PARTS ARE NEW UNLESS SPECIFIED OTHERWISE.

BAR# AC 012735

EPA# CAD 983615535

CUSTOMER COPY

10.23	16.23	16.23
29.41	29.41	29.41
10.67	10.67	10.67

KCX27591

1 0 6 4 4 7

BRITISH MOTOR CAR DIST., LTD.

901 Van Ness Avenue
San Francisco, CA 94109
(415) 776-7700

"Since 1947"

INVOICE



MILL VALLEY, CA 94941

PAGE 4

SERVICE ADVISOR: 132 GINO POTTER

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG
WHITE	1989	ROLLS ROYCE SILVER S	SCAZS02A0KCX27591	JOEO	12916/12916	TW178
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	PAYMENT	INV. DATE
01JAN1989	01JUN89		16:30 20NOV98		0.00 CASH	24NOV1998
R.O. OPENED	READY	OPTIONS: DLR:0517 ENG:6.8_Liter_FI_With_Catalyst				
05OCT98	24NOV98					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

XRN REFER TO TECH NOTES BELOW FOR REPAIR

DESCRIPTION

23 CRR

594.65 594.65

1 CD6589 BRAKE PAD KIT F	173.55	173.55	173.55
2 UA10054ZP PIN SPLIT.186 X	2.07	2.07	4.14
4 RRG1 BEARING GREASE	9.90	9.90	39.60
4 UG13397 OIL SEAL	47.58	47.58	190.32
2 UG13544SP BRG CONE	11.90	11.90	23.80
2 UG13545SP CUP	6.38	6.38	12.76
2 UG13552SP *BRG CONE	16.92	16.92	33.84
2 UG13553SP *BRG CUP	11.82	11.82	23.64

HWAS HAZARDOUS WASTE DISPOSAL-BRAKE SERVICE

23 CHW

1.43 1.43

12916 CARRIED OUT A FRONT BRAKE SERVICE AS NEEDED. FITTED NEW GREASE SEALS, GREASE AND BEARINGS.

H** ROATE AND BALANCE TIRES AS RECOMMENDED

M13 BALANCE WHEEL(S) EACH

23 CRR

PAID 69.95 69.95

12916 ROTATED AND HIGH SPEED BALANCED ALL FOUR WHEEL AND TIRE COMBINATIONS.

I** CK & ADVISE, INSPECTION REVEALED LEFT REAR AXLE SHAFT

LEAKING, SERVICE LEFT AND REAR AXLE SHAFTS AS RECOMMENDED

XRN REFER TO TECH NOTES BELOW FOR REPAIR

DEC 19 1998

DESCRIPTION

23 CRR

CASH CHECK 509.70 509.70

1 UG15008 OIL SEAL	32.34	32.34	32.34
1 UG15009 OIL SEAL (RED)	34.04	34.04	34.04
2 UG10140R BEARING	46.60	46.60	93.20

12916 REMOVED HALF SHAFTS AND DISMANTLED, REPLACED SEALS AS NEEDED. REFITTED AND TORQUED BOLTS TO SPEC. TOPPED UP DIFFERENTIAL, ROAD TESTED VEHICLE. CHECK O.K.

<p>90m</p> <p>Hours:</p> <p>Monday - Friday</p> <p>7:30 am - to 6:00 pm</p>	ORIGINAL ESTIMATE: \$ _____		FINAL REVISED ESTIMATE: \$ _____			DESCRIPTION	TOTALS	
	DATE	TIME	PHONE #	AUTHORIZED	ADDITIONAL AMOUNT	REVISED TOTAL	LABOR AMOUNT	3050.96
							PARTS AMOUNT	2288.67
							GAS, OIL, LUBE	21.50
							SUBLET AMOUNT	0.00
							MISC. CHARGES	0.00
							TOTAL CHARGES	5361.13
							ADJUSTMENTS	0.00
							SALES TAX	196.37
							PLEASE PAY THIS AMOUNT	5557.50

I ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATE PRICE.

I ACKNOWLEDGE RECEIPT OF VEHICLE AND I HAVE RECEIVED A COPY OF THIS INVOICE.

ALL PARTS ARE NEW UNLESS SPECIFIED OTHERWISE.

BAR# AC 012735

EPA# CAD 983615535

CUSTOMER COPY

British Motor Car Distributors, Ltd.

901 Van Ness Avenue • San Francisco, CA 94109 (415) 776-7700 fax: (415) 776-8323

Two Years or 30,000 mile service Maintenance Check List

RO# 106447

Date: 10/27/98

Name: _____

Model Year: 89 Make: ROLLS-ROYCE Model: SILVER SPIRIT

Serial # KCX 27591

License # JOEO Speedometer Reading: 12916

1. CHECK CONDITION OF ENGINE MOUNTS
2. CHECK BRAKE SPHERE PRESSURES
3. CHANGE ENGINE OIL
4. CHANGE ENGINE OIL FILTER
5. CHANGE TRANSMISSION OIL AND FILTER
6. CHANGE DIFFERENTIAL GEAR OIL
7. CHECK REAR TRUNION GEAR OIL (WHERE APPLICABLE)
ADD IF NECESSARY
8. CHECK REAR AXLE BOLTS. TIGHTEN IF NECESSARY
9. LUBE ALL LINKAGES
10. LUBE ALL NECESSARY FRICTION POINTS
11. LUBE REAR CHECK STRAPS (WHERE APPLICABLE)
12. CHECK FRONT END SUSPENSION BUSHINGS AND MOUNTS FOR WEAR
13. CHECK FRONT AND REAR DAMPERS FOR LEAKS AND WEAR
14. LUBE FRONT END STEERING LINKAGE (WHERE APPLICABLE)
15. CHECK STEERING RACK LEAKS AND WEAR (WHERE APPLICABLE)
16. CHECK STEERING BOX AND DAMPER FOR LEAKS AND WEAR
(WHERE APPLICABLE)
17. LUBE UPPER ROLL JOINTS (WHERE APPLICABLE)
18. CHECK REAR SUSPENSION BUSHINGS AND MOUNTS FOR WEAR
19. CHECK REAR STRUTS FOR LEAKS AND WEAR
20. CHECK REAR GAS SPRINGS
21. CHECK CONDITION OF FRONT BRAKES AND ROTORS. NOTE ROTOR
THICKNESS
22. CHECK CONDITION OF REAR BRAKES AND ROTORS. NOTE ROTOR
THICKNESS
23. CHECK CONDITION OF PARKING BRAKE PADS
24. LUBE AND ADJUST PARKING BRAKE CABLES
25. CHECK CONDITION OF TIRES AND ADJUST TIRE PRESSURES.
ROTATE TIRES IF NECESSARY
26. RENEW NECESSARY FUEL FILTERS
27. TIGHTEN EXHAUST MANIFOLD AND TAKEDOWN PIPE BOLTS
28. CHECK EXHAUST SYSTEM FOR LEAKS, CORROSION AND ALIGNMENT.
ADJUST ALIGNMENT IF NECESSARY
29. CHECK FOR OIL LEAKS
30. CHECK FOR MINERAL OIL LEAKS (WHERE APPLICABLE)
31. CHECK FOR BRAKE FLUID LEAKS (WHERE APPLICABLE)

32. FLUSH HYDRAULIC BRAKE AND LEVELING SYSTEM
(WHERE APPLICABLE)
33. CHECK FOR ALL TYPES OF FLUID LEAKS
34. CHECK PROPSHAFT COUPLINGS (WHERE APPLICABLE)
35. LUBE PROPSHAFT U JOINTS (WHERE APPLICABLE)
36. LUBE REAR AXLE U JOINTS (WHERE APPLICABLE)
37. TIGHTEN ENGINE OIL SUMP BOLTS
38. RENEW HEATER HOSES
39. RENEW RADIATOR HOSES
40. RENEW EXPANSION TANK PRESSURE VALVE AND SEALS
(WHERE APPLICABLE)
41. RENEW ENGINE THERMOSTAT
42. PRESSURE CHECK RADIATOR CAP (WHERE APPLICABLE)
43. ADD NEW ENGINE ANTIFREEZE COOLANT AND PRESSURE CHECK
SYSTEM. CHECK FOR LEAKS.
44. RENEW ALL ENGINE DRIVE BELTS
45. CLEAN ENGINE CRANKCASE BREATHER FILTER
46. TIGHTEN ENGINE VALVE COVERS
47. CLEAN WEAKNER VALVES (WHERE APPLICABLE)
48. RENEW SPARKING PLUGS
49. RENEW IGNITION DISTRIBUTOR POINTS, CONDENSOR AND ROTOR
(WHERE APPLICABLE)
50. CLEAN CARBURETOR DASH POTS (WHERE APPLICABLE)
51. RENEW CARBURETOR FUEL FILTERS (WHERE APPLICABLE)
52. RENEW AIR FILTER
53. TIGHTEN EGR PIPES AND FITTINGS (WHERE APPLICABLE)
54. CHECK EMISSION CONTROL SYSTEM. REPAIR AS NECESSARY
55. CHECK FUEL INJECTION HOSES AND FITTINGS
(WHERE APPLICABLE)
56. RENEW FUEL EVAPORATOR SYSTEM FILTERS (WHERE APPLICABLE)
56. CHECK AND ADJUST ENGINE IGNITION TIMING TO FACTORY
SPECIFICATIONS
57. CHECK AND ADJUST ENGINE AIR FUEL MIXTURE TO FACTORY
SPECIFICATIONS
58. CHECK ALL FLUID LEVELS. FILL WHERE NECESSARY
59. RENEW FRESH AIR FILTER
60. RENEW WINDSCREEN WIPER BLADES
61. CHECK WINDSCREEN WASHER NOZZLES. ADJUST AS NECESSARY
62. TIGHTEN WIPER ARM FASTENERS
63. CHECK CONDITION OF BATTERY. CLEAN TERMINALS AND
INSTALL PROTECTORS
64. CHECK OPERATION OF HEADLAMPS. CORRECT AS NECESSARY
65. CHECK OPERATION OF TAIL LIGHTS. CORRECT AS NECESSARY
66. CHECK OPERATION OF SIDE MARKER, LICENSE PLATE AND
BACKUP LIGHTS. CORRECT AS NECESSARY
67. CHECK OPERATION OF BRAKE LIGHTS. CORRECT AS NECESSARY
68. TIGHTEN DOOR LATCH AND STRIKER PLATE SCREWS
69. TIGHTEN DOOR ARM REST SCREWS (WHERE APPLICABLE)
70. LUBE ALL WEATHER STRIPPING
71. LUBE DOOR, BONNET AND BOOT HINGES
72. CHECK OPERATION OF INTERIOR LIGHTS. CORRECT AS NECESSARY
73. CHECK OPERATION OF INTERIOR FITTINGS. CORRECT AS
NECESSARY
74. CHECK OPERATION OF ELECTRIC WINDOWS

75. CHECK OPERATION OF ELECTRIC SEATS
76. CHECK OPERATION OF ALL MIRRORS AND TIGHTEN AS NECESSARY
77. CHECK OPERATION OF ALL SEAT BELTS. CORRECT AS NECESSARY
78. CHECK OPERATION OF HORNS. CORRECT AS NECESSARY
79. CHECK OPERATION OF EMERGENCY FLASHERS. CORRECT AS NECESSARY
80. RESET CLOCK
81. NA RESET RADIO STATIONS
82. ROAD TEST CAR FOR SATISFACTORY PERFORMANCE
83. CHECK OPERATION OF HEATER AND AIR CONDITIONING. NOTE MALFUNCTIONS IF ANY
84. CHECK OPERATION OF SPEED CONTROL. NOTE MALFUNCTIONS IF ANY
85. CHECK FOR EXCESSIVE ROAD NOISE
86. CHECK GENERAL ROAD HANDLING
87. AFTER ROAD TEST, CHECK ALL FLUID LEVELS. ADJUST AS NECESSARY
88. CHECK FOR ANY FLUID LEAKS THAT MAY HAVE DEVELOPED. CORRECT AS NECESSARY
89. NA MAKE SURE CAR HAS A PROPER AMOUNT OF FUEL
90. ADVISE SERVICE WRITER OF ANY ADDITIONAL SERVICE THIS CAR REQUIRES

COMMENTS _____

_____TECHNICIAN # 23SIGNATURE Mary Ann

KCX27591

184973

BENTLEY SAN FRANCISCO

999 Van Ness Avenue
San Francisco, CA 94109
(415) 776-7700
www.bmcd.com



INVOICE

Mission Statement:

"We are a team committed to providing value, quality and excellence in sales and service; inspired by our customers' standards and the Qvale family reputation for integrity since 1947."

PAGE 1


SERVICE ADVISOR: 132 GINO POTTER

MILL VALLEY, CA 94941

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG
WHITE	89	ROLLS ROYCE SILVER S	SCAZS02A0KCX27591	JOEO	15750/15757	TY729
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	PAYMENT	INV. DATE
01JUN1989	01JUN89		16:30 14OCT03		0.00 DISCPB	16OCT2003
R.O. OPENED	READY	OPTIONS: DLR:0517 ENG:6.8 Liter FI With Catalyst				
09OCT03	16OCT03	1) CELL PHONE #415 828-7733				

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL	
A	COURTESY INSPECTION/OWNERS APPRECIATION EVENT							
	S10 OWNERS APPRECIATION INSPECTION, COMPLETED							
	99 CRR						0.00	0.00
OWNERS APPRECIATION EVENT COMPLETED.								

B**	PERFORM 24 MONTH OR 15,000 MILE SERVICE AS REQUESTED AND RECOMMENDED							
	S10 24 MONTH/15,000 MILE SERVICE, COMPLETED							
	38 CRR1						1375.00	1375.00
	14	UG2427	DUST CAP ACCUM		1.91	1.91	26.74	
	1	UE74370	FUEL FILTER		53.04	53.04	53.04	
	2	SPM1482	WASHER SEALING		3.72	3.72	7.44	
	2	SPM1522	WASHER SEALING		3.72	3.72	7.44	
	1	UE70123	AIR FILTER		43.27	43.27	43.27	
	1	UE70477	CAP EXPANSION B		42.77	42.77	42.77	
	1	UE43628	PLUG BLANKING A		14.46	14.46	14.46	
	8	RH12050	BPR4EVX		16.07	16.07	128.56	
	1	UE35022	O RING BREATHER		6.71	6.71	6.71	
	2	RTC7601	ANTI-FREEZE		17.00	17.00	34.00	
	4	UT13741	PA MIN OIL		14.13	14.13	56.52	
	HWO HAZARDOUS WASTE DISPOSAL-OIL & FILTER							
	38 CHW						2.68	2.68
	HWA HAZARDOUS WASTE DISPOSAL-ANTIFREEZE							
	38 CHW						5.29	5.29
	SSP MISC SHOP SUPPLIES							
	38 CSUP						5.00	5.00
	S10 OIL AND FILTER SERVICE - SERVICE CLINIC							
	PROMOTION							
	38 IRR							(N/C)
	1	UE40893	OIL FILTER				(N/C)	
	2	CD6591	PLUG DRAIN RAD				(N/C)	
	3	XB1093R	WASHER JOINT				(N/C)	
LUBE 10	QUARTS 20W/50 ENGINE OIL							
	PO#F							

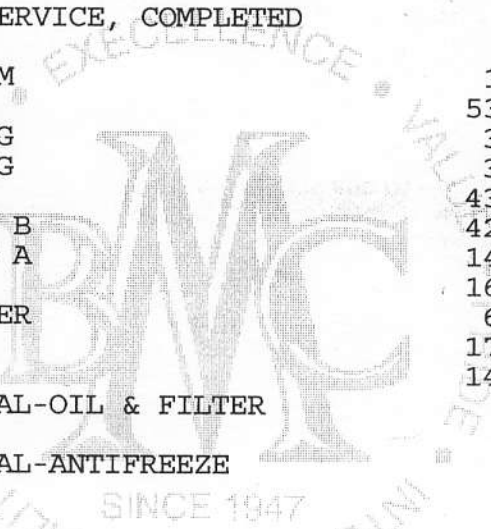

Hours:

Monday - Friday
7:30 am - to 6:00 pm

ORIGINAL ESTIMATE: \$	FINAL REVISED ESTIMATE: \$	DESCRIPTION	TOTALS
		LABOR AMOUNT	
		PARTS AMOUNT	
		GAS, OIL, LUBE	
		SUBLET AMOUNT	
		MISC. CHARGES	
		TOTAL CHARGES	
		ADJUSTMENTS	
		SALES TAX	
		PLEASE PAY THIS AMOUNT	

I ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATE PRICE.

I ACKNOWLEDGE RECEIPT OF VEHICLE AND I HAVE RECEIVED A COPY OF THIS INVOICE.

ALL PARTS ARE NEW UNLESS SPECIFIED OTHERWISE. BAR# AH 223516 EPA# CAL 000265432
WARNING: Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and paints and materials used to maintain vehicles, including, but not limited to, fuel, oil, batteries, brakes, and wheel-balancing weights. In addition, motor vehicles emit engine exhaust and fumes, and when serviced, cleaned, or maintained generate used oil, waste fluids, fumes, grease, grime, and particulates from component wear, which contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. (Posted in accordance with Proposition 65 in Cal. Health & Safety Code §25249.5 et seq.) For further information about Proposition 65: <http://www.oehha.org/prop65.html>

BENTLEY SAN FRANCISCO

999 Van Ness Avenue
San Francisco, CA 94109
(415) 776-7700
www.bmcd.com



Mission Statement:

"We are a team committed to providing value, quality and excellence in sales and service; inspired by our customers' standards and the Qvale family reputation for integrity since 1947."

KCX27591

1 8 4 9 7 3

INVOICE

PAGE 2

SERVICE ADVISOR: 132 GINO POTTER

MILL VALLEY, CA 94941

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG
WHITE	89	ROLLS ROYCE SILVER S	SCAZS02A0KCX27591	JOEO	15750/15757	TY729
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	PAYMENT	INV. DATE
01JUN1989	01JUN89		16:30 14OCT03		0.00	16OCT2003
R.O. OPENED	READY	OPTIONS: DLR:0517 ENG:6.8 Liter_FI_With_Catalyst				
09OCT03	16OCT03	1) CELL PHONE #415 828-7733				

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
			IRR				(N/C)
LUBE 5	QUARTS	TRANSMISSION FLUID	CRR2			12.75	12.75
LUBE 2	QUARTS	GEAR OIL	CRR2			5.50	5.50
SUBL	OSCAR MARTINEZ	DETAIL (PO#73507/INV#7943)	IRR				(N/C)
15750	PERFORM	24 MONTH/15,000 MILE SERVICE AS PER CHECK SHEET. APPRX 90% FRONT, REAR AND PARKING BRAKE PAD MATERIAL REMANNING. BRAKE ACCUMULATORS ARE NEW.					

C CK & ADVISE, INSPECTION REVEALED BRAKE PRESSURE ACCUMULATORS AT MINIMUM PRESSURE SPECIFICATION**
S14 BRAKE ACCUMULATORS, REPLACE
 38 CRR1
 2 CD6000GMF SPHERE BRAKE AC 140.78 455.00 281.56
 2 GMF1225 O RING DAMPER R 7.16 7.16 14.32
 2 UT13741PA MIN OIL 14.13 14.13 28.26
 15750 REMOVE AND REPLACE BRAKE ACCUMULATOR SPHERES. BLEED #1 AND #2 BRAKE SYSTEMS.

D CK & ADVISE, INSPECTION REVEALED ACU KNOB ON DASH IS LOOSE**
S16 ACU FUNCTION KNOB CLIP, REPLACE
 38 CRR1
 1 SPC1208 CLIP 20.35 0.00 20.35
 15750 REMOVE AND REPLACE BROKEN CLIP SECURING ACU FUNCTION KNOB.

NOTE: ADDITIONAL ITEMS NOTICED DURING INSPECTION. RIGHT REAR STRUT SEEPS, DRIVESHAFT COUPLERS STARTING TO CRACK, SLIGHT SQUEAK FROM RIGHT FRONT AREA WHEN GOING OVER BUMPS.

ORIGINAL ESTIMATE: \$	FINAL REVISED ESTIMATE: \$			DESCRIPTION	TOTALS
	DATE	TIME	PHONE #	LABOR AMOUNT	
				PARTS AMOUNT	1842.97
				GAS, OIL, LUBE	765.44
				SUBLET AMOUNT	18.25
				MISC. CHARGES	0.00
				TOTAL CHARGES	0.00
				ADJUSTMENTS	2626.66
				SALES TAX	260.83
				PLEASE PAY THIS AMOUNT	65.06
					2430.89

ALL PARTS ARE NEW UNLESS SPECIFIED OTHERWISE. BAR# AH 223516 EPA# CAL 000265432
 WARNING: Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and paints and materials used to maintain vehicles, including, but not limited to, fuel, oil, batteries, brakes, and wheel balancing weights. In addition, motor vehicles emit engine exhaust and fumes, and when serviced, cleaned, or maintained generate used oil, waste fluids, fumes, grease, grime, and particulates from component wear, which contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. (Posted in accordance with Proposition 65 in Cal. Health & Safety Code §25249.5 et seq.) For further information about Proposition 65: http://www.oehha.org/prop65.html



BENTLEY

Bentley San Francisco

999 Van Ness Ave. San Francisco, CA 94109

Phone (415) 776-7700 Fax (415) 292-9977



GENUINE PARTS

Name: _____ Ro# 184473 Miles: 15750 Date: 10/9/03
Year: 89 Make: BOLLIS-ROUTE Model: SPUR Vin# KEX 27591

6.75 Litre V8 (1980-1989)

24 MONTH/15,000 Mile Service Maintenance Check List

Engine

1. Change engine oil
2. Renew oil filter
3. Check the condition and tension of the engine drive belts
4. Renew air filter element
5. Renew the spark plugs
6. Lubricate throttle linkage
7. Check and adjust ignition timing (other than turbo R)
8. Check and adjust idle speed (where applicable)
9. Check induction system for leaks
10. Check vacuum advance mechanism for correct operation (where applicable)
11. Retorque valve covers
12. Lubricate the distributor

Engine Cooling System

13. Check all coolant hose clamps for tightness
14. Examine the condition of all coolant hoses
15. Check and top-up the coolant level
16. Renew the coolant (every 2 years)
17. Check anti-freeze concentration; correct as needed
18. Remove any foreign matter from the radiator matrix, refrigeration condenser, engine oil cooler and the intercooler matrix (if fitted)

Transmission/Propeller Shaft/Final Drive

19. Check the transmission fluid and top-up as necessary
20. Renew the transmission fluid
21. Lubricate the gear range selector control rod
22. Lubricate the propeller shaft universal joints (where applicable)
23. Check the final drive oil level
24. Renew the final drive fluid
25. Check the condition of the drive-shaft joint covers

Fuel System

26. Renew main fuel filter
27. Check the condition of the fuel tank filler hose
28. Check the condition of all pipes and hoses
29. Check the fuel system for flow and pressure

Exhaust and Exhaust Emission Control System

30. Check exhaust system for leaks and proper adjustment
31. Check and tighten exhaust manifold and takedown pipe bolts

Heating/Air conditioning system

- 72. Check that the scuttle intake grilles are free from obstructions
- 73. Check the refrigeration system for proper operation
- 74. Check the heater for proper operation
- 75. Check the defroster for proper operation

Body

- 76. Check the condition and operation of seat belts
- 77. Check that all body drains are free from obstruction
- 78. Lubricate all hinges and locks
- 79. Lubricate the spare wheel lowering bolt
- 80. Check the fluid level in the power operated hood reservoir with hood in the fully down (opened) position (Convertible cars)
- 81. Lubricate the hood frame (Convertible cars)
- 82. Check the condition of the hood to body seal
- 83. Check to see that all seal drains are free from obstruction
- 84. Check the hood to backlight drain tray and drains are free from obstruction (Convertible cars)
- 85. Lubricate all weather stripping
- 86. Tighten interior rear view mirror

Wheels and Tires

- 87. Check all tire pressures (including spare) adjust as necessary
LF 26 PSI LR 30 PSI SP 32 PSI
RF 26 PSI RR 30 PSI
- 88. Check the condition and tread depth of all tires
LF 8 mm LR 8 mm SP 8 mm
RF 8 mm RR 8 mm
- 89. Lubricate the wheel trim locks. Grease the arms of contact between the wheel and hub

Road test and final inspection

- 90. Road test for satisfactory performance and condition
- 91. Check operation of speed control
- 92. Check for excessive road noise
- 93. After road test recheck fluid levels
- 94. Check for spare mineral oil. Supply if needed
- 95. Read out fault memory (where applicable)
- 96. Reset clock
- 97. Update owners handbook
- 98. Clean and lube antenna mast

Comments:

Marin's
 Showcase For
 The World's
 Finest Automobiles

540 Francisco
 Boulevard West
 San Rafael
 CA 94901-3925

Telephone
 415.454.0582
 Facsimile
 415.457.9121

Mercedes Benz
 Range Rover
 Rolls Royce
 Bentley
 Lincoln
 Mercury



R.A.B. MOTORS

NOTICE TO CONSUMER: PLEASE READ IMPORTANT WARRANTY INFORMATION ON BACK.

RANGE ROVER !!! THE ULTIMATE IN FOUR WHEEL DRIVE VEHICLES IS NOW AVAILABLE AT R.A.B. MOTORS. WE HAVE A GREAT SELECTION AT SPECIAL INTRODUCTORY PRICES ! PLEASE CALL ONE OF OUR SALES CONSULTANTS TO ARRANGE A TEST DRIVE TODAY ! 415/454-0582

CUSTOMER NO. 606715	ADVISOR JAMES F MONAHAN	33	HAT NO. 347	INVOICE DATE 04/09/93	INVOICE NO. RRC585838
	LABOR RATE	LICENSE NO.	MILEAGE 5297	COLOR WHITE/TAN	STOCK NO.
	YEAR / MAKE / MODEL 89/ROLLS ROYCE/SPIRIT/SD			DELIVERY DATE 03/23/90	DELIVERY MILES 65
	VEHICLE ID. NO. S C A Z S 0 2 A Q K C X 2 7 5 9 1			SELLING DEALER NO.	PRODUCTION DATE
MILL VALLEY, CA 94941	F.T.E. NO.	P.O. NO.	R.O. DATE 03/31/93		
REPAIR	COMMENTS				

LABOR & PARTS				
J# 1 OORZI	INSPECT & ADVISE	HOURS:	TECH(S):156 166	162.50
OWNER REQUESTS VEHICLE INSPECTION AND RECOMMENDATION OF REQUIRED MAINTENANCE.				
CHANGED OIL AND FILTER. LUBRICATED CHASSIS. CHECKED AND TOPPED OFF FLUID LEVELS AS REQUIRED.				
JOB # 1	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE
JOB # 1	1	UE-40893	OIL FILTER	28.95
JOB # 1	1	XB-1093-R	WASHER JOINT	2.00
JOB # 1 TOTAL PARTS				30.95



BENTLEY

Bentley San Francisco

999 Van Ness Ave. San Francisco, CA 94109

Phone (415) 776-7700 Fax (415) 292-9977



GENUINE PARTS

Name: Joe Ling Ro# _____ Miles: _____ Date: _____

Year: _____ Make: _____ Model: _____ Vin# _____

6.75 Litre V8 (1980-1989)

24 MONTH/15,000 Mile Service Maintenance Check List

Engine

1. Change engine oil
2. Renew oil filter
3. Check the condition and tension of the engine drive belts
4. Renew air filter element
5. Renew the spark plugs
6. Lubricate throttle linkage
7. Check and adjust ignition timing (other than turbo R)
8. Check and adjust idle speed (where applicable)
9. Check induction system for leaks
10. Check vacuum advance mechanism for correct operation (where applicable)
11. Retorque valve covers
12. Lubricate the distributor

Engine Cooling System

13. Check all coolant hose clamps for tightness
14. Examine the condition of all coolant hoses
15. Check and top-up the coolant level
16. Renew the coolant (every 2 years)
17. Check anti-freeze concentration; correct as needed
18. Remove any foreign matter from the radiator matrix, refrigeration condenser, engine oil cooler and the intercooler matrix (if fitted)

Transmission/Propeller Shaft/Final Drive

19. Check the transmission fluid and top-up as necessary
20. Renew the transmission fluid
21. Lubricate the gear range selector control rod
22. Lubricate the propeller shaft universal joints (where applicable)
23. Check the final drive oil level
24. Renew the final drive fluid
25. Check the condition of the drive-shaft joint covers

Fuel System

26. Renew main fuel filter
27. Check the condition of the fuel tank filler hose
28. Check the condition of all pipes and hoses
29. Check the fuel system for flow and pressure

Exhaust and Exhaust Emission Control System

30. Check exhaust system for leaks and proper adjustment
31. Check and tighten exhaust manifold and takedown pipe bolts

32. Check the operation of the air injection system and check system for leaks
33. Inspect the catalytic converter overheat thermo coupler (if fitted)

Emission Control System

34. Clean the crankcase breather flame trap (where applicable)
35. Check the condition of all evaporative emission system pipes, hoses, and connections
36. Remove and clean the E.G.R. valve and feed pipes
37. Check the E.G.R. valve for correct operation

Steering and Suspension

38. Check the steering pump fluid level, top-up as necessary
39. Lubricate the steering linkage ball joints (where applicable)
40. Check the condition of the steering rack convoluted seals
41. Check the condition of the front suspension ball joints and covers
42. Check the condition of the rear strut convoluted seals
43. Lubricate the leveling valve ball joint
44. Check the condition of the suspension dampers

Brake and Hydraulic System

45. Check the integrity of the reservoir lead tamperproof seal
46. Renew the hydraulic system mineral oil
47. Check the hydraulic reservoirs mineral oil level and top-up as necessary
48. Check the condition of all brake pipes and hoses
49. Check the brake pads for wear. Record readings (% Remaining Fr 90 Rr 90)
50. Check the condition of the brake discs
51. Lubricate and adjust parking brake linkage mechanism
52. Check the parking brake pads for wear
53. Check the hydraulic system accumulator pressures. Record readings #1 min 450 act 725
#2 min 450 act 625
54. Check rear ride height (invoice separately if adjustment required)

Electric system

55. Check the state of charge of the battery. Where possible check the level of the electrolyte
Record readings Specification 12.6 Actual 12.6v
56. Check the standby current draw from battery
57. Inspect the battery terminals, clean and coat them with petroleum jelly
58. Check the alternator for correct operation. Record readings Specification 14.25v Actual 14.3v
59. Check all fascia warning lamps
60. Check the operation of the air bag warning circuit (where applicable)
61. Check the operation of the interior lamps
62. Check the operation of the exterior lamps
63. Replace windscreen wiper blades, check wiper operation
64. Check the operation of the windscreen washers and headlamp washers (if fitted)
65. Check the fluid level in the washer reservoir
66. Check side mirror operation
67. Check the operation of the remote central locking and burglar alarm system (where applicable)
68. Replace the batteries for the remote alarm fobs
69. Check horn operation
70. Check all spare fuses and bulbs (replenish as needed)
71. Interrogate the automatic variable ride system for any store fault codes

Heating/Air conditioning system

- 72. Check that the scuttle intake grilles are free from obstructions
- 73. Check the refrigeration system for proper operation
- 74. Check the heater for proper operation
- 75. Check the defroster for proper operation

Body

- 76. Check the condition and operation of seat belts
- 77. Check that all body drains are free from obstruction
- 78. Lubricate all hinges and locks
- 79. Lubricate the spare wheel lowering bolt
- 80. Check the fluid level in the power operated hood reservoir with hood in the fully down (opened) position (Convertible cars)
- 81. Lubricate the hood frame (Convertible cars)
- 82. Check the condition of the hood to body seal
- 83. Check to see that all seal drains are free from obstruction
- 84. Check the hood to backlight drain tray and drains are free from obstruction (Convertible cars)
- 85. Lubricate all weather stripping
- 86. Tighten interior rear view mirror

Wheels and Tires

- 87. Check all tire pressures (including spare) adjust as necessary LF 24_{psi} LR 28_{psi} SP 32_{psi}
RF 24_{psi} RR 28_{psi}
- 88. Check the condition and tread depth of all tires LF 8_{mm} LR 8_{mm} SP 8_{mm}
RF 8_{mm} RR 8_{mm}
- 89. Lubricate the wheel trim locks. Grease the arms of contact between the wheel and hub

Road test and final inspection

- 90. Road test for satisfactory performance and condition
- 91. Check operation of speed control
- 92. Check for excessive road noise
- 93. After road test recheck fluid levels
- 94. Check for spare mineral oil. Supply if needed
- 95. Read out fault memory (where applicable)
- 96. Reset clock
- 97. Update owners handbook
- 98. Clean and lube antenna mast

Comments: _____

J# 2 12RRZ

Smog Inspection HOURS: TECH(S):117
SMOG CERTIFICATION NOTE: IF VEHICLE FAIL INSPECTION, CUSTOMER
MAY HAVE REPAIRS COMPLETED ELSEWHERE
VEHICLE PASSED INSPECTION
CERTIFICATE #D3695742.

45.00

-----QTY-----FP-NUMBER-----DESCRIPTION-----UNIT PRICE-----
JOB # 2 TOTAL PARTS 0.00

JOB # 2 TOTAL LABOR & PARTS 45.00

J# 3+42RRZ

BRAKES HOURS: TECH(S):156 166
EXAM REVEALED DIST VALVE LEAKING
EXAMINATION REVEALED #1 & #2 DISTRIBUTION VALVES LEAKING.
OVERHAULED #1 & #2 DISTRIBUTION VALVES AND BLEED SYSTEMS.

WARRANTY

-----QTY-----FP-NUMBER-----DESCRIPTION-----UNIT PRICE-----

JOB # 3
JOB # 3
JOB # 3

4 UR-27053
1 BC
2 XB-1092-R

BOTTLE PACK 12 CTN
BRAKE/CLE
WASHER JOINT

WARRANTY
WARRANTY
WARRANTY

JOB # 3 TOTAL PARTS 0.00

JOB # 3 TOTAL LABOR & PARTS 0.00

J# 4+01RRZ

CYL-HEAD/OIL LEAKS HOURS: TECH(S):156 166
EXAM REVEALED OIL COOLER LINES LEAKING
INSTALLED UPDATED COOLER HOSES.

WARRANTY

-----QTY-----FP-NUMBER-----DESCRIPTION-----UNIT PRICE-----

JOB # 4

1 TY-794

OILCOOLER HOSE KIT

WARRANTY

JOB # 4 TOTAL PARTS 0.00

JOB # 4 TOTAL LABOR & PARTS 0.00

G.O.G. & SUPPLIES

JOB # 1 10.0 20W50 MOTOR OIL e 2.500 7UNIT

TOTAL - GOG 25.00

25.00

MISC

JOB # 1 HO HAZARDOUS WASTE: ENGINE OIL
JOB # 2 SM SMOG CERTIFICATE

1.40

7.00

TOTAL - MISC 8.40

ESTIMATE
CUSTOMER HEREBY ACKNOWLEDGES RECEIVING
ORIGINAL ESTIMATE OF \$290.00 (+TAX)

540 Francisco Boulevard West Telephone 415-454-0582
San Rafael, CA 94901-3925 FAX 415-457-9121

RAB MOTORS

B.A.R. # AB 006021
EPA ID # CAD 982970223

PAGE 1 OF 2

[CONTINUED ON NEXT PAGE]

10:25:48