171495

HORNBURG JAGUAR "The Oldest Jaguar Dealer in the West"

INVOICE

LAND= ROVER

DONN DABNEY 255 W NAPA ST SUITE E

PAGE 1

1520 N. WILCOX AVE. · HOLLYWOOD, CA 90028 PHONE: (323) 469-7271

SONOMA, CA 95476 HOME: CONT: 707-332-8331 www.hornburgla.com CELL: 707-332-8331 SERVICE ADVISOR: BUS: 105 LARRY JOHNSON COLOR YEAR MAKE/MODEL VIN LICENSE MILEAGE IN / OUT TAG EBONY 06 JAGUAR XJ LWB SAJWA79B16SH06738 61508/61508 T1847 DEL. DATE PROD. DATE WARR. EXP. **PROMISED** PO NO. RATE **PAYMENT** INV. DATE 18JAN07 DD 17JAN201 WAIT 15MAY13 CASH 0.00 15MAY13 R.O. OPENED READY OPTIONS: ENG: 4.2 Liter DOHC 12:11 15MAY13 11:15 15MAY13 LINE OPCODE TECH TYPE HOURS LIST NET TOTAL A DO OIL CHANGE SERVICE 02 Y 122 CJS 23.00 23.00 1 C2C41611 FILTER-OIL 20.10 20.10 20.10 1 JZH100062 PLUG-OIL SUMP DR 7.70 7.70 7.70 8 E-45 5W30 OIL 4.98 4.98 39.84 1 BG110 MOA 13.50 13.50 13.50 MISC OIL WASTE CJS 2.40 2.40 PARTS: 81.14 LABOR: 23.00 OTHER: TOTAL LINE A: 2.40 106.54 61508 service lof ********************* B Multi-Point Inspection Jaguar 99PJ Multi-Point Inspection Jaquar 0.00 CJ RTIRE TIRE TREAD WEAR CHECKED. MINIMAL TREAD REMAINING. TIRE REPLACEMENT RECOMMENDED 122 CJ 0.00 0.00 0.00 OTHER: LABOR: 0.00 0.00 disting T.TNE 0.00 61508 inspection rec 4 tires and alignment POLLEN FILTER DIRTY AND CLOGGED WITH LEAVES AIR FILTER DIRTY NEEDS AIR MASS SENSOR AND THROTTLE BODY CLEANED TIRES WORN TO 4/32 AND REAR TIRES WORN ON INSIDE EDGES C CUSTOMER STATES RESET ALL TIRE PRESSURES TP CUSTOMER STATES RESET ALL TIRE PRESSURES (N/C)122 ISPJ TOTAL LINE C: 0.00 LABOR: 0.00 0.00 OTHER: 0.00 61508 set pressures lf32/rf32/rr32/lr32 ***************

NOTICE TO CUSTOMERS WE MAKE A SEPARATE CHARGE FOR THE STORAGE AND DISPOSAL OF TOXIC WASTES. RATHER THAN RECOVER THESE COSTS BY INCREASEING OUR LABOR RATES TO ALL OF OUR SERVICE CUSTOMERS, WE MAK THIS CHARGE ONLY ON THOSE PARTICULAR REPAIRS OR SERVICES WHICH GENERATE THESE WASTES. THESE ARE UNIFORM CHARGES WHICH ARE CALCULATED ANNUALLY FOR EACH PARTICULAR SERVICE AND ARE AVAILABLE ON REQUIEST. REQUEST.

STATEMENT OF DISCLAIMER The factory warranty constitutes all The factory warranty constitutes all of the warranties with respect to the sale of this item/items. The Seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

CUSTOMER SIGNATURE

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY	

Notice to Consumer: Please read important information on back.

THIS AMOUNT BAR # ARD215465

EPA # CAL000223346

CUSTOMER #: 72620

171495

HORNBURG JAGUAR "The Oldest Jaguar Dealer in the West"

INVOICE

LAND-ROVER

DONN DABNEY 255 W NAPA ST SUITE E 1520 N. WILCOX AVE. · HOLLYWOOD, CA 90028

SONOMA, CA 95476

HOME:

EST: 115.00

BUS:

CONT: 707-332-8331 CELL: 707-332-8331

PAGE 2

SERVICE ADVISOR:

PHONE: (323) 469-7271

CASH

www.hornburgla.com 105 LARRY JOHNSON

NET

15MAY13

TOTAL

COLOR MAKE/MODEL YEAR VIN LICENSE MILEAGE IN / OUT TAG EBONY 06 JAGUAR XJ LWB SAJWA79B16SH06738 61508/61508 T1847 DEL. DATE PROD. DATE WARR, EXP. PROMISED PO NO. RATE PAYMENT INV. DATE

8JAN07 DD 17JAN201 WAIT 15MAY13 R.O. OPENED READY OPTIONS: ENG: 4.2 Liter DOHC

11:15 15MAY13 12:11 15MAY13 LINE OPCODE TECH TYPE HOURS

> 15MAY13 11:15 SA: 105



.00

LIST

MAY 15 PAID

DESCRIPTION

NOTICE TO CUSTOMERS WE MAKE A SEPARATE CHARGE FOR THE STORAGE AND DISPOSAL OF TOXIC WASTES. RATHER THAN RECOVER THESE COSTS BY INCREASEING OUR LABOR RATES TO ALL OF OUR SERVICE CUSTOMERS, WE MAK THIS CHARGE ONLY ON THOSE PARTICULAR REPAIRS OR SERVICES WHICH GENERATE THESE WASTES. THESE ARE UNIFORM CHARGES WHICH ARE CALCULATED ANNUALLY FOR EACH PARTICULAR SERVICE AND ARE AVAILABLE ON REQUEST.

STATEMENT OF DISCLAIMER The factory warranty constitutes all of the warranties with respect to the sale of this item/items. The Seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

CUSTOMER SIGNATURE

LABOR AMOUNT	23.00
PARTS AMOUNT	81.14
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES	2.40
TOTAL CHARGES	106.54
LESS INSURANCE	0.00
SALES TAX	7.30
PLEASE PAY THIS AMOUNT	113.84

Notice to Consumer: Please read important information on back.

BAR # ARD215465

113.84 EPA # CAL000223346

TOTALS

Jaguar Multi-Point Inspection Report

Hornburg Jaguar La 1520 N. Wilcox Los Angeles, Ca, 90028 90069



The Jaguar Multi-Point Inspection is a series of thorough vehicle "health checks" and visual examinations performed by our factory-trained technicians. The focus of this complimentary service is to ensure that your Jaguar vehicle continues to perform at an optimum level, as well as to help minimize your chances of being inconvenienced while on the road.

In the event that additional service is recommended on a listed item, your Service Advisor will be happy to speak with you about service options.

Oonn Dabney	2006		
ustomer Name 71495 T1847 61508	Year/Model SAJWA79B16SH06738	Engine Size	
7/493 11047 01506 0/Tag Mileage	VIN VIN	05/15/201 Date	3
Checked and Okay at this Time	May Require Future Attention*	Requires Immediate Attention	P) In the last
Check Fluid Levels and Fill		Check Battery	
OK FILL OK FILL	Good Recharge		ESCHARION .
Engine Oil Brake Res		a bag	
Windshield Washer Headlamp		Check Brakes	
Power Steering Coolant Re	ecovery Reservoir Measure F	ront / Rear Brake Linings	
Transmission (if equipped w/ dipstick)	RF 🚳 🗸 🐞	RR 🖋	
Check Following Systems / Compo	nents		
 Operation of horn, interior lights, exterior signals, hazard and brake lamps 	lamps, turn		N
 Visually inspect headlamp alignment 			
Windshield washer spray, wiper operation	and wiper blades		
Windshield cracks and/or chips			
Heating, ventilation and air conditioning c	heck		/
Heating, ventilation and air conditioning of Engine air cleaner filter Oil and/or fluid leaks		10 1	
Oil and/or fluid leaks		LR •	•
Constant velocity (CV) drive axle boots (if	equipped) 0	er 5mm or 7/32"	
Exhaust system (leaks, damage, loose par	rts) 3 to 5	mm or 4/32" to 7/32"	
Steering and steering linkages	Less	than 2mm or 3/32"	
Shocks/struts, air suspension and other s components for leaks and/or damage	uspension Brake Measureme	nts Not Taken This Service Visit	
Brake system (including lines, hoses and	parking brakel	Check Tires	
 Engine cooling system, hoses and clamps 	LF	TREAD DEPTH	F
Radiator, heater and air conditioning hoses		7/32" or Grea	
Accessory drive belt(s)	▼ 4/32" to 6/32"	4/32" to 6/3 3/32" or Le	
Clutch operation (if equipped)	■ 3/32" or Less	3/32 01 26	255 4
Navigation map update required	7/32" or Greater	7/32" or Grea	ter (
State inspection due (if applicable)	// Vear	4/32" to 6/3 3/32" or Le	
Your last completed maintenance		RF O	V F
Your next factory scheduled maintenance Mile	is due at .5 /14	ar Pattern / Damage RR Tire Wear Indicates d Wheel Balance Needed	1
This Courtesy Inspection Completed By Your Jagu	ar Service Team		
ervice Advisor: Larry Johnson	Tire Pressure Set to Factory Recommendations	PSI 32 Front 32 Rear	
Alvara Payes	*Brake/tire replacement will be requir	ed prior to the next 10,000 mile scheduled mainte	nance s
echnician: Alvaro Reyes			

Comments:

Windshield washer spray, wiper operation and wiper blades: wipers worn

Heating, ventilation and air conditioning check: dirty, contaminated

Hornburg Jaguar La 1520 N. Wilcox Los Angeles, Ca, 90028 90069



Factor of the Current	
Engine air cleaner filter: dirty, contaminated	
Oil and/or fluid leaks: trans sleeve	
Your next factory scheduled maintenance is due at: next 10,000 f	or 12 months
Left Front Brake Linings: 5mm	
Right Front Brake Linings: 5mm	
Left Rear Brake Linings: 7mm	
Right Rear Brake Linings: 7mm	
Left Front Tread Depth: 4/32	
Right Front Tread Depth: 4/32	
Left Rear Tread Depth: 4/32	
Right Rear Tread Depth: 4/32	
	-
	k k





Payment Summary

Date printed: Jun-11-13

Status:

Paid with PayPal on May-31-13.

Seller: Buyer: americanmotorparts leftcoastclassics

Shipping

Seller should ship to:

Donn W Dabney 839 Oakwood Dr Sonoma CA 95476-3229 **United States**

Payment

Item Name Top Deal Particulate Cabin Air Filter 05-09 Jaguar XJ8 05-09 Jaguar XJR C2C6884

290924496178 - Price: US \$11.94

Shipping

Standard Shipping : FREE UPS Ground Estimated delivery: Tue. Jun. 4 - Mon. Jun. 10

Qty

Price

US \$11.94

Subtotal:

US \$11.94 FREE Shipping & handling:

CA sales tax:

US \$0.96

US \$12.90 Total:

You've earned \$0.24 in eBay Bucks. See conditions.

Payment instructions:

PLEASE COMPLETE CHECKOUT FOR PAYMENT INSTRUCTIONS.

Payment details:

PayPal

MARIN LUXURY CARS

195 Casa Buena Drive Corte Madera, CA 94925 (415) 460-6096 Fax: (415) 496-2168

www.marinluxurycars.com

(2640513





ALL CLAIMS AND RETURNED GOODS MUST BE ACCOMPANIED BY THIS INVOICE. NO RETURNS ON ELECTRICAL OR SPECIAL ORDER PARTS.

NO RETURNS AFTER 30 DAYS. 30% RE-STOCK CHARGE ON ALL RETURNED PARTS.

120100

DISCLAIMER OF WARRANTIES

Any warranties on the product sold hereby are those made by the manufacturer. The seller hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products.

DATE ENTERED 8 APR 13	YOUR ORDER NO.	DATE SHIPPED 08 APR 13	INVOICE DATE 08 APR 13	INVOICE NUMBER	120100	09:46
S O L	ACCOUNT N	O. J99	S H		PAGE 1 OF	7 1
D RET	AIL CASH		P RETAIL C	CASH		A Lange

SHIP VIA	SLSM. B/L NO.	TERMS		F.O.B. P	OINT	
	287	CASH			RTE MADERA,	CA
GUANTITY GRD GRD	PART NO.	DESCRIPTION	LIS'T	NET	AMOUNT	
7 7	0 C2D27159	1 SWITCH-SEC	35.61	19.25	19.25	
				1		
	e i i i i i i i i i i i i i i i i i i i					
,						
	ON SPECIAL ORDERS				19.25	
	RETURNS SUBJECT I			W S		
W KETURN	S AFTER 30 DAYS	FREIGI			0.00	
	CUSTOMER'S SIGNAT	SALES	TAX		1.64	
	×		TOTAL		\$20.89	

Page 1

6819 Redwood Dr. Ste A-D Cotati, CA 94931

Phone: 707 792-2737 FAX: 707 792-4454

230919006

Labor: \$237.60

Labor: \$290.40

Order Date 09/19/13 05:06 pm Completed: 09/23/13 01:14 pm

4349

Dabney, D(Lft Coast)

839 Oakwood Dr.

rover

SONOMA CA 95476 Mobile: 707-332-8331

06 JAGUAR XJ8 BLACK

Mileage in:70570 out: Lic: 6SRL855/CA V8Cyl 4.2

Vin: SAJWA79B16SH06738 01/06

Eq: AT AC PS FI

Profile:

Quotes

1 09/19/13 05:23pm 132.00

Donn in person.

4349

resale dealer cost

Job01 Overheating-Wiring Repairs

Check engine overheating, towed to shop Checked level, ran engine checked cooling fan operation With scan tool connected watch engine temp and fan control, no fan Raised vehicle and traced fault to electrical wiring had been cut by drive belt

contact

Re-route and re-insulate wiring.
Recheck fan operation with scope and watch temperature rise, fan going to med speed, force fan to high speed, still getting hot, recommend replacement

thermostat housing assembly

Status: Completed Tech: BP

Job Subtotal: \$237.60

Job02 (H8/)04-Thermostat-Assembly

Drain cooling system and hoses as required Disconnect and remove thermostat housing and clean all surfaces Install replacmeent parts as needed

Add clean coolant and run system to operating temperature

Check system and heater operation

AJ811793 THERMOSTAT ASSEMBLY-N 1.0 @ 141.75 = \$141.75 AFPXA003 ANTIFREEZE/COOLANT (pnt-N 16.0 @ 2.43 = \$38.88 180.63

Status: Completed Tech: BP

Job Subtotal: \$471.03

Job03 Coolant Expansion Tank Labor: \$52.80

Install replacement tank and top off fluid.

C2Z13764 EXPANSION TANK(xj8/S04-N 1.0 @ 170.31 =\$ 170.31 170.31

Status: Completed Tech: BP

Job Subtotal: \$223.11

----->--->--->--->---->---->---->

Page 2

6819 Redwood Dr. Ste A-D

Cotati, CA 94931 Phone: 707 792-2737 FAX: 707 792-4454

Invoice No. 230919006

Order Date 09/19/13 05:06 pm Completed: 09/23/13 01:14 pm

4349

Tire Pressure: needs tires and alignment

by paying by check, you authorize us or our agent to process the check by traditional deposit, electronically, or through a 'preauthorized draft.'If the check is returned for any reason, you authorize us or our agent to re-present the check one or more times by such methods, and you authorize us or our agent to collect a returned check fee up to the maximum amount as permited by law.

Payments to British European Motors	Cost Summar	У
Status: Completed Work Order Payments:	Labor Parts Discount Freight Subtotal Total Payments Bal Due	580.80 350.94 149.08 15.00 797.66 \$797.66 0.00 797.66

Thank you for choosing British European Motors

Date: 10/31/2013 12:35:39 PM

Subject: Tire Rack :: Order Confirmation

From: "Tire Rack" <orders@email.tirerack.com> **Recipients:** <MOREOLDCARS@COMCAST.NET>;

Join Us On 🕴 💟 You Tube "

Trouble viewing this email? You can see it online here.

888-727-8092

PRODUCTS

SHOPPING TOOLS

Thank You for Shopping at Tire Rack

Your order is currently being reviewed and processed. As soon as it leaves our distribution center you will receive a shipment confirmation via email as well.

Order Information

UPGRADE GARAGE

Customer Number: 1519058-000

Billing Address: Donn W Dabney

839 Oakwood Dr Sonoma, CA 95476

707-332-8331

Shipping Address:

Donn W Dabney 839 Oakwood Dr Sonoma, CA 95476

707-332-8331

Questions?

Please refer to your customer number at left and order number(s) below when calling.

Products & Shipping

If you have questions about the products you have ordered, order status or other customer service matters, please call 888-981-3953 or email custsvc@tirerack.com.

Installation

Do you need help with installation? Select one of our Recommended Installers to handle your installation needs.

Tire & Wheel Package installation instructions are also available.

Via: UPS Ground

From: McCarran, NV

PRODUCTS ORDERED

CALL NAME OF	THE THE R. LEWIS CO., LANSING MICH. LANSING, MICH.			
Qty	Size and Description	Availability	Price Each	Total Price
4	235/50R-18 Kumho Ecsta PA31 Download Warranty Brochure PDF	In Stock	\$120.00	\$480.00

Note: As a complimentary service to you, the Tire Identification Codes for the tires you purchased will be automatically registered with the Department of Transportation (DOT).

VEHICLES

Some products above selected for the following vehicle(s):

Vehicle: 06 Jaguar XJ8L

Shipping:

\$57.66

TRACK THIS ORDER >>

Order Total Including Shipping:

\$537.66

Additional Information Related to This Order:

235/50R-18 Kumho Ecsta PA31

Your Price \$54.00



Order details

Sold by usdirectparts (6479)

Delivery package 1 of 1

Estimated delivery Tuesday, Nov 5, 2013 - Tuesday, Nov 12, 2013



[FRONT KIT] Reliance *OE REPLACEMENT* Disc Brake Rotors *Plus Ceramic Pads F2015

Item price

\$123.30

Quantity

Item number

121056860306

Shipping service UPS Ground



7101 Vorden Parkway South Bend, IN 46628-8422 Phone: (574) 287-2345 800: (800) 428-8355 Customer Service: Ext. 4360 Fax: (574) 236-7707



INVOICE

NO34834 INVOICE DATE PAGE 10/31/13 1

RP60721154

11/01/13 5:27:56

BILL TO:

1519058-000 Dabney, Donn W 839 Oakwood Dr Sonoma CA 95476 3229

SHIP TO:

1519058-000 Dabney, Donn W 839 Oakwood Dr Sonoma CA 95476 3229

SHIP-TO PHONE: 707-332-8331

SHIP METHOD: UPS Ground

ORDER DATE SALES REP.NAME/PHONE EXT TERM		ERMS MAKE, MODEL AND YEAR			WHSE			
10/31/13 ECOM	MERCE OR			XJ8 L 6		NV		
PART NUMBER QUA		QUANTITY SHIPPED	GROUP	DESCRIPTION	UNIT PRICE	EXTENSION		
35VR8PA31 2161403 REGCARDR REGISTRATIONR	1	1		235/50R18 KU ECSTA PA31 2161403 97V FIND WARRANTY DETAILS @ WWW.TIRERACK.COM/KU1013 Tire DOT Number registration has been filed electronically Subtotal Freight Charge VISA PAYMENT Total Payment	120.00 N/C 537.66-	480.00 480.00 57.66 537.66-		
				Total Amount Due	DAI	\$.00 U		

175290

HORNBURG JAGUAR "The Oldest Jaguar Dealer in the West"

INVOICE

LAND-<ROVER</pre>

ONN DABNEY 255 W NAPA ST STE E

COLOR

PARTS:

30NOMA, CA 95476-6546

PAGE 1

1520 N. WILCOX AVE. · HOLLYWOOD, CA 90028 PHONE: (323) 469-7271

www.hornburgla.com

TOTAL

23.00

20.10

0.00

0.00

CONT: 707-332-8331 HOME: BUS:

5914 MICHAEL COLAVITTI SERVICE ADVISOR: TAG CELL: 707-332-8331 MILEAGE IN / OUT LICENSE VIN MAKE/MODEL YEAR 73053/73053 SAJWA79B16SH06738 INV. DATE JAGUAR XJ LWB PAYMENT RATE PO NO. PROMISED

06 EBONY PROD. DATE | WARR, EXP. DEL. DATE 13NOV13 CASH 0.00 WAIT 13NOV13 17JAN2011

ENG:4.2 Liter DOHC 18JAN07 DD OPTIONS: READY R.O. OPENED

15:16 13NOV13

NET LIST 11:25 13NOV13 LINE OPCODE TECH TYPE HOURS A CUSTOMER REQUESTS OIL AND FILTER CHANGE, INSPET TIRE PRESSURE AND ALL

OTHER FLUIDS 23.00 LOF + 20.10 1515 CJS 20.10

11.85 1 C2C41611 FILTER-OIL 11.85 11.85 1 JZH100062 PLUG-OIL SUMP DR 54.00 6.75 6.75 108.95 8 E-45 CASTROL GTX 5W30 TOTAL LINE A: 0.00 23.00 OTHER: LABOR:

PARTS: 73053 0.55 performed LOF service ****************

B Multi-Point Inspection Jaguar 99PJ Multi-Point Inspection Jaguar

0.00 1515 CJ 0.00 LABOR: TOTAL LINE B: 0.00 3 OTHER: 0.00

*********** 73053 mpi C CUSTOMER STATES RESET ALL TIRE PRESSURES TP CUSTOMER STATES RESET ALL TIRE PRESSURES

(N/C)0.00 1515 ISPJ TOTAL LINE C: 0.00 OTHER: 0.00 LABOR: 0.00 PARTS: 73053

L/F 30, R/F 30 L/R 32, R/R 32

D *CUSTOMER STATES PLEASE CHECK FRONT END SHOCKS AND BUSHINGS FOR WEAR.

60 FRONT SUSPENSION 0.00 0.00 1515 CJ 0.00 TOTAL LINE D: 0.00 0.00 OTHER: LABOR:

0.00 PARTS: 73053 front bushings leaking. customer declined repair

13NOV13 11:25 SA: 5914 EST: 116.00

707-332-8331

NOTICE TO CUSTOMERS WE MAKE A SEPARATE CHARGE FOR THE STORAGE AND DISPOSAL OF TOXIC WASTES. RATHER THAN RECOVER THESE COSTS BY INCREASEING OUR LABOR RATES TO ALL OF OUR SERVICE CUSTOMERS, WE MAK THIS CHARGE ONLY ON THOSE PARTICULAR REPAIRS OR SERVICES WHICH GENERATE THESE WASTES. THESE ARE UNIFORM CHARGES WHICH ARE CALCULATED ANNUALLY FOR EACH PARTICULAR SERVICE AND ARE AVAILABLE ON REQUIEST REQUEST.

STATEMENT OF DISCLAIMER The factory warranty constitutes all of the warranties with respect to the sale of this item/items. The the sale of this item/items. The Seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

TOTALS DESCRIPTION 23.00 LABOR AMOUNT 85.95 PARTS AMOUNT 0.00 GAS, OIL, LUBE 0.00 SUBLET AMOUNT 0.00 MISC. CHARGES 108.95 TOTAL CHARGES LESS INSURANCE 0.00 SALES TAX 7.74 PLEASE PAY

HOW 1 3 2013

CUSTOMER SIGNATURE

THIS AMOUNT BAR # ARD215465

116.69 EPA # CAL000223346

Jaguar Multi-Point Inspection Report



- Hornburg Jaguar La 1520 N. Wilcox Los Angeles, Ca, 90028 90069

The Jaguar Multi-Point Inspection is a series of thorough vehicle "health checks" and visual examinations performed by our factory-trained technicians. The focus of this complimentary service is to ensure that your Jaguar vehicle continues to perform at an optimum level, as well as to help minimize your chances of being inconvenienced while on the road.

In the event that additional service is recommended on a listed item, your Service Advisor will be happy to speak with you about service options.

Donn Dabney	2006	w		
sustomer Name 75290 T001 73053	Year/Model SAJWA79B16SH06738	Engine Size	11/13/2013	
75290 T001 73053 Mileage	VIN		Date	
	re Future Attention*	Requires Immed	diate Attention	
Check Fluid Levels and Fill	Chec	ck Battery		
OK FILL OK FILL	Good Recharge	Bad		
Engine Oil Brake Reservoir		- The second sec		
Windshield Washer Headlamp Washer	Moacure Front	ck Brakes / Rear Brake	Lininas	
Power Steering Coolant Recovery Reservo	ir preasure from	/ Near Droke	/	
Transmission (if equipped w/ dipstick)	RF 🌑 🔅 🕷		RR 🕷 🌼 🌑	
Check Following Systems / Components				
 Operation of horn, interior lights, exterior lamps, turn signals, hazard and brake lamps 				
Visually inspect headlamp alignment			M I	
Windshield washer spray, wiper operation and wiper blad	es			
Windshield cracks and/or chips				
Heating, ventilation and air conditioning check			5	
Engine air cleaner filter	IF @		LR W	6
Oil and/or fluid leaks		41000		50000
Constant velocity (CV) drive axle boots (if equipped)	Over 5	mm or 7/32"		
Exhaust system (leaks, damage, loose parts)	3 to 5mm	or 4/32" to 7/	32"	
Steering and steering linkages	Less tha	n 2mm or 3/3	2"	1
 Shocks/struts, air suspension and other suspension components for leaks and/or damage 	Brake Measurements N	lot Taken This S	Service Visit	
Brake system (including lines, hoses and parking brake)		eck Tires		
Engine cooling system, hoses and clamps	LF, TR	EAD DEPTH		F
Radiator, heater and air conditioning hoses for leaks / dam		170	7/32" or Greater	1
Accessory drive belt(s)	4/32" to 6/32" 3/32" or Less	JWA I	4/32" to 6/32" 3/32" or Less	-
Clutch operation (if equipped)	3/32 of Less	汉宋	0/02 0/ 2003	
Navigation map update required	7/32" or Greater	N. W.	7/32" or Greater	- (
State inspection due (if applicable)//	1/22" to 1/22" 3/32" or Less		4/32" to 6/32" 3/32" or Less	
Month Day Year	LR	Commission, and the commission	0,02 0, 2000	F
Your last completed maintenance ; Mileage ; Month	Year J O I E		RF .	
Your next factory scheduled maintenance is due at Mileage; Month	Year LR Tire	Wear Indicates	RR 🕯	1
	Alignment Check Needed	vviieet r	Balance Needed	
This Courtesy Inspection Completed By Your Jaguar Service Te	Tire Pressure Set to		No.	
Service Advisor: Michael Colavitti	Factory Recommendations PS		NO CONTRACTOR AND PROPERTY OF THE PERSON NAMED IN CONTRACTOR OF THE PERSON	
Technician: Doug Ross	*Brake/tire replacement will be required pri	or to the next 10,000 r	nile scheduled maintenan	ice
Customer Signature:				
mments:				
gine Oil: lof	9			

- Hornburg Jaguar La 1520 N. Wilcox Los Angeles, Ca, 90028 90069



Comments:
Shocks/struts, air suspension/ other suspension for leaks and/or damage: hydro bush
Left Front Brake Linings: 3mm
Right Front Brake Linings: 3mm
Left Rear Brake Linings: 8mm
Right Rear Brake Linings: 8mm
Left Front Tread Depth: 10/32
Right Front Tread Depth: 10/32
Left Rear Tread Depth: 10/32
Right Rear Tread Depth: 10/32

255 W NAPA JI STE E

SONOMA, CA 95476-6546

DONN DABNEY -

177790



INVOICE

LAND> -ROVER

1520 N. WILCOX AVE. · HOLLYWOOD, CA 90028

PHONE: (323) 469-7271

NET

TOTAL

13.50

PAGE 1

LIST

BUS:		CELL: 707-		SER	VICE ADVISOR:	5551042	REID ST		
COLOR	YEAR	MAKE/MODEL			VIN	LICENSE	NAMES OF TAXABLE PARTY OF TAXABLE PARTY OF TAXABLE PARTY.	IN / OUT	TAG
EBONY	06	JAGUAR XJ LV	VB	SAJWA	79B16SH06738		81178	/81178	T3616
DEL. DATE	PROD.	DATE WARR. EXP.	. EXP. PROMIS		PO NO.	RATE	PAYMENT		DATE
18JAN07 DI		17JAN2011	WAIT 12	2MAR14		0.00	CASH	12MAR	14

R.O. OPENED READY OPTIONS: ENG: 4.2 Liter DOHC

08:08 12MAR14 09:29 12MAR14 LINE OPCODE TECH TYPE HOURS

.00
.00

81178 PERFORM MPI

B CUSTOMER STATES RESET ALL TIRE PRESSURES TP CUSTOMER STATES RESET ALL TIRE PRESSURES

CONT: 707-332-8331

136 ISPJ (N/C)PARTS: 0.00 LABOR: 0.00

0.00 OTHER: 0.00 TOTAL LINE B: 81178 LF 30 RF 30 LR 32 RR 32

C CUSTOMER REQUESTS OIL CHANGE

02 LOF

136 CJS 23.00 23.00 , 20 10 1 C2C41611 FILTER-OIL 20.10 20.10 11.85 1 JZH100062 PLUG-OIL SUMP DR 11.85 11.85 11.85 7.84 8 E-45 CASTROL GTX 5W30 7.84 62.72 13.50 13.50

1 BG110 MOA MISC OIL WASTE

CJS 2.40 2.40 PARTS: 108.17 LABOR: 23.00 OTHER: TOTAL LINE C: 133.57

2.40 81178 LOF

EST: 140.00

12MAR14 08:08 SA: 5551042

MAR 1 2 PAID

DESCRIPTION

NOTICE TO CUSTOMERS WE MAKE A SEPARATE CHARGE FOR THE STORAGE AND DISPOSAL OF TOXIC WASTES. RATHER THAN RECOVER THESE COSTS BY INCREASEING OUR LABOR RATES TO ALL OF OUR SERVICE CUSTOMERS, WE MAK THIS CHARGE ONLY ON THOSE PARTICULAR REPAIRS OR SERVICES WHICH GENERATE THESE WASTES. THESE ARE UNIFORM CHARGES WHICH ARE CALCULATED ANNUALLY FOR EACH PARTICULAR SERVICE AND ARE AVAILABLE ON REQUIEST.

STATEMENT OF DISCLAIMER The factory warranty constitutes all of the warranties with respect to the sale of this item/items. The Seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items. item/items.

CUSTOMER SIGNATURE

LABOR AMOUNT 23.00 PARTS AMOUNT 108.17 GAS, OIL, LUBE 0.00 SUBLET AMOUNT 0.00 MISC. CHARGES 2.40 TOTAL CHARGES 133.57 LESS INSURANCE 0.00 SALES TAX 9.74 PLEASE PAY

Notice to Consumer: Please read important information on back.

BAR # ARD215465

THIS AMOUNT

143.31 EPA # CAL000223346

TOTALS

Jaguar Multi-Point Inspection Report

Hornburg Jaguar La 1520 N. Wilcox Los Angeles, Ca, 90028 90069



The Jaguar Multi-Point Inspection is a series of thorough vehicle "health checks" and visual examinations performed by our factory-trained technicians. The focus of this complimentary service is to ensure that your Jaguar vehicle continues to perform at an optimum level, as well as to help minimize your chances of being inconvenienced while on the road.

In the event that additional service is recommended on a listed item, your Service Advisor will be happy to speak with you about service options.

Donn Dab		2006	
Customer N 177790 T3		Year/Model Engine Si: SAJWA79B16SH06738	ze 03/12/2014
RO/Tag	Mileage	VIN	Date
Ch	ecked and Okay at this Time May Require	Future Attention* Requires In	nmediate Attention
	Check Fluid Levels and Fill	Check Batter	
OK FILL	OK FILL	1	2
V ,	Engine Oil Brake Reservoir	Good Recharge Bad	
	Windshield Washer Headlamp Washer	Check Brakes	
V	Power Steering Coolant Recovery Reservoir	Measure Front / Rear Br	ake Linings
	Transmission (if equipped w/ dipstick)	RE M	RR • •
	Check Following Systems / Components		KIK 😈 💮 🐷
4	Operation of horn, interior lights, exterior lamps, turn signals, hazard and brake lamps		
4	Visually inspect headlamp alignment		
0, 1	Windshield washer spray, wiper operation and wiper blades	1000000	
0, 0	Windshield cracks and/or chips		
6,	Heating, ventilation and air conditioning check		
6.	Engine air cleaner filter		1
8,00	Oil and/or fluid leaks	LF 🕷 🌑	LR 🕷 🌎 🌑
8,00	Constant velocity (CV) drive axle boots (if equipped)	Over 5mm or 7/	32"
6,00	Exhaust system (leaks, damage, loose parts)	3 to 5mm or 4/32" t	o 7/32"
6,00	Steering and steering linkages	Less than 2mm or	3/32"
d	Shocks/struts, air suspension and other suspension components for leaks and/or damage	Brake Measurements Not Taken T	
0,0	Brake system (including lines, hoses and parking brake)	Check Tires	
6,00	Engine cooling system, hoses and clamps	LF, TREAD DEPTH	
4 , • •	Radiator, heater and air conditioning hoses for leaks / damage	7/32" or Greater	7/32" or Greater
0,00	Accessory drive belt(s)	4/32" to 6/32"	4/32" to 6/32"
Ø, 0	Clutch operation (if equipped)	3/32" or Less	3/32" or Less
6	Navigation map update required	7/32" or Greater	7/32" or Greater
	State inspection due (if applicable)/	4/32" to 6/32" 3/32" or Less	4/32" to 6/32" 3/32" or Less
6	Your last completed maintenance ; / Month Year	LR	J/02 01 Less
	Your next factory scheduled maintenance is due at ; / / /	LF Wear Pattern / Dama LR Tire Wear Indicate	RR W
This face	tory Increasion Completed B. Verral	Alignment Check Needed Who	eel Balance Needed
	tesy Inspection Completed By Your Jaguar Service Team sor: Reid Stolz	Tire Pressure Set to Factory Recommendations PSI Fr	ont Rear
		*Brake/tire replacement will be required prior to the next 10,	
echnician:	Mitchell Low		
Sustomer S	gnature:		

8534 12/09

Left Front Brake Linings: 10MM

Hornburg Jaguar La 1520 N. Wilcox Los Angeles, Ca, 90028 90069



Comments:
Right Front Brake Linings: 10MM
Left Rear Brake Linings: 10MM
Right Rear Brake Linings: 10MM





14:44

HORNBURG JAGUAR

"The Oldest Jaguar Dealer in the West"
1520 N. Wilcox Ave. · Hollywood, California 90028
PHONE: (323) 469-7271 FAX: (323) 461-0934
WHOLESALE DIRECT LINE: 1(800) HORNBURG
467-6287



PARTS DEPARTMENT HOURS: MONDAY - FRIDAY 8:00 A.M. TO 5:30 P.M.

DISCLAIMER OF WARRANTIES - Any warranties on the products sold hereby are those made by the manufacturer. The Seller, HORNBURG JAGUAR, hereby expressly disclaims all warranties, either expressed or implied, including any implied warranty of merchantability or fitness for a particular purpose, and HORNBURG JAGUAR neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products.

ABSOLUTELY NO RETURNS ON ELECTRICAL OR SPECIAL ORDERED PARTS. - Return of any parts will be at the sole discretion of HORNBURG JAGUAR in accordance with JAGUAR return policies. Any parts deemed returnable are subject to a 15% handling charge unless due to defective parts. No parts may be returned after 10 days and no refund without this invoice. Parts accepted for return must be in original container, resalable condition and show no signs of installation or use.

I have read, understood and accept all provision of the statements.

RECEIVED BY

DATE ENTE	RED Y	OUR ORDER NO.	DATE SHIPPED	INVOICE DATE	INVOICE		
25 JUL	14		25 JUL 14		NUMBER	60080	
S O L		ACCOUNT NO.	. 10	S H I P		PAGE 1 OF 1	
T O	RETAI	L CASH		T O			

HIP VIA	ISLSM. B/L NO.	artier entwice	TERMS		F.O.B.	POINT		
	906		CASH		H	OLLYWO	OD, CA	
QUANTITY	PART NO.	DESCR		LIST	NET	AMO	UNT	
ORD. SHIP B.O.	C2C25329		JBBER-WIP	27.27	14.99		14.99	
45-54 No. 10 (20)	C2C25325	12204 RU	JBBER-WIP	27.27	14.99		14.99	
								Thank You For Your Business!
					J	UL 252 NS A	0160	Your Business
** WE ADDDE	CIATE YOUR B	ISTNESS **					-0	24000000
Please note	that ALL Sp	ecial Order	PART				29.98	
Parts are	and the second s		SUBL				0 00	
*** NOT RETURNABLE ***			FREIC	STAX		-	2.70	
	CUSTOMER'S	SIGNATURE	SALE	STAN		-	2.70	190
	X	or Grant One	-	TOTA	L		\$32.68	

DONN DABNEY

HOME:

180757

HORNBURG IAGUAR "The Oldest Jaguar Dealer in the West"

INVOICE

LAND> < ROVER</pre>

1520 N. WILCOX AVE. · HOLLYWOOD, CA 90028

PHONE: (323) 469-7271 www.hornburgla.com

255 W NAPA ST STE E SONOMA, CA 95476-6546

CONT: 707-332-8331

PAGE 1

105 LARRY JOHNSON SERVICE ADVISOR: CELL: 707-332-8331 BUS: MILEAGE IN / OUT TAG LICENSE VIN MAKE/MODEL COLOR YEAR T1534 91471 /91471 SAJWA79B16SH06738 JAGUAR XJ LWB 06

EBONY INV. DATE PAYMENT RATE PO NO. WARR. EXP. PROMISED PROD. DATE DEL. DATE 25JUL14 0.00 COUPJ

WAIT 25JUL14 17JAN201 18JAN07 DI ENG:4.2 Liter DOHC READY **OPTIONS:** R.O. OPENED

14:36 25JUL14 13:35 25JUL14

			TOTAL	
LINE OPCODE TECH TYPE HOURS	LIST	NET	TOTAL	-
A DO OIL CHANGE SERVICE 02 CUSTOMER REQUESTS OIL AND FILTER CHANGE				
136 CJS		23.00	23.00	
1 C2C41611 FILTER-OIL	21.11	21.11	21.11	
1 JZH100062 PLUG-OIL SUMP DR	12.44	12.44	12.44	
	8.25	8.25	66.00	
8 E-45 CASTROL GTX 5W30	13.50	13.50	13.50	
1 BG110 MOA	13.50	13.50	10.00	
MISC OIL WASTE CJS		2.40	2.40	
PARTS: 113.05 LABOR: 23.00 OTHER: 2.40	TOTAL LIN	E A:	138.45	

91471 perform lof ************************

B CUSTOMER STATES RESET ALL TIRE PRESSURES

TP CUSTOMER STATES RESET ALL TIRE PRESSURES 136 ISPJ 0.00 OTHER: 0.00 LABOR: PARTS:

(N/C)0.00 LINE B: 0.00

91471 LF 30 RF 30 LR 32 RR 32 *************

C Multi-Point Inspection Land Rover

99PL Multi-Point Inspection Land Rover

0.00 0.00 136 CJ 0.00 TOTAL LINE C: 0.00 0.00 OTHER: 0.00 LABOR:

PARTS: 91471 perform mpi

EST: 120.00

SA: 105 25JUL14 13:35

PAID

1111 2 5 2014

NOTICE TO CUSTOMERS WE MAKE A SEPARATE CHARGE FOR THE STORAGE AND DISPOSAL OF TOXIC WASTES. RATHER THAN RECOVER THESE COSTS BY INCREASEING OUR LABOR RATES TO ALL OF OUR SERVICE CUSTOMERS, WE MAK THIS CHARGE ONLY ON THOSE PARTICULAR REPAIRS OR SERVICES WHICH GENERATE THESE WASTES. THESE ARE UNIFORM CHARGES WHICH ARE CALCULATED ANNUALLY FOR EACH PARTICULAR SERVICE AND ARE AVAILABLE ON REQUEST. REQUEST

STATEMENT OF DISCLAIMER The factory warranty constitutes all The factory warranty constitutes all of the warranties with respect to the sale of this item/items. The Seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items. item/items.

DESCRIPTION	TOTALS
LABOR AMOUNT	23.00
PARTS AMOUNT	113.05
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES	2.40
TOTAL CHARGES	138.45
LESS INSURANCE	20.00
SALES TAX	10.17
PLEASE PAY THIS AMOUNT	128.62

Notice to Consumer: Please read important information on back.

BAR # ARD215465

EPA # CAL000223346

CUSTOMER SIGNATURE

Land Rover Multi-Point Inspection Report

Hornburg Jaguar La 1520 N. Wilcox

Los Angeles, Ca, 90028 90069



The Land Rover Multi-Point Inspection is a series of thorough vehicle "health checks" and visual examinations performed by our factory-trained technicians. The focus of this complimentary service is to ensure that your Land Rover vehicle continues to perform at an optimum level, as well as to help minimize your chances of being inconvenienced while on the road.

In the event that additional service is recommended on a listed item, your Service Advisor will be happy to speak with you about service options.

onn Dabne	еу	2006	and the second second		
ustomer Nan		Year/Model SAJWA79B16SH06738	Engine Size	07/25/2014	
80757 T15 D/Tag	91471 Mileage	VIN		Date	
		Future Attention*	Requires Immedia	ate Attention	
	Check Fluid Levels and Fill	Che	eck Battery		
OK FILL	OK FILL	Good Recharge	Bad		
E	Engine Oil Brake Reservoir	0000	**************************************	2	
V V	Vindshield Washer Headlamp Washer	Ch	eck Brakes t / Rear Brake L	inings	
P	Power Steering Coolant Recovery Reservoir	Measure From	(/ Real Blake L	illings	
震器 T	Transmission (if equipped w/ dipstick)	RF 🕷 🌑		RR 🌑 🌑 🌑	
,	Check Following Systems / Components	7			
4 0	Operation of horn, interior lights, exterior lamps, turn signals, hazard and brake lamps				
6 0	Visually inspect headlamp alignment				
0, 8	Windshield washer spray, wiper operation and wiper blades		$ \cup $		
8, 0	Windshield cracks and/or chips				
v , •	Heating, ventilation and air conditioning check				
6 , 0	Engine air cleaner filter	LF W		LR 🌑 💮	1
6,0	Oil and/or fluid leaks	0.00	8mm or 10/32"		
6, 0	Constant velocity (CV) drive axle boots (if equipped)			(224	
8 , •	Exhaust system (leaks, damage, loose parts)		or 5/32" to 10/	32	
8, 0	Steering and steering linkages		n 4mm or 5/32"		
	Shocks/struts, air suspension and other suspension components for leaks and/or damage	Brake Measurements	Not Taken This Se	rvice Visit	
d. 0	Brake system (including lines, hoses and parking brake)	C	heck Tires		
6. 0	Engine cooling system, hoses and clamps	LF, T	READ DEPTH		-
0	Radiator, heater and air conditioning hoses for leaks / damage	7/32" or Greater		7/32" or Greater	
d 0	Accessory drive bell(s)	4/32" to 6/32"	6	4/32" to 6/32" 3/32" or Less	
6 0	Clutch operation (if equipped)	3/32" or Less	0,50	3/32 or Less	
d e	Navigation map update required	7/32" or Greater	000	7/32" or Greater	
6	State inspection due (if applicable) / Month Day / Year	4/32" to 6/32" 3/32" or Less		4/32" to 6/32" 3/32" or Less	
6	Your last completed maintenance; ; / ;	LR LF		RF d	
d a	Your next factory scheduled maintenance is due at	LP Wear I	Pattern / Damage	RR d	
	Mileage Month Year		e Wear Indicates		
	intege	Alignment Check Needed	Wheel Ba	lance Needed	
This Cour	rtesy Inspection Completed By Your Land Rover Service Team	Tire Pressure Set to			
	. Larny Johnson		PSI Front	Rear	
ervice Adv	isor: Larry Johnson	*Brake/tire replacement will be required p		le scheduled maintenan	ice
Technician:	Mitchell Low	- oranertire replacement will be required t	10 111- 11301 101000 1111		
Customer S	Signature:	-			
Charles and the same of the sa					
mment					
nsmission	on (if equipped w/ dipstick): n/a				_

Hornburg Jaguar La 1520 N. Wilcox Los Angeles, Ca, 90028 90069



Comments:
Right Front Brake Linings: 10mm
Left Rear Brake Linings: 8mm
Right Rear Brake Linings: 8mm
Left Front Tread Depth: 8/32
Right Front Tread Depth: 8/32
Left Rear Tread Depth: 8/32
Right Rear Tread Depth: 7/.32

CUSTOMER #: 72620

184993

HORNBURG JAGUAR "The Oldest Jaguar Dealer in the West"

INVOICE

DONN DABNEY

255 W NAPA ST STE E

SONOMA, CA 95476-6546

HOME: CONT:707-332-8331

PAGE 1

< ROVER</pre> 1520 N. WILCOX AVE. · HOLLYWOOD, CA 90028

PHONE: (323) 469-7271

0.00

23.00

21.11

12.44

8.25

2.40

13.50

LAND-

		VVV	w.nornburgia.co
/ICE ADVISOR	105	TADDV	TOUNTOON

COIVI: 70 7 332 6331) <u>T</u>			www.morribargia	.com			
BUS: CELL:707-332-8331			31 SER	SERVICE ADVISOR: 105 LARRY JOHNSON					
COLOR	YEAR	MAKE/M	DDEL		VIN	LICENSE	MILEAGE	IN / OUT	TAG
EBONY	06	JAGUAR XJ	LWB	SAJWA	79B16SH0673	38	101419/	101420 T1	1569
DEL. DATE	PROD.	DATE WARR. E	XP. PRO	MISED	PO NO.	RATE	PAYMENT	INV, DAT	E
18JAN07 DI		17JAN2	TIAW 110	02FEB15		155.00		02FEB15	
R.O. OPEN	VED	READY	OPTI	ONS: ENG	::4.2_Liter_	DOHC			
07:34 02FE	EB15	09:10 02F	EB15						
LINE OPCOL	DE TE	CH TYPE HO	URS			LIST	NET	' TOTAI	G
7 7/1-74 5									

A Multi-Point Inspection Jaquar YBRAKE A BRAKE SYSTEM CONCERN HAS BEEN DISCOVERED

THAT WILL REQUIRE ATTENTION IN THE NEAR

FUTURE.

119 CJ

0.00 LABOR:

0.00 OTHER:

0.00

TOTAL LINE A:

0.00 0.00

101419 Performed mpi ******************

B CUSTOMER STATES RESET ALL TIRE PRESSURES

TP CUSTOMER STATES RESET ALL TIRE PRESSURES

119 ISPJ 0.00 LABOR:

0.00 OTHER:

0.00

TOTAL LINE B:

(N/C)0.00

PARTS: 101419

PARTS:

PARTS:

Set tire pressures

1/f-32 , r/f-32

1/r-34 , r/r-34

************ C CUSTOMER REQUESTS OIL AND FILTER CHANGE

02 CUSTOMER REQUESTS OIL AND FILTER CHANGE

119 CJS 1 C2C41611 FILTER-OIL 1 JZH100062 PLUG-OIL SUMP DR 8 E-45 CASTROL GTX 5W30

1 BG110 MOA MISC OIL WASTE

CJS

113.05 LABOR:

OTHER: 23.00

2.40

TOTAL LINE C:

21.11

12.44

13.50

8.25

2.40 138.45

23.00

21.11

12.44

66.00

13.50

101419 Performed lof

EST: 145.00 02FEB15 07:34 SA: 105

NOTICE TO CUSTOMERS WE MAKE A SEPARATE CHARGE FOR THE STORAGE AND DISPOSAL OF TOXIC WASTES. RATHER THAN RECOVER THESE COSTS BY INCREASEING OUR LABOR RATES TO ALL OF OUR SERVICE CUSTOMERS, WE MAK THIS CHARGE ONLY ON THOSE PARTICULAR REPAIRS OR SERVICES WHICH GENERATE THESE WASTES. THESE ARE UNIFORM CHARGES WHICH ARE CALCULATED ANNUALLY FOR EACH PARTICULAR SERVICE AND ARE AVAILABLE ON DECLIFIED. REQUEST.

STATEMENT OF DISCLAIMER STATEMENT OF DISCLAIMER
The factory warranty constitutes all of the warranties with respect to the sale of this item/items. The Seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items. item/items.

CUSTOMER SIGNATURE

DESCRIPTION	TOTALS.
LABOR AMOUNT	23.00
PARTS AMOUNT	113.05
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES	2.40
TOTAL CHARGES	138.45
LESS INSURANCE	0.00
SALES TAX	10.17
PLEASE PAY THIS AMOUNT	148.62

Notice to Consumer: Please read important information on back.

BAR # ARD215465

EPA # CAL000223346

Jaguar Multi-Point Inspection Report

Hornburg Jaguar La 1520 N. Wilcox Los Angeles, Ca, 90028 90069



The Jaguar Multi-Point Inspection is a series of thorough vehicle "health checks" and visual examinations performed by our factory-trained technicians. The focus of this complimentary service is to ensure that your Jaguar vehicle continues to perform at an optimum level, as well as to fielp minimize your chances of being inconvenienced while on the road.

In the event that additional service is recommended on a listed item, your Service Advisor will be happy to speak with you about service options.

Your next factory scheduled maintenance is due at Mileage Month Year	Donn Dabney	2006	
Mileage **Checked and Okay at this Time** **May Require Future Attention** **Check Battery** **Check Battery** **Ok Fill.** **Engine Oil			
Check Fluid Levels and Fill OK Fill. OK Fill. OK Fill. OK Fill. Engine Oil Windshield Washer Power Steering Coclant Recovery Reservoir Transmission if requipped w/ dipstick! Check Following Systems / Components Operation of horn, interior tights, exterior lamps, turn signals, hazard and brake lamps Wisually inspect headlamp alignment Windshield washer spray, viper operation and viper blades Windshield vasher spray, viper operation and viper blades Windshield cracks and/or chips Heating, ventilation and air conditioning check Engine air cleaner filter Oil and/or fluid leaks Constant velocity (Cyl drive axie boots (il equipped) Exhaust system (tecks, damage, losse parts) Steering and steering linkages Shock/struts, air suspension and other suspension components for leaks and/or damage Brake system fliculding lines, hoses and parking brakel Engine cooling system, hoses and clamps Radiator, heater and air conditioning hoses for leaks / damage Accessory drive beltis Citack Pries Radiator, heater and air conditioning hoses for leaks / damage Accessory drive beltis Citack Pries Your last completed maintenance Michael Johnson Michael Johnson Michael Johnson Michael Johnson Michael Johnson			Commission of the state of the
Check Fluid Levets and Fill OK FILL Engine Oil		Manager and the state of the st	
Brake Reservoir Windshield Washer Power Steering Coclant Recovery Reservoir Transmission life quipped w/ dijstick! Check Following Systems / Components Operation of horn, interior lights, exterior lamps, turn signals, hazard and brake lamps Visually inspect headlamp alignment Windshield cracks and/or chips Heating, ventilation and air conditioning check Engine air cleaner filter Oil and/or fluid leaks Constant velocity (CV) drive axle boots (if equipped) Exhaust systom (leaks, admage, loose parts) Steering and steering linkages Shocks/struts, air suspension and other suspension components for leaks and/or damage Shocks/struts, air suspension and other suspension components for leaks and/or damage Accessory drive bettis Clutch operation (if equipped) Navigation map update required Navigation map update required State inspection due (if applicable) Navigation map update required Navigation ma		TOWN THE PROPERTY OF A STATE OF THE PROPERTY O	
Engine Oil Windshield Washer Power Steering Coclant Recovery Reservoir Transmission If equipped wildipstickl Check Following Systems / Components Operation of horn, interior lights, exterior lamps, turn signals, hazard and brake lamps Visually inspect headiamp alignment Windshield washer spray, wiper operation and wiper blades Windshield cracks and/or chips Heating, ventilation and air conditioning check Engine air cleaner filter Oil and/or fluid leaks Constant velocity (DV) drive axte boots (if equipped) Exhaust system (leaks, damage, loose parts) Steering and steering linkages Shocks/struts, air suspension and other suspension components for leaks and/or damage Shocks/struts, air suspension and other suspension components for leaks and/or damage Engine cooling system, hoses and clamps Radiator, heater and air conditioning hoses for leaks / damage Accessory drive bettls) Clutch operation (if equipped) Novigation map update required State inspection due (if applicable) Monitor Day Vest Wour last completed maintenance Michael Johnson This Courtesy Inspection Completed By Your Jaguar Service Isam Factory Recommendations PSI Front Rear Tire Pressure Set to Factory Recommendations PSI Front Rear Takabofite replacement will be required prior to the next 10,000 mile scheduled maintenance eschoicans. This Courtesy Inspection Completed By Your Jaguar Service Isam This Courtesy Inspection Completed By Your Jaguar Service Isam This Courtesy Inspection Completed By Your Jaguar Service Isam This Courtesy Inspection PSI Front Rear Tread DEPTH			
Power Steering Coclant Recovery Reservoir Transmission (if equipped w/ dipstick) Chock Following Systems / Components Operation of horn, interior lights, exterior lamps, turn signals, hazard and brake lamps Visually inspect headamp alignment Windshield cracks and/or chips Heating, ventilation and air conditioning check Engine air cleaner filter Oil and/or fluid leaks Constant velocity (EV) drive axte boots (if equipped) Exhaust system (leaks, damage, loose parts) Steering and steering linkages Shocks/struts, air suspension and other suspension components for leaks and/or damage Brake system (including lines, hoses and parking brake) Engine cooling system, hoses and clamps Radiator, heater and air conditioning hoses for leaks / damage Accessory drive belt(s) Radiator, heater and air conditioning hoses for leaks / damage Accessory drive belt(s) Clutch operation (if equipped) Navigation map updator required Navigation map updator required State inspection due lif applicable) Meeting Lip Meet	Engine Oil Brake Reservoir	— Good Recharge	840
Transmission lif equipped w/ dipstick) Chack Following Systems / Components Operation of horn, interior lights, exterior lamps, turn signals, hazard and brake lamps Windshield cracks and/or chips Heating, wentilation and air conditioning check Engine air cleaner filter Oil and/or fluid leaks Constant velocity (EV) drive axte boots (if equipped) Exhaust system (leaks, damage, loose parts) Steering and steering linkages Shocks/struts, air suspension and other suspension components for leaks and/or damage Brake system (including lines, hoses and parking brake) Engine cooling system, hoses and clamps Radiator, heater and air conditioning hoses for leaks / damage Accessory drive belt[s] Nevigation map update required State inspection due (if applicable) Nevigation map update required State inspection due (if applicable) Nevigation map update required Never Pattern / Damage Ref LR Wear Pattern / Damage Ref LR Wear Pattern / Damage Ref LR Wear Pattern / Damage Ref LR Tire Wear Indicates Alignment Check Needed Wheel Balance Needed Tire Pressure Set to Factory Recommendations PSI Front Rear Baken/ire replacement will be required prior to the next 10,000 mile scheduled maintenance service and the provided prior to the next 10,000 mile scheduled maintenance service and the provided prior to the next 10,000 mile scheduled maintenance service provided prior to the next 10,000 mile scheduled m	Windshield Washer Headlamp Washer	Check E	Brakes :
Check Following Systems / Components Operation of horn, interior lights, exterior lamps, turn signals, hazard and brake lamps Visually inspect headiamp alignment Windshield cracks and/or chips Windshield cracks and/or chips Engine air cleaner filter Oil and/or fluid leaks Constant velocity (CV) drive axle boots [if equipped] Exhaust system (lecks, damage, loose parts] Steering and steering linkages Shocks/struts, air suspension and other suspension components for leaks and/or damage Brake system (including lines, hoses and parking brake) Engine cooling system, hoses and clamps Radiator, heater and air conditioning hoses for leaks / damage Accessory drive bett[s] Clutch operation [if equipped] Navigation map update required State inspection due [if applicable] Mileage Milea	Power Steering Coclant Recovery Reservoir	Measure Front / Re	ear Brake Linings
Operation of horn, interior lights, exterior lamps, turn signals, hazard and brake lamps Visually inspect headlamp alignment Windshield racks and/or chips Heating, ventilation and air conditioning check Engine air cleaner filter Oil and/or fluid leaks Constant velocity (CV) drive axte boots [if equipped] Exhaust system (leaks, damage, toose parts] Steering and steering linkages Shocks/struts, air suspension and other suspension components for leaks and/or damage Shocks/struts, air suspension and other suspension components for leaks and/or damage Engine cooling system, hoses and clamps Engine cooling system, hoses and clamps Radiator, heater and air conditioning hoses for leaks / damage Accessory drive bett[s] Clutch operation lif equipped Navigation map update required State inspection due [if applicable] Navigation map update required State inspection due [if applicable] Navigation map update required State inspection due [if applicable] Nour tast completed maintenance Mileage Your tast completed maintenance Mileage Your tast completed maintenance is due at Mileage Your paguar Service Team Mileage LF Wear Pattern / Damage RF LF Wear Pattern / Damage RF LF Wear Pattern / Damage RF LF LF Wear Pattern / Damage RF LR LF LF Wear Pattern / Damage RF LR LF LF Wear Pattern / Damage RF LR LF LF LF Wear Pattern / Damage RF LR LF LF LF LF TreeSoure Set to Factory Recommendations PSI Front Rear Flake/life replacement will be required prior to the next 10,000 mile scheduled maintenance securities and the required prior to the next 10,000 mile scheduled maintenance securities and the required prior to the next 10,000 mile scheduled maintenance securities and the required prior to the next 10,000 mile scheduled maintenance securities and the required prior to the next 10,000 mile scheduled maintenance securities and the required prior to the next 10,000	Transmission (if equipped w/ dipstick)	DE A	pp = 1
Visually inspect headlamp alignment Windshield washer spray, wiper operation and wiper blades Windshield cracks and/or chips Heating, ventilation and air conditioning check Engine air cleaner filter Oil and/or fluid leaks Constant velocity (CV) drive axle boots (if equipped) Exhaust system (leaks, damage, toose parts) Steering and steering linkages Shocks/struts, air suspension and other suspension components for leaks and/or chamage Brake system (including lines, hoses and parking brake) Engine cooling system, hoses and clamps Radiator, heater and air conditioning hoses for leaks / damage Accessory drive belt(s) Navigation map update required Navigation map update required State inspection due (if applicable) Month Day Year Your last completed maintenance is due at Mileage Month Year Mileage Month Year Wear Pattern / Damage RF LR LF Wear Pattern / Damage RF LR LF Wear Indicates Alignment Check Needed Wheel Balance Needed Tire Pressure Set to Factory Recommendations PSI Front Rear *Blake/lire replacement wit be required prier to the next 10,000 mile scheduled maintenance service replacement with the required prier to the next 10,000 mile scheduled maintenance service. *Blake/lire replacement with the required prier to the next 10,000 mile scheduled maintenance service. *Blake/lire replacement with the required prier to the next 10,000 mile scheduled maintenance service. *Blake/lire replacement with the required prier to the next 10,000 mile scheduled maintenance service. *Blake/lire replacement with the required prier to the next 10,000 mile scheduled maintenance service. *Blake/lire replacement with the required prier to the next 10,000 mile scheduled maintenance service. *Blake/lire replacement with the required prier to the next 10,000 mile scheduled maintenance service. *Blake/lire replacement with the required prier to the next 10,000 mile scheduled maintenance service. *Blake/lire replacement with the required prier to the next 10,000 mile scheduled maintenance service. *Blake/lire replace	Check Following Systems / Components	nr 💮	RR 💮 🔻 💮
Windshield washer spray, wiper operation and wiper blades Windshield cracks and/or chips Heating, ventilation and air conditioning check Engine air cleaner filter Oil and/or fluid leaks Constant velocity [CV] drive axle boots [if equipped] Exhaust system (leaks, damage, loose parts) Steering and steering linkages Shocks/struts, air suspension and other suspension components for leaks and/or damage Brake system (including lines, hoses and parking brake) Engine cooling system, hoses and clamps Radiator, heater and air conditioning hoses for leaks / damage Accessory drive belt(s) Clutch operation (if equipped) Navigation map update recuired State inspection due (if applicable) Month Vear Vour last completed maintenance is due at Mileage Your last completed maintenance is due at Mileage Wanth Vear Month Vear Month Vear Month Vear Mileage Tire Wear Pattern / Damage RF RR Alignmen: Check Needed Wheel Balance Needed Tire Pressure Set to Factory Recommendations PSI Front Rear **Blake/life replacement will be required prior to the next 10,000 mile scheduled maintenance ser	 Operation of horn, interior lights, exterior lamps, turn signals, hazard and brake lamps 	F A	
Windshield cracks and/or chips Heating, ventilation and air conditioning check Engine air cleaner filter Oil and/or fluid leaks Constant velocity (CV) drive axte boots (if equipped) Exhaust system (leaks, damage, loose parts) Steering and steering linkages Shocks/struts, air suspension and other suspension components for leaks and/or damage Brake system (including lines, hoses and parking brake) Engine cooling system, hoses and clamps Radiator, heater and air conditioning hoses for leaks / damage Accessory drive belt(s) Clutch operation (if equipped) Navigabion map update recuired State inspection due (if applicable) Month Day Wear Your last completed maintenance Mileage Your last completed maintenance is due at Mileage Your last completed maintenance Mileage Wheel Balance Needed Tire Pressure Set to Factory Recommendations PSI Front Rear *Bake/lite replacement will be required prior to the next 10,000 mile scheduled maintenance ser	Wisually inspect headlamp alignment		
Heating, ventilation and air conditioning check Engine air cleaner filter Oit and/or fluid leaks Constant velocity [CV] drive axte boots [if equipped] Exhaust system (leaks, damage, loose parts] Steering and steering linkages Shocks/struts, air suspension and other suspension components for leaks and/or damage Brake system (including lines, hoses and parking brake) Engine cooling system, hoses and clamps Radiator, heater and air conditioning hoses for leaks / damage Accessory drive belt(s) Clutch operation (if equipped) Navigation map update required State inspection due lif appticable) Wour last completed maintenance State inspection due lif appticable) Wour last completed maintenance Mileage Wour last completed Maintenance is due at Mileage Month Year Tire Wear Pattern / Damage RF Wear Pattern / Damage RF LR User State inspection Completed By Your Jaguar Service Team Wour last Courtesy Inspection Completed By Your Jaguar Service Team Tire Pressure Set to Factory Recommendations PSI Front Rear **Baske/life replacement will be required prior to the next 10,000 mile scheduled maintenance services and prior to the next 10,000 mile scheduled maintenance services. **Baske/life replacement will be required prior to the next 10,000 mile scheduled maintenance services. **Baske/life replacement will be required prior to the next 10,000 mile scheduled maintenance services. **Baske/life replacement will be required prior to the next 10,000 mile scheduled maintenance services. **Baske/life replacement will be required prior to the next 10,000 mile scheduled maintenance services. **Baske/life replacement will be required prior to the next 10,000 mile scheduled maintenance services. **Baske/life replacement will be required prior to the next 10,000 mile scheduled maintenance services. **Baske/life replacement will be required prior to the next 10,000 mile scheduled maintenance services. **Baske/life replacement will be required prior to the next 10,000 mile scheduled maintenance services. **Baske/life replacemen	Windshield washer spray, wiper operation and wiper blade	s	
Engine air cleaner filter Oit and/or fluid leaks Constant velocity (CV) drive axte boots [if equipped] Exhaust system (leeks, damage, toose parts) Steering and steering linkages Shocks/struts, air suspension and other suspension components for leaks and/or damage Shocks/struts, air suspension and other suspension components for leaks and/or damage Brake system (including lines, hoses and parking brake) Engine cooling system (leeks, damage, toose parts) Shocks/struts, air suspension and other suspension components for leaks and/or damage Brake system (including lines, hoses and parking brake) Engine cooling system (leeks, damage, toose parts) Shocks/struts, air suspension and other suspension components for leaks and/or damage Brake Measurements Not Taken This Service Visit Check Tires TREAD DEPTH	Windshield cracks and/or chips		
Oil and/or fluid leaks Constant velocity (CV) drive axle boots (if equipped) Exhaust system (leaks, damage, loose parts) Steering and steering linkages Shocks/struts, air suspension and other suspension components for leaks and/or damage Brake system (including lines, hoses and parking brake) Engine cooling system, hoses and parking brakel Radiator, heater and air conditioning hoses for leaks / damage Accessory drive bett(s) Navigation map update required State inspection due (if applicable) Your last completed maintenance Your next factory scheduled maintenance is due at Mileage Month Year Month Year Mileage Month Year Michael Johnson LF User 5mm or 7/32" 3 to 5mm or 4/32" to 7/32" Less than 2mm or 3/32" Brake Measurements Not Taken This Service Visit Check Tires Check Tires LF TREAD DEPTH TREAD DEPTH TREAD DEPTH 7/32" or Greater 4/32" to 6/32" 3/32" or Less 7/32" or Greater 4/32" to 6/32" 3/32" or Less 7/32" or Greater 4/32" to 6/32" 3/32" or Less 7/32" or Greater 4/32" to 6/32" 3/32" or Less Tire Wear Pattern / Damage RF LF Wear Pattern / Damage RF Alignment: Check Needed Wheel Balance Needed Tire Pressure Set to Factory Recommendations Front Rear *Baske/tire replacement will be required prior to the next 10,000 mile scheduled maintenance ser	Heating, ventilation and air conditioning check		
Constant velocity (CV) drive axte boots (if equipped) Exhaust system (leaks, damage, loose parts) Steering and steering linkages Shocks/struts, air suspension and other suspension components for leaks and/or damage Brake system (including lines, hoses and parking brake) Engine cooling system, hoses and clamps Radiator, heater and air conditioning hoses for leaks / damage Accessory drive bett(s) Clutch operation (if equipped) Navigation map update required State inspection due (if applicable) Your last completed maintenance Mileage: Month Vear This Courtesy Inspection Completed By Your Jaguar Service Team Michael Johnson Over 5mm or 7/32" 3 to 5mm or 4/32" to 7/32" Brake Measurements Not Taken This Service Visit Check Tires TREAD DEPTH TREAD DEPTH RI 7/32" or Greater 4/32" to 6/32" 3/32" or Less 3/32" or Less 3/32" or Less 4/32" to 6/32" 3/32" or Less LR LF Wear Pattern / Damage RF LE LF Wear Pattern / Damage RR Tire Wear Indicates Alignment: Check Needed The Pressure Set to Factory Recommendations PSI Front Rear *Blake//lire replacement will be required prior to the next 10,000 mile scheduled maintenance service and parking brakel Less than 2mm or 7/32" Less than 2mm or 3/32" Brake Measurements Not Taken This Service Visit Check Tires TREAD DEPTH 7/32" or Greater 4/32" to 6/32" 3/32" or Less 3/32" or Less LR LF Wear Pattern / Damage RR Tire Wear Indicates Tire Pressure Set to Factory Recommendations PSI Front Rear *Blake//lire replacement will be required prior to the next 10,000 mile scheduled maintenance services *Blake//lire replacement will be required prior to the next 10,000 mile scheduled maintenance services *Blake//lire replacement will be required prior to the next 10,000 mile scheduled maintenance services *Blake//lire replacement will be required prior to the next 10,000 mile scheduled maintenance services *Blake//lire replacement will be required prior to the next 10,000 mile scheduled maintenance services *Blake//lire replacement will	Engine air cleaner filter		1
Steering and steering linkages Shocks/struts, air suspension and other suspension components for leaks and/or damage Brake system (including lines, hoses and parking brake) Engine cooling system, hoses and clamps Radiator, heater and air conditioning hoses for leaks / damage Accessory drive belt[s] Navigation map update required State inspection due [if applicable] Your last completed maintenance Mileage Your next factory scheduled maintenance is due at Mileage Mileage Month Mon	Oil and/or fluid leaks	— LF 🖝 💮	LR 🌑 🗸 🌑
Steering and steering linkages Shocks/struts, air suspension and other suspension components for leaks and/or damage Brake system (including lines, hoses and parking brake) Engine cooling system, hoses and clamps Radiator, heater and air conditioning hoses for leaks / damage Accessory drive belt[s] Clutch operation (if equipped) Navigation map update required State inspection due (if appticable) Your last completed maintenance Mileage Month Year Your next factory scheduled maintenance is due at Mileage Mi	Constant velocity (CV) drive axle boots (if equipped)	Over 5mm	or 7/32"
Shocks/struts, air suspension and other suspension components for leaks and/or damage Brake system (including lines, hoses and parking brake) Engine cooling system, hoses and clamps Radiator, heater and air conditioning hoses for leaks / damage Accessory drive belt[s] Clutch operation (if equipped) Navigation map update required State inspection due (if applicable) Your last completed maintenance Your last completed maintenance is due at Mileage Month Year Mileage Month Year Alignmen: Check Needed Wheel Balance Needed Tire Pressure Set to Factory Recommendations Pathe//ire replacement will be required prior to the next 10,000 mile scheduled maintenance ser	Exhaust system (leaks, damage, loose parts)	3 to 5mm or 4	/32" to 7/32"
Shocks/struts, air suspension and other suspension components for leaks and/or damage Brake system (including lines, hoses and parking brake) Engine cooling system, hoses and clamps Radiator, heater and air conditioning hoses for leaks / damage Accessory drive bett(s) Clutch operation (if equipped) Navigation map update required State inspection due (if applicable) Your last completed maintenance Your next factory scheduled maintenance is due at Mileage Month Mo	Steering and steering linkages	Less than 2m	om or 3/32"
Engine cooling system, hoses and clamps Radiator, heater and air conditioning hoses for leaks / damage Accessory drive belt(s) Clutch operation (if equipped) Navigation map update required State inspection due (if applicable) Month Day Year Your last completed maintenance Mileage Your next factory scheduled maintenance is due at Mileage This Courtesy Inspection Completed By Your Jaguar Service Team Alignmen: Check Needed Tire Pressure Set to Factory Recommendations Factory Recommendations Pake/lire replacement will be required prior to the next 10,000 mile scheduled maintenance service maintenance service maintenance service maintenance of the next 10,000 mile scheduled maintenance service maintenance service maintenance of the next 10,000 mile scheduled maintenance service maintenance of the next 10,000 mile scheduled maintenance service maintenance service maintenance of the next 10,000 mile scheduled maintenance service maintenance service maintenance service maintenance of the next 10,000 mile scheduled maintenance service maintenance maintenance service maintenance service maintenance maintenance service maintenance maintenance service maintenance maintenance maintenance service maintenance ma	Shocks/struts, air suspension and other suspension components for leaks and/or damage		
Radiator, heater and air conditioning hoses for leaks / damage Accessory drive belt[s] Clutch operation [if equipped] Navigation map update required State inspection due [if applicable] Your last completed maintenance Mileage Your next factory scheduled maintenance is due at Mileage Month Year Trire Wear Pattern / Damage RR Alignmen: Check Needed Wheel Balance Needed Tire Pressure Set to Factory Recommendations PSI Front Rear *Bake/tire replacement will be required prior to the next 10,000 mile scheduled maintenance ser	Brake system (including lines, hoses and parking brake)	Check	Tires
Radiator, heater and air conditioning hoses for leaks / damage Accessory drive bett[s] Clutch operation (if equipped) Navigation map update required State inspection due (if applicable) Month Day Year Your last completed maintenance Mileage Month Year Your next factory scheduled maintenance is due at Mileage Month Year Alignment Check Needed Tire Wear Pattern / Damage LR Tire Wear Indicates Alignment Check Needed Tire Pressure Set to Factory Recommendations Factory Recommendations Factory Recommendations PSI Front Rear Brake/tire replacement will be required prior to the next 10,000 mile scheduled maintenance ser	Engine cooling system, hoses and clamps	LF. TREAD I	DEPTH PE
Clutch operation [if equipped] Navigation map update required State inspection due [if applicable] / Month / Day / Year Your last completed maintenance / Mileage Month / Year Your next factory scheduled maintenance is due at / Mileage Month / Year Your next factory scheduled maintenance is due at / Mileage Month / Year Tire Wear Pattern / Damage RR Alignment Check Needed Wheel Balance Needed Tire Pressure Set to Factory Recommendations PSI Front Rear **Biake/tire replacement will be required prior to the next 10,000 mile scheduled maintenance ser	Radiator, heater and air conditioning hoses for leaks / damag		7/32" or Greater
Navigation map update required State inspection due (if applicable) Month Day Year Your last completed maintenance Mileage Your next factory scheduled maintenance is due at Mileage Whonth Wileage Month Year Alignment Check Needed Wheel Balance Needed Tire Pressure Set to Factory Recommendations Factory Recommendations Factory Recommendations Factory Recommendations Bake/tire replacement will be required prior to the next 10,000 mile scheduled maintenance set	Accessory drive belt(s)		
State inspection due (if applicable) Your last completed maintenance Mileage Month Year	Clutch operation [if equipped]	3/32" or Less	3/32" or Less
Your last completed maintenance Mileage Month Vear Your next factory scheduled maintenance is due at Mileage Mileage Month Year Your next factory scheduled maintenance is due at Mileage Mileage Mileage Mileage Month Year Mileage Mileage Month Year LF Wear Pattern / Damage RF RR Alignment Check Needed Wheel Balance Needed Tire Pressure Set to Factory Recommendations PSI Front Rear *Bake/tire replacement will be required prior to the next 10,000 mile scheduled maintenance set	Navigation map update required	7/32" or Greater	7/32" or Greater
Your last completed maintenance Your next factory scheduled maintenance is due at Your next factory scheduled maintenance is due at Your next factory scheduled maintenance is due at Wear Pattern / Damage RF RR Tire Wear Indicates Alignment Check Needed Wheel Balance Needed Tire Pressure Set to Factory Recommendations PSI Front Rear Factory Recommendations PSI Front Factory Recommendations PSI Factory Recommendations PSI			
Your next factory scheduled maintenance is due at Mileage Month Year	Your last completed maintenance;/	LR	3/32" or Less
This Courtesy Inspection Completed By Your Jaguar Service Team ervice Advisor: Larry Johnson Tire Pressure Set to Factory Recommendations PSI Front Rear *Biake/tire replacement will be required prior to the next 10,000 mile scheduled maintenance set	Your next factory scheduled maintenance is due at	LR Wear Pattern	/ Damage
Factory Recommendations PSI Front Rear *Brake/tire replacement will be required prior to the next 10,000 mile scheduled maintenance service. *Brake/tire replacement will be required prior to the next 10,000 mile scheduled maintenance service.	This Courtesy Inspection Completed By Your Jaguar Service Tean	n l	Wheel Balance Needed
echnician: MICNAEI JOHNSON	ervice Advisor: Larry Johnson		Front Rear
	Technician: Michael Johnson	*Brake/tire replacement will be required prior to the	e next 10,000 mile scheduled maintenance ser

Comments:



687 W. Napa St. Sonoma, CA 95476 www.sonomachevy.com Phone: (707) 996-2141 Toll Free: (877) 390-5573 Fax: (707) 996-5544 SERVICE DEPARTMENT HOURS 7:30 a.m. to 5:30 p.m. Monday - Friday R/O Open Date R/O Number

1/02/15 6038814/1

R/O Close Date Status

1/02/15 Pre-Invoice

Mileage In Mileage Out

99228 99228

Service Advisor / Tag #

Patrick Mulliga/JAG BAR# ARD00249137 CAL# 000315259 LEFT COAST CLASSICS Work Phone Vehicle Identification Number 255 W NAPA STREET SUITE E SAJWA79B16SH06738 Home Phone Delivery Date In-Service Date SONOMA, CA 95476 707-332-8331 License Number Make Body 2006 XJ 4DR SDN XJ8 LWB BLACK **JAGUAR**

DESCRIPTION OF SERVICE AND PARTS Email: www.leftcoastclassics.com AR#: LEFT001	AMOUNT
#1 - Customer Reports: CUSTOMER REQUESTS SMOG TEST FOR REGISTRATION RENEWAL PURPOSES Work performed by C PARRIERA (105) SMOG CERTIFICATE PERFORMED AND COMPLETED SMOG TEST VEHICLE PASSED SMOG AND CERTIFICATE SET ELECTRONICALLY TO DMV Sub Total: 59.95	51.70 8.25
#2 CARB: CHECK TIRE PRESSURES. SET TIRE PRESSURES TOMANUFACTURE SPECIFICATIONS. RESET TIRE PRESSUREMONITOR SYSTEM ON APPLICABLE MODELS AS PERCALIFORNIA AIR RESOURCES REQUIREMENTS. Sub Total: .00	

TERMS: STRICTLY CASH UNLESS ARRANGEMENTS ARE MADE. "I hereby authorize the repair work hereinafter to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in the vehicle in case of fire, theft, or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you or your employees permission to operate the vehicle herein described on streets, highways, or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto."

DISCLAIMER OF WARRANTIES. Any warranties on the products sold hereby are those made by the manufacturer. The seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes nor authorize any other person to assume for it any liability in connection with the sale of said products. Any limitation contained herein does not apply where prohibited by law.

LABOR		51.70
PARTS		8.25
DEDUCTIBLE		.00
SUBLET		.00
SHOP SUPPLIES		.00
HAZARDOUS MATERIAL	S	.00
SALES TAX OR TAX I.D.	xxxH100	.00
SPECIAL ORDER DEPOS	IT	.00
DISCOUNTS		.00
TOTAL DUE		59.95

NO RETURN ON ELECTRICAL OR SAFETY ITEMS OR SPECIAL ORDERS.

X (C) 2003 ARKONA, Inc. - Dealership Application Group (800)345-1026

SMOG CHECK VEHICLE INSPECTION REPORT

(01/02/2015 @ 1:35:12 pm)

Vehicle Information

		A CITT CT CT			
Model Year. License. Engine Size. GVWR. Odometer Fuel Type Engine Year. Fleet BAR File #	6SRL855 4.2 Liters N/A 99228 Gasoline N/A	Make State Type. Test Weight Certification Exhaust Engine Make.	California Passenger N/A California Single	Model VIN Transmission Cylinders VLT Record # Inspection Reason Bar Number	MAJWA79B16SH06738 Automatic 8 33629 Biennial

Overall Test Results

Congratulations! Your vehicle passed the enhanced Smog Check inspection, which helps California reach its daily goal of removing an extra 100 tons of smog-forming emissions from the air. Thank you for keeping your vehicle well maintained.

Visual Inspection..(Pass) Functional Check..(Pass) Emissions Test..(Pass)

DMV ID Number..(3705M176P528) Smog Check Certificate Number..(PM902020)

Your Smog Check certificate has been electronically transmitted to the DMV. This certificate is valid for ninety (90) days from the date of issuance.

Please keep this copy for your records.

Emission Control Systems Visual Inspection/Functional Check Results

(Visual/Functional tests are used to assis	t the identifica	ation of oxides of nitrogen, crankcase, and co	ld start emissi	ons which are not measured during the idle te	Result
ECS	Result	ECS	Result	<u> </u>	
PCV	Pass	Fuel Evaporative Controls	Pass	Catalytic Converter	Pass
		Fuel Injection		Pump Air Injection	Pass
Spark Controls		Wiring to Sensors		Vacuum lines sensors/switches	Pass
Oxygen Sensor	Pass			Fuel Cap Visual	Pass
Other related emis. components.	Pass	Liquid Fuel Leak		ruer cap vibaar	
OBD System Check		Ignition Timing	N/A		

Idle Emission Test Results

	RPM	%CO2	%02	I	HC (PPM	.)		CO(%)		
Test	MEAS	MEAS	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	Result
M1: 0 MPH M2: 0 MPH		14.6 14.6	0.3	100 130	17 12	4 12	1.00	0.00		Pass Pass

MAX = Maximum Allowed Emissions AVE = Average Emissions For Passing Vehicles MEAS = Amount Measured

Smog Check Station Information

SONOMA CHEVROLET 687 W. NAPA STREET SONOMA, CA 95476 1 707 996 2141 Technician Name/Number... PARREIRA, CHRISTOPHE/E0305972
Repair Tech Name/Number... N/A
Software Version/EIS Number... 1401/SX021102
Station Number... RC249137

I certify under penalty of perjury under the laws of the State of California, that I performed the inspection in accordance with all bureau requirements, and that the information listed on this vehicle inspection report is true and correct.

1-2-2015 Date

Technidian's Signature

UNIVERSAL AUTO REPAIR

16903 Sonoma Hwy. Sonoma, CA. 95476

Phone - 707-939-1363 Fax - 707-939-1803

We appreciate your business! www.UniversalAutoRepair.net

INVOICE

15076

Org. Est. # 042560 BAR# ARD00161872

INVOICE

839 Oakwood Dr.

Sonoma, CA 95476

Left Coast Classics - DONN DABNEY

Home 707-996-8283 --- Cell 707-332-8331

Print Date: 04/10/2015

2006 Jaguar - XJ8 L - 4.2L, V8 (256CI)

Lic#: 6SRL855 - CA

Odometer In: 105820

Unit#:

Odometer Out: 105820

Vin #: SAJWA79B16SH06738

Ref#: Extended

120.00

Gust ID: 2659				Hat #:		Ref#
Part Description / Number	Qty	Sale	Extended	Labor Description	Hours	Extende
Headlight Bulb D1S Bulb, Marker	1.00	89.50	89.50	CHECK FRONT END -Test drove and racked vehicle for inspection. Needs front sway bar	1.00	120.0
2825	1.00	2.55	2.55	bushings for rattle. Needs control arm		
Sway Bar Bushing XR8 19697	2.00	45.30	90.60	-Cleared codes for lean condition, MAF se O2 codes). Cruise control now works after CHECK HEADLAMPS HEADLAMP SULB & JOR SEALED REAM	clearing all o 0.30	codes. 36.0


36.00 HEADLAMP BULB &/OR SEALED BEAM - Remove & Replace -One, Right Side -Including replacing marker bulb as well. STABILIZER BAR BUSHING - Remove & 4.20 504.00 Replace - One or Both - [Includes: R&I Stabilizer Bar.] - [DOES NOT include alignment.]

Org. Estimate	\$ 858.63	Revisions	\$ 0.00	Current Estimate	\$ 858.63	Labor:	660.00
					The state of the s	Parts:	182.65
						Sublet	\$0.00
						Sub:	842.65
						Tax:	15.98
						Total:	858.63
[Payments -]						Bal Due:	\$858.63

Warranty is 12 months or 12,000 miles, no exceptions.

An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is up to one year/12,000 miles, is nontransferable, has to be performed in our shop, and can't exceed the original cost of repair. \$30 returned check fee.

Signature Date Time

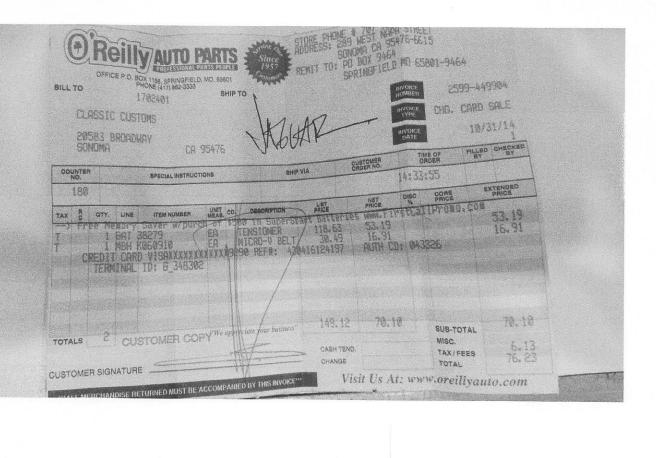

Order information

Order placed on Wednesday, Jun 10, 2015

Payment method PayPal

Payment date Wednesday, Jun 10, 2015

Shipping address

Donn W Dabney 839 Oakwood Dr Sonoma CA 95476-3229 United States

Order total

Subtotal \$14.72
Shipping Free
Sales tax \$1.10
Total \$15.82

Item(s) bought from alliedautostores

Qty	Item name	Shipping service	Item price
1	Cabin Air Filter-Value Line ATP CF-231 fits 05-09 Jaguar XJ8 4.2L-V8 (121587747782)	Standard Shipping	\$14.72

Bill to:

DONN DABNEY 255 W WARA STREET STE E SCHOMA CA 95476

SONOMA CA 95476 707 332-8331 LEFTCOASTCLASSICS.COM

TIRE DIRECT

800-707-8473 discounttiredirect.com DONN DABNEY 838 QAKWOOD DR

SONOMA CA 95476 000 000-0000

Contact: DONN DABNEY

TaxID:

Invoice# 6688960

T11601

Page:

PO#

Order# 8473589

Date: 06-06-3015

10:19 PM

1 of 1

D:

Salesman:

ECOMM

300 00000

luct Cnd	Qty Size	Description		Price	FEIT	Extended Price	Ship	Invoice DC
153 N	A 235 /50 B18	97W St RSW		112.00	.00	448.00	WDAZ01	WDAE01
Comments:	KUM EGSTA VEHICLE: 2006 JAGU	ASX	LUXURY	SEDAN				
)83 N	1 SKIPPING &	2- PRGS PREE SHIPPIN	G	.00	.00	,00	WDAZ01	WDAZ01
				Subtota	av.	448.00		
				Total	al:	448,00		
	card:	VIS **********7991				448.00		
	74			Tender	ed:	448.00		









TIRE INDUSTRY REGISTRATION CENTER PO BOX 1000 AKRON OH 44309-1000

DeWITT'S TIRE RECYCLE AND AUTO REPAIR

Tom & Pauline DeWitt 19764 Eighth St. East P.O. Box 1651 Sonoma, CA 95476 (707) 996-2015

Customer Order No	. CHEQUEUN Date_			<u></u>
Name	274 Coast C	lass	16	
Address				
SOLD BY	CASH C. O. D CHARGE ON ACCT.	MDSE. RETD.	PAID OUT	
QUAN,	DESCRIPTION	PRICE	AMOUNT	
	1011 15			
4	18" fore			
	Mounts		1000	1
	20			
	Valle !			
	In the A			
	V VIO. TAX			
	TOTAL			
0044	1286 Rec'd by			

All claims and returned goods MUST be accompanied by this bill

GS-201-3 PRINTED IN U.S.A.

Thank You





SONOMA AUTO PARTS, INC.

19425 SONOMA HWY. SONOMA, GA 95476 PHONE: (707) 996-8424 FAX: (707) 996-0910



1A

All accounts due and payable 10th of month following date of purchase, and must be settled every 30 days. Finance charge of 2% per month after 30 days. No merchandise returned without our permission. All returns are subject to a 10% Handling Charge. No returns on electrical parts. Warranties apply to parts only, RECEIVED BY ALL GOODS RETURNED MUST BE ACCOMPANIED BY THIS INVOICE ACCT. NO. SOLD TO INVOICE NO. STORE NO. DATE SLS Cash Sale ATTENTION TIME PURCHASE ORDER NO. Thank You For Shopping at Sonoma Auto Parts INVOICE TYPE YTITHAUG PART NUMBER LINE DESCRIPTION PRICE CODE NET TOTAL Jaquar XJ8 4.2 t Valve e de Brake Rotor Onl 46,4900 SS-7874A-M Brake Pads - Rea SUB 1 132 97 MISC. 8.750 TAX 0.00 TOTAL D 144.6

UNIVERSAL AUTO REPAIR

16903 Sonoma Hwy. Sonoma, CA. 95476

Phone: 707-939-1363 Fax: 707-939-1803

We appreciate your business!

INVOICE

15185

Org. Est. # 042791 BAR# ARD00161872

Print Date: 06/30/2015

INVOICE

Left Coast Classics - DONN DABNEY

839 Oakwood Dr.

Sonoma, CA 95476

2006 Jaguar - XJ8 L - 4.2L, V8 (256CI) VIN(2)

Lic#: 6SRL855 - CA

Odometer In: 109726

Odometer Out: 109726

VIN#: SAJWA79B1 6SH06738

Home: 707-996-8283 Cell: 707-332-8331 Cust ID : 2659

Part Description / Number	Qty	Sale	Ext	Labor Description	Hours	Extended
Alternator AL 9433X	1.00	465.98	465.98	CHARGING SYSTEM - Check - All Applicable Models - [Includes: Check battery, regulator and alternator output.]	0.50	60.00
				ALTERNATOR ASSEMBLY - Remove & Replace - All Applicable Models	2.00	240.00

806.75 Org. Estimate 806.75 Revisions 0.00 Current Estimate 300.00 Labor: Parts: 465.98 65.98 Sub: Tax: 40.77 806.75 Total: Bal Due: \$806.75

Warranty is 12 months or 12,000 miles, no exceptions.

An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is up to one year/12,000 miles, is nontransferable, has to be performed in our shop, and can't exceed the original cost of repair. \$30 returned check fee.

Signature

6819 Redwood Dr. Ste A-C Cotati, CA 94931

Phone: 707 792-2737 FAX: 707 792-4454

<u>Invoice No.</u> 250803002

Order Date 08/03/15 11:53 am Completed: 08/13/15 02:39 pm

Dabney, D(Lft Coast)

839 Oakwood Dr.

rover

SONOMA CA 95476 Mobile: 707-332-8331 06 JAGUAR XJ8 BLACK

Mileage in:70570 out: Lic: 6SRL855/CA V8Cyl 4.2

Vin: SAJWA79B16SH06738 01/06

Eq: AT AC PS FI Last in 9/19/2013

Job01 Ba	attery			Labo	r: \$0.00
МТР-Н8	BATTERY-N	1.0 @	148.98 =\$	148.98	148.98
Status: Con	mpleted Tech: TA	3	Job S	ubtotal:	\$148.98

Tire Pressure: LF[] RF[] LR [] RR []

Payments to British European Motors	Cost Summary	7
Status: Completed Work Order	Labor Parts	0.00 148.98
Payments:	Subtotal	148.98
zagmente.	Total	\$148.98
	Payments Bal Due	0.00 148.98

Thank you for choosing British European Motors

CUSTOMER #: 72620

189537

HORNBURG JAGUAR "The Oldest Jaguar Dealer in the West"

1520 N. WILCOX AVE. HOLLYWOOD, CA 90028 PHONE: (323) 469-7271

www.hornburgla.com



DONN DABNEY 255 W NAPA ST STE E SONOMA, CA 95476-6546

WORKORDER

PAGE 1

HOME: BUS:		CONT: 707- CELL: 707-		SER'	VICE ADVISOR:			RY	
COLOR	YEAR	MAKE/MODEL			VIN	LICENSE	MILE	AGE IN/ OUT	TAG
EBONY	06	JAGUAR XJ LW	В	SAJWA	79B16SH06738		11275	3/	T1668
DEL DATE	PROD	DATE WARR EXP.	PROMISI	ED .	PO NO.	RATE	PAYMENT	INV, I	DATE
18JAN07 DI R.O. OPEN 10AUG2015	VED	17JAN2011 READY	OPTION	S: ENG	:4.2_Liter_DO	0.00 DHC	CASH		
	DDE	TECH TYPE			NSTRUCTIONS			The state of the s	
A 99PJ		СJ	Multi-Po	int In	spection Jag	ıar		usret repair	AMOUNT
# B TP		CJ	CUSTOMER	STATE	S RESET ALL	TIRE PRE	ESSURES		

				*	(-
# C			DO 0	IL CHANGE	SERVICE
	$0.2^{\frac{1}{1000000000000000000000000000000000$	CJ	Y		
					444

SURE I METAIN	LAWILLIA PIL

The second second second second	
and a stage and having the court of a finished an interest entire and in	
	AMOUNT
CIL	
ATE	
taris.	
10.152. N. 1871	
GAL.	
CREASE	
LEG.	
SWOG. CERT.	
	AVENUE AND A
MISC.	
	a francisco francisco

	` (*		
TERMS CASH CREDIT CARD	I hereby authorize the repair work to be done along with the necessary material, and hereby grant you and/or your employees permission to operate the car or truck herein described on streets, highways or elsewhere for the purpose of testing and/or inspection, in the event of a teardown for inspection, I understand that my	PRELIMINARY ESTIMA AUTHORIZED BY X	TE \$ 175.00
CHECK [] (PRIOR APPROVAL) OTHER []	vehicle will be reassembled within days of the date shown above, unforessen complications not withstanding. If automobile is returned to customer before authorized service is performed, a diagnostic and handling charge will be made. If I choose not to authorize the services recommended. Customer agrees to pay any portion of repairs that are determined by the manufacturer as unwarrantable.	Revised Estimate PartsLabor Date Time	Totals Phone # _ FAX # BY
CALL WHEN READY YES DNO	conditions, i.e. accident damage, abuse, neglect or mileage discrepancy etc. YOU WILL BE ALLOWED TO COMPLETE ANY FACTORY AUTHORIZED WARRANTY REPAIRS OR SERVICES THAT ARE AT NO COST TO ME. I also authorize any sublet repairs that you deem necessary. CUSTOMER IS HEREBY NOTIFIED THAT THE	Revision Details Labor Labor	E-mail In Person Totals Phone #
ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE	SAID PROPERTY IS NOT INSURED OR PROTECTED AGAINST LOSS OCCASIONED BY THEFT, FIRE OR VANDALISM WHILE THE PROPERTY REMAINS WITH THE REPAIR GARAGE, NOTICE TO CONSUMER-PLEASE READ IMPORTANT INFORMATION ON REVERSE SIDE, CUSTOMER ACKNOWLEDGES RECEIPT OF A COPY HEREOF. SUBJECT TO CONDITIONS ON REVERSE SIDE OF THIS	Date Time Revision Details	FAX #BY
SAVE REMOVED PARTS FOR CUSTOMER U YES	OTHERWISE. SAVE DISCARD. CUST. SIGN.	"I acknowledge notice and oral approval of an increa	In Personse in the original estimated price

Notice to Consumer: Please read important information on back.

(Signature or initials)"

Steiner'S Auto & Custom Wiring Po Box 821 Sonoma CA 95476 7073634126

Cell: 1707-332-8331 Customer: , Left Coast Classics Address: Home: Work: 1707-996-8283 Vehicle: 2006 Jaguar XJ8 L Odometer: VIN: sajwa79b16sh06738 Tag: 7/30/2015 Created: Type Description Part No Condition Qty/Hrs Price Total CABIN AIR FILTER - R&R AII NOTE 1: Times shown DO NOT include recover, evacuate and charge system. If necessary to open refrigerant system; refer to Labor System Charge (Complete) for appropriate time.NOTE 2: Times 0.3 \$60.00 \$18.00 listed are for Factory and Dealer dash installed Integral Type air conditioning units only. Use necessary clock time for service of hang on units. DISC ROTOR - R&R Rear, Both, w/o Brembo Brakes Labor Includes: Replace pads if necessary. DOES NOT include 1.8 \$60.00 \$108.00 refinishing. UP **NPart** Brake Rotor Only - Rear - Ultra Premium 2 NEW \$59.34 \$118.68 880644 PartDisc Discount Returned Rotors 86840 2.0 -\$46.49 -\$92.98 Note: M - Labor Database, Copyright, Mitchell International, All Rights Reserved Supplies: \$5.00 HazMat: \$5.00 Tax: \$2.25 Total: \$163.95 request the return of replaced parts. Flat Rate/ Hourly Rate/ Both Apply If your vehicle is not picked up within 72 hours after completion of work performed, customer agrees to a daily storage fee of not more than \$50.00. Customer further agrees that the repair shop will not be liable for the vehicle or articles left in the vehicle in case of fire, theft, accidents or other causes beyond control. My vehicle may be driven by your employees for road testing at my risk. SIGNED

_____DATE____

Estimates are valid for 30 Days

Payment Type: CASH___CHECK__CHARGE__OTHER__

DIV



687 W. Napa St. Sonoma, CA 95476 www.sonomachevy.com Phone: (707) 996-2141 Toll Free: (877) 390-5573 Fax: (707) 996-5544 SERVICE DEPARTMENT HOURS 7:30 a.m. to 5:30 p.m. Monday - Friday R/O Open Date R/O Number

9/21/15 6043581/1

R/O Close Date Status

9/22/15 Pre-Invoice

Mileage In Mileage Out

114720 114721

Service Advisor / Tag #

		± 000315259		ISIDRO CALI	DERON/657	
LEFT COAST CLASSICS		Work Phone	Vehicle Identification Number			
	NAPA STREET			SAJWA79B:	16SH06738	
SONOM	A, CA 95476		Home Phone	Delivery Date	In-Service Date	
			707-332-8331			
Year	Make	Model	Body	Color	License Number	
2006	JAGUAR	XJ	4DR SDN XJ8 LWB	BLACK		

DESCRIPTION OF SERVICE AND PARTS	AMOUNT
Email: www.leftcoastclassics.com AR#: LEFT001	A company of the second company of the secon
#1 - SMOG: PERFORM SMOG CERTIFICATION INSPECTION Work performed by C PARRIERA (105) SMOG CERTIFICATE JOB COMPLETE- SMOG PASSED CERT #PW446960C Sub Total: 59.95	51.70 8.25
#2 - CARB: CHECK TIRE PRESSURES. SET TIRE PRESSURES TOMANUFACTURE SPECIFICATIONS. RESET TIRE PRESSUREMONITOR SYSTEM ON APPLICABLE MODELS AS PERCALIFORNIA AIR RESOURCES REQUIREMENTS.	

TERMS: STRICTLY CASH UNLESS ARRANGEMENTS ARE MADE. "I hereby authorize the repair work hereinafter to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in the vehicle in case of fire, theft, or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you or your employees permission to operate the vehicle herein described on streets, highways, or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto."

Sub Total: .00

DISCLAIMER OF WARRANTIES. Any warranties on the products sold hereby are those made by the manufacturer. The seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products. Any limitation contained herein does not apply where prohibited by law.

	LABOR	51.70	
	PARTS	8.25	
	DEDUCTIBLE	.00	
	SUBLET	.00	
	SHOP SUPPLIES	.00	
	HAZARDOUS MATERIALS		.00
j-	SALES TAX OR TAX I.D.	xxxH100	.00
	SPECIAL ORDER DEPOSIT	.00	
	DISCOUNTS		.00
	TOTAL DUE		59.95

NO RETURN ON ELECTRICAL OR SAFETY ITEMS OR SPECIAL ORDERS.

CO 2003 ARKONA, Inc. - Dealership Application Group (800)945-1028

Smog Check Vehicle Inspection Report (VIR)

Vehicle Information

Test Date/Time: 09/22/2015 @ 12:54 PM

Model Year:

2006

Vehicle Make:

JAGUAR

XJ8 L

VIN (scanned from vehicle):

SAJWA79B16SH06738

Vehicle Model:

License Plate: Fuel Type:

6SRL855 Gasoline

License State:

CA

Inspection Reason: Change of Ownership

Certification Type: California

Odometer:

114720

Overall Test Result

PASS

Congratulations! Your vehicle passed the Smog Check inspection, which helps California reach its daily goal of removing smog-forming emissions from the air. Thank you for keeping your vehicle well maintained.

Visual Inspection: PASS Functional Inspection: PASS

Smog Check Certificate Number: PW446960C

DMV ID Number: 3134W273P518

Your Smog Check certificate has been electronically transmitted to DMV.

Your certificate is valid for 90 days from date of issuance.

Please keep this copy for your records.

Visual Inspection Result Information

Result	Inspection Category	Result	Inspection Category
PASS	Air Injection System	PASS	Catalyst
PASS	Computers, Sensors, Switches, and Wiring	PASS	Crankcase Emission Controls
NOTAPPLICABLE	Exhaust Gas Recirculation (EGR)	PASS	Fuel Evaporative System (EVAP)
PASS	Fuel Metering System	PASS	Other Emission Related Components/Systems
NOTAPPLICABLE	Turbocharger/Supercharger	PASS	Vacuum Lines to Sensors/Switches

Emission Control Systems Functional Check Results

Result

PASS

Liquid Fuel Leak Check

Result PASS

OBDII

PASS

Smoke Check

Smog Check Inspection Station Information

Station ID:

RC249137

Inspector Name/ID:

Software Version/OIS ID:

PARREIRA, CHRISTOPHER/EO305972

SONOMA CHEVROLET

687 W NAPA STREET

SONOMA, CA 95476

(707) 996-2141

6.1.858.0/CV010231

I certify, under penalty of perjury, under the laws of the State of California, that I performed the inspection in accordance with all bureau requirements, and that the information listed on this vehicle inspection report is true and accurate.

Date

Luspector's Signature

1

189537

HORNBURG JAGUAR "The Oldest Jaguar Dealer in the West"

INVOICE



DONN DABNEY

255 W NAPA ST STE E

PAGE 1

1520 N. WILCOX AVE. · HOLLYWOOD, CA 90028 PHONE: (323) 469-7271

SONOMA, C.	A 954	76-6	546			PAGE 1		PHONE: (323) 469 www.hornburgla		
IOME:			CONT: 707-			RVICE ADVISOR:	10F T 7 E			
BUS:			CELL: 707-	-332-833	1 SEI		LICENSE	MILEAGE	IN / OUT	TAG
COLOR	YEAR		MAKE/MODEL			VIN	LICENOL			
								112753/	112753	T1668
EBONY	06	JAG	JUAR XJ LV	WB		A79B16SH06738	RATE I	PAYMENT	INV.	
DEL. DATE	PROD.	DATE	WARR. EXP.	PROM	MISED	PO NO.	NAIL	1717111-11		
DEL. DITTE	3.50.00							CASH	10AUG	15
LOTANOT F	T.		17JAN201	WAIT	10AUG15		0.00	CASH	TOAGG	13
8JAN07 D R.O. OPE			READY	OPTIO	NS: EI	G:4.2_Liter_I	OOHC			
H.O. 011	-INCO									
	*****	1-1	47 10ATG	15						TT 7\ T
9:47 10F	AUG15	TTT	:47 10AUG	72 1			LIS'	r NET	<u>l. 10</u>	TAL
THE OPCO	DE TI	SCH .	TYPE HOUR	amiar						
A Multi-F	Point	Insi	pection J	AGUAL MCEDN U7	G BEEN	DISCOVERED				
YSUS	SP A S	SUSPI	ENSTON CO	MCEKM LIV	TO DILL	THE NEAR				
	THA	r WI.	LL KEGUIK	E ATTENI	LTOM TIM	THE NEAR				
	FUT	JRE.						0.0		.00
		119	CJ		• 000110	n. 0.00	TOTAL	LINE A:	0	.00
PARTS:	0	.00	LABOR:	0.00) O.I.HF	R: 0.00	10111-			
112753 I	MPI M	PI					*****	****		
		***	******	*****	*****	******				
3 CUSTOM	ER ST	ATES	RESET AI	L TIRE	PRESSUR	ES ==aaiiDaa				
TP	CUSTO	MER	STATES RE	ESET ALL	TIRE P	RESSURES			(1)	1/C)
		119	TSPJ				TOTAL	TIME B.		0.00
PARTS:	0	0.0	TABOR:	0.0	O OTHE		TOTAL	יי ביייים		
110752			- T TO 0	1DTION /T	R32/RR3	2				
112/33	BCC P	***	******	*****	*****	******	*****		i.	
a no ott			SERVICE						1	
C DO OIL	CHAN	MED C	REQUESTS	OTT. AND	FILTER	CHANGE	Tar Facility	Z mi Hilliam		0.0
02	CUSIC	MEK	VEGOTOID	Total State of the	Telling In			23.0		3.00
	+6	119	CJS	LOTT TO			22.	20 22.2	30 2.	2.20
	1 C2C	[416]	L1 FILTER	-ULL CIME	פת נ		-13:	101		3.10
	1 JZF	11000	062 PLUG-0	UIL SUMP	, DK		8.	99 8.9	[1975] (1000 H.	1.92
			ASTROL GT	X 5W3U			13.	50 13.5	50 1	3.50
	1 BG		AON							
MISC OII	WAS!	ΓE						2.4		2.40
			CJS			n 2.40	TATOT	TITNE C:	14	6.12
PARTS:	120	0.72	LABOR:	23.0	0 O.I.H	ER: 2.40	101712			
112753	oil (Chan	ge Servic	e Perfor	cmed LO.	F Service	· · · · · · · · · · · · · · · · · · ·	****		
		***	*****	****			***************************************			
D** OXY	SENS	OR C	ODE SCAN	AND IDEN	NTIFY W	HAT ONE				
88	INST	PAN	EL					144.	00 14	4.00
00	11101	119	CT				HOMAT	LINE D:		4.00
PARTS:		0.00	LABOR:	144.0	OO OTH	ER: 0.00	TOTAL	TINE D.		
110000	a - 3 -	000	n 1 00 00	nnected	SDD an	d read all DT	C's. Sup	bried		
TTZ 122	f all									
сору о	ı uıı	***	*****	*****	*****	*****	*****	****		
							TO THE		т	OTALS
					1	STATEMENT OF DISCLAI	MFR D	ESCRIPTION		JIALS
						The factory warranty constitu	tes all LABOR	AMOUNT		
					vancous area one	of the warranties with respe	ect to DARTS	AMOUNT		

NOTICE TO CUSTOMERS WE MAKE A SEPARATE CHARGE FOR THE STORAGE AND DISPOSAL OF TOXIC WASTES. RATHER THAN RECOVER THESE COSTS BY INCREASEING OUR LABOR RATES TO ALL OF OUR SERVICE CUSTOMERS, WE MAK THIS CHARGE ONLY ON THOSE PARTICULAR REPAIRS OR SERVICES WHICH GENERATE THESE WASTES. THESE ARE UNIFORM CHARGES WHICH ARE CALCULATED ANNUALLY FOR EACH PARTICULAR SERVICE AND ARE AVAILABLE ON REPUIEST. REQUEST.

The tectory warranty constitutes all of the warranties with respect to the sale of this item/items. The Seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or titness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items. item/items.

CUSTOMER SIGNATURE

PARTS AMOUNT GAS, OIL, LUBE SUBLET AMOUNT MISC. CHARGES TOTAL CHARGES LESS INSURANCE SALES TAX PLEASE PAY THIS AMOUNT

Notice to Consumer: Please read important information on back.

BAR # ARD215465

EPA # CAL000223346

DONN DABNEY

189537

HORNBURG JAGUAR "The Oldest Jaguar Dealer in the West"

LAND= < ROVER

1520 N. WILCOX AVE. · HOLLYWOOD, CA 90028 PHONE: (323) 469-7271

www.hornburgla.com

NET

TOTAL

INVOICE

255 W NAPA ST STE E SONOMA, CA 95476-6546 HOME:

CONT:707-332-8331

CELL: 707-332-8331

SERVICE ADVISOR:

PAGE 2

105 LARRY JOHNSON

BUS: MILEAGE IN / OUT TAG LICENSE VIN MAKE/MODEL COLOR YEAR T1668 112753/112753 SAJWA79B16SH06738 JAGUAR XJ LWB 06 EBONY INV. DATE PAYMENT RATE PO NO. PROMISED WARR. EXP. PROD, DATE DEL. DATE 10AUG15 0.00 CASH WAIT 10AUG15 7JAN201 18JAN07 DD ENG:4.2 Liter DOHC OPTIONS:

READY R.O. OPENED

11:47 10AUG15 09:47 10AUG15

LINE OPCODE TECH TYPE HOURS EST: 175.00

SA: 105 10AUG15 09:47

CAR NEEDS AIR FILTER REPLACED NEEDS FRONT LOWER CONTROL ARMS REPLACED NEEDS POWER STEERING AND BRAKE FLUIDS REPLACED RECOMEND THROTTLE PLATE AND AIR MASS SENSOR CLE ANED





LIST

AUG 1 O PAID

NOTICE TO CUSTOMERS WE MAKE A SEPARATE CHARGE FOR THE STORAGE AND DISPOSAL OF TOXIC WASTES. RATHER THAN RECOVER THESE COSTS BY INCREASEING OUR LABOR RATES TO ALL OF OUR SERVICE CUSTOMERS, WE MAK THIS CHARGE ONLY ON THOSE PARTICULAR REPAIRS OR SERVICES WHICH GENERATE THESE WASTES. THESE ARE UNIFORM CHARGES WHICH ARE CALCULATED ANNUALLY FOR EACH PARTICULAR SERVICE AND ARE AVAILABLE ON DEPOLICET.

STATEMENT OF DISCLAIMER The factory warranty constitutes all of the warranties with respect to the sale of this item/items. The Seller hereby expressly disclaims all warranties either express or warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability to connection with the sale of this item/items.

CUSTOMER SIGNATURE

DESCRIPTION 167.00 LABOR AMOUNT 120.72 PARTS AMOUNT 0.00 GAS, OIL, LUBE SUBLET AMOUNT 0.00 2.40 MISC. CHARGES 290.12 TOTAL CHARGES 0.00 LESS INSURANCE 10.86 SALES TAX PLEASE PAY THIS AMOUNT 300.98

Notice to Consumer: Please read important information on back.

BAR # ARD215465

EPA # CAL000223346

TOTALS

Jaguar Multi-Point Inspection Report

Hornburg Jaguar La 1520 N. Wilcox Los Angeles, Ca, 90028 90069



The Jaguar Multi-Point Inspection is a series of thorough vehicle "health checks" and visual examinations performed by our factory-trained technicians. The focus of this complimentary service is to ensure that your Jaguar vehicle continues to perform at an optimum level, as well as to help minimize your chances of being inconvenienced while on the road.

In the event that additional service is recommended on a listed item, your Service Advisor will be happy to speak with you about service options.

mer Name 37 T1668 112753	Year/Model Engine Size	
97 T1660 119753	CA 114/470D4001100700	08/10/2015
07.1.000	SAJWA79B16SH06738 VIN	Date
g Mileage		ediate Attention
	Check Battery	
Check Fluid Levels and Fill OK FILL		
Engine Oil Brake Reservoir	Sood Recharge Bad	
Windshield Washer Headlamp Washer	Check Brakes	
Power Steering Coolant Recovery Reservoi	Moacure Front / Rear Brak	e Linings
Transmission (if equipped w/ dipstick)	RF &	RR 🖠 💿
Check Following Systems / Components		
 Operation of horn, interior lights, exterior lamps, turn signals, hazard and brake lamps 		
Visually inspect headlamp alignment		
Windshield washer spray, wiper operation and wiper blade	es	
Windshield cracks and/or chips		
Heating, ventilation and air conditioning check	Control of the Contro	
Engine air cleaner filter	15 %	IR A
Oil and/or fluid leaks	Lr w	LN 9
Constant velocity (CV) drive axle boots (if equipped)	Over 5mm or 7/32	AND DESCRIPTION OF THE PARTY OF
Exhaust system (leaks, damage, loose parts)	3 to 5mm or 4/32" to 5	7/32"
Steering and steering linkages	Less than 2mm or 3/	32"
Shocks/struts, air suspension and other suspension components for leaks and/or damage	Brake Measurements Not Taken This	s Service Visit
Brake system (including lines, hoses and parking brake)	Check Tires	
Engine cooling system, hoses and clamps	LF TREAD DEPTH	F
Radiator, heater and air conditioning hoses for leaks / dama		7/32" or Greater 4/32" to 6/32"
Accessory drive belt(s)	4/32" to 6/32" 3/32" or Less	3/32" or Less
Clutch operation (if equipped)	_ S/SZ OF Less	
Navigation map update required	7/32" or Greater	7/32" or Greater
State inspection due (if applicable) Month Day / Year	4/32" to 6/32" 3/32" or Less	4/32" to 6/32" 3/32" or Less
\bigcirc Your last completed maintenance $\frac{08}{100}$ Your last completed maintenance	5 LR Coor LF Wear Pattern / Damage	PE d
\bigcirc Your next factory scheduled maintenance is due at ${-}$ ${}$	LR Tire Wear Indicates	RR RR
is Courtesy Inspection Completed By Your Jaguar Service Tea	am	
ice Advisor: Larry Johnson	Tire Pressure Set to	nt 32 Rear
	*Brake/tire replacement will be required prior to the next 10,00	0 mile scheduled maintenance s
nician: Michael Johnson		Management in particular of the street of th

Comments:

Engine air cleaner filter: Air Filter Recommended

Your next factory scheduled maintenance is due at: 6 Months or 7,500 Miles from Now

Hornburg Jaguar La 1520 N. Wilcox Los Angeles, Ca, 90028 90069



Comments:	
Left Front Tread Depth: 10/32	
Right Front Tread Depth: 10/32	
Left Rear Tread Depth: 10/32	
Right Rear Tread Depth: 10/32	
Tilgrit Hear Head Boban 10/02	
	F 87
	6
	And the second s